





General information

Make	PEUGEOT
Model	307 SPORT HDI (136BHP)
Colour	Black
Year of manufacture	2005
Top speed	126 mph
0 - 60 mph	9.8 seconds
Gearbox	6 speed Manual

Engine & fuel consumption

Power	136 BHP
Max. torque	320 Nm at 2.000 rpm
Engine capacity	1.997 cc
Cylinders	4
Fuel type	Diesel
Consumption city	39.8 mpg
Consumption extra urban	62.8 mpg
Consumption combined	52.3 mpg
CO2 emission	142 g/km
CO2 label	F





MOT history

MOT expiry date	2021-09-27
MOT pass rate	59 %
MOT passed	13
Failed MOT tests	9
Total advice items	73
Total items failed	32

MOT #22	2020-09-28 11:40
MOT test number	233955462412
Result	✓ Passed
Next expiry date	2021-09-27
Advice Offside Front Track rod end ball joint has slight play (2.1.3 (b) (i))	
Minor Nearside Front Anti-roll bar linkage ball joint dust cover severely deteriorated (5.3.4 (b) (i))	





MOT #21		2019-09-23 15:21
MOT test	number	594062269920
Result		✓ Passed
Advice (i))	Offside Front Suspension arm pin or bush worn but not resulting in excessive	e movement (5.3.4 (a)
Advice	Nearside Rear tyre inner wall	
Advice	Offside indicator repeater outer lens missing	
Advice	Nearside Rear Coil spring corroded (5.3.1 (b) (i))	
Advice (a) (i))	Nearside Front Suspension arm pin or bush worn but not resulting in excession	ive movement (5.3.4
Advice	Nearside Non obligatory mirror damaged	
Advice	Oil leak, but not excessive (8.4.1 (a) (i))	
Advice	Rear shock absorbers upper dirt covers detached operation not affected	
Advice	Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 ((ii))
Advice	Add blue tank heat shield secured by cable ties	
Advice	Offside Rear Coil spring corroded (5.3.1 (b) (i))	



HY05VJM report date: 2024-03-28

MOT #20	2019-09-19 13:36
MOT test number	485107893946
Result	🗙 Failed
Advice Nearside Non obligatory mirror damaged	
Advice Offside Rear Coil spring corroded (5.3.1 (b) (i))	
Advice Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a)	(ii))
Advice Offside Front Suspension arm pin or bush worn but not resulting in excessive r (i))	novement (5.3.4 (a)
Pass with rectification Nearside Headlamp aim too low (4.1.2 (a))	
Fail Rear Seat belt buckle not functioning as intended centre (7.1.2 (d))	
Advice Rear shock absorbers upper dirt covers detached operation not affected	
Advice Nearside Rear Coil spring corroded (5.3.1 (b) (i))	
Advice Add blue tank heat shield secured by cable ties	
Advice Nearside Front Suspension arm pin or bush worn but not resulting in excessive (a) (i))	e movement (5.3.4
Advice Oil leak, but not excessive (8.4.1 (a) (i))	
Pass with rectification Offside Headlamp aim too low (4.1.2 (a))	
Advice Nearside Rear tyre inner wall	
Fail Nearside Front Tyre fouling a part of the vehicle fouling inner wheel arch (5.2.3 (f))))
Advice Offside indicator repeater outer lens missing	





MOT #19 2019-09-04 14:09
MOT test number 786134223543
Result × Failed
Fail Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
Advice Offside Front Suspension arm pin or bush worn but not resulting in excessive movement bushes (5.3.4 (a) (i))
Minor Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
Advice Slight Underbody corrosion
Fail Central Seat belt buckle not functioning as intended (7.1.2 (d))
Advice Offside side repeater lens missing
FailRear Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
Fail Offside Headlamp aim too low (4.1.2 (a))
Advice Nearside Non obligatory mirror damaged
FailNearside Track rod end ball joint worn to the extent there is a serious risk of detachment (2.1.3 (b)(ii))
Advice Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement bushes (5.3.4 (a) (i))
Fail Offside Rear Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
Fail Windscreen washer not working (3.5 (a))
Fail Front Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
Fail Nearside Headlamp aim projected beam image is obviously incorrect bulb in wrong (4.1.2 (c))
Advice Heat shield bent and loose
Advice Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))
Fail Offside Rear Road wheel badly distorted (5.2.2 (c) (i))



HY05	VJ	Μ
report date:	2024-	03-28

2017-09-07 08:58

MOT #18	2018-09-06 16:09
MOT test number	368396747728
Result	🗸 Passed
AdviceBrake pipe corroded, covered in grease or other material (1.1.11 (c))MinorNearside Obligatory mirror slightly damaged (3.3 (b) (i))	

MOT #17

MOT test	number	750262627049
Result		✓ Passed
Advice	Engine covers & undertrays fitted	
Advice	Offside Rear Nail in tyre	
Advice	Offside Rear Tyre worn close to the legal limit (4.1.E.1)	
Advice	Engine light on	

MOT #16	2017-08-31 12:13
MOT test number	567892310540
Result	🗙 Failed
Advice Engine covers & undertrays fitted	
FailOffside Rear position lamp(s) not working (1.1.A.3b)	
Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)	
Fail Offside Front Tyre not fitted in accordance with side wall instructions rotation (4.1.0	D.1f)
Fail Offside Front Anti-roll bar linkage has excessive play in a ball joint (2.4.G.2)	
Advice Engine light on	
Fail Nearside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)	
Advice Offside Rear Nail in tyre	





2016-08-05 11:58

MOT #15	2016-08-05 14:20
MOT test number	937360528629
Result	✓ Passed
Advice Engine lamp is on	
Advice Front brake fluctuating, but not excessively (3.7.B.3)	

MOT #14

MOT test	number
-----------------	--------

MOT test number	704970942383
Result	🗙 Failed
Fail Nearside Windscreen wiper does not clear the windscreen effectively (8.2.2)	
Advice Front brake fluctuating, but not excessively (3.7.B.3)	
FailOffside Headlamp not working on dipped beam (1.7.5a)	
Fail Nearside Rear Shock absorber has a serious fluid leak (2.7.3)	
Advice Engine lamp is on	

MOT #13	2015-09-01 14:14
MOT test number	737293442445
Result	✓ Passed
Advice Nearside Rear Shock absorber has a light misting of oil (2.7.3)	

MOT #12	2014-09-01 15:03	
MOT test number	939414144261	
Result	✓ Passed	
Advice Offside Front Anti-roll bar linkage ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)		
Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)		
Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)		





MOT #11	2014-09-01 15:03	
MOT test number	388144044293	
Result	× Failed	
Pass with rectification	Nearside Headlamp not working on dipped beam (1.7.5a)	
Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)		
Advice Offside Front Anti-roll bar linkage ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)		
Pass with rectification	Offside Front Direction indicator not working (1.4.A.2c)	
Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)		

MOT #10	2013-08-20 10:20
MOT test number	968592433210
Result	✓ Passed

MOT #9	20	13-08-20 10:20
MOT test number		637312733241
Result		🗙 Failed
Pass with rectification	Offside Headlamp aim beam image obviously incorrect (1.8.A.1b)	

MOT #8	2012-07-17 14:30
MOT test number	595249792152
Result	✓ Passed

MOT #7	2012-07-17 09:57	
MOT test number	488269892161	
Result	🗙 Failed	
Fail Nearside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)		
Advice Parking brake: parking brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7)		
Fail Offside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)		





MOT #6		2011-08-04 15:52
MOT test	number	109716111296
Result		✓ Passed
Notice	Offside front tyre cut in sidewall	
Notice	Both rear brakes slightly binding	
Notice	Both front wiper blades slightly smearing	
Notice	Offside rear caliper handbrake lever not returning to stop	
Notice	Offside front door hinges worn	

MOT #5		2011-07-29 16:10
MOT test	number	366300511267
Result		🗙 Failed
Notice	Both front wiper blades slightly smearing	
Notice	Offside rear caliper handbrake lever not returning to stop	
Notice	Offside front road spring contained within suspension leg but could com	e adrift so at present not
dangerous	5	
Notice	Offside front door hinges worn	
Fail N	earside Front coil spring fractured (2.4.C.1a)	
Notice	Offside front tyre cut in sidewall	
Notice	Both rear brakes slightly binding	
dangerous Notice Fail N Notice	Offside front door hinges worn earside Front coil spring fractured (2.4.C.1a) Offside front tyre cut in sidewall	e adrift so at present not

МОТ #4	2010-07-30 14:31
MOT test number	983811310224
Result	✓ Passed



HY05VJM
report date: 2024-03-28

MOT #3	2009-07-30 15:36
MOT test number	981781719210
Result	✓ Passed
Notice Rear brakes binding	
Advice Tyre worn close to the legal limit (4.1.E.1)	
Notice All 4 tyres age cracking and got cuts in treads	
MOT #2	2009-07-24 15:08
MOT test number	981395109230
Result	× Failed
Pass with rectification Offside Front Headlamp aim too high (1.8)	
FailNearside Rear coil spring fractured (2.4.C.1a)	
Notice All 4 tyres age cracking and got cuts in treads	
Advice Front brake juddering slightly (3.7.A.2b)	
Fail Side repeater incorrect colour (1.4.A.2f)	
FailBrake disc excessively pitted (3.5.1h)	
Notice Offside front wiper blade smearing windscreen	
Advice Tyre worn close to the legal limit (4.1.E.1)	

Nearside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)

Fail

MOT #1

Result

MOT test number

Notice Offside front and both rear brake binding

2008-03-10 10:20

294240378072

🗸 Passed



HY05VJM report date: 2024-03-28

Tax & MOT check

X Untaxed Tax expired: 31 January 2021	X MOT Expired: 27 September 2021
Tax status	Expired at 31 January 2021
Days left	1184 days too late
MOT expiry date	27 September 2021
Full MOT history	See MOT history
Tax calculation	

Vehicle class	49
Band	F
Single payment (12 months)	£ 200,00,-
Single six month payment	£ 110,00,-
Total payable by 12 monthly instalments	£ 210,00,-





Damage history

Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report <u>here</u> for the results.

Damage 1		
Date	le l	
Category		Appropriate
Туре		
Damage 2		AMPLE
	K	
Date		1.E
Category		AMP.
Туре		

Extra PEUGEOT salvage check

If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.





Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	6.00.000
Auction value	4 10.000
Average private trade value	4 11 711





Owner history

For how long did the current and previous owner(s) have this PEUGEOT? How many owners did this PEUGEOT have? Check it in the premium report and see all owner registrations. Download the full report <u>here</u>.

and and a second s	

	More info >
Plate changes	
See in this check if this PEUGEOT had different number plates.	
Number of plates	,
Current registration	
Plate since	
Current registration	
Plate since	





Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this PEUGEOT is financed.


Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	





Mileage check

Odometer	In miles
Mileage registrations	21
First mileage registration	2005-03-09
Last registration	2020-09-28
Complete history	See info

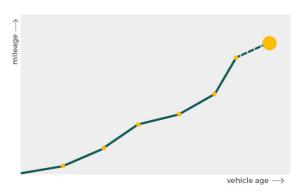

Registration #1	2005-03-09	18 mi
Registration #2	2008-03-10	18.594 mi
Registration #3	2009-07-24	24.750 mi
Registration #4	2009-07-30	24.787 mi
Registration #5	2010-07-30	27.321 mi
Registration #6	2011-07-29	29.796 mi
Registration #7	2011-08-04	29.809 mi
Registration #8	2012-07-17	35.298 mi
Registration #9	2012-07-17	35.301 mi
Registration #10	2013-08-20	45.941 mi
Registration #11	2014-09-01	52.946 mi
Registration #12		11.117 esi
Registration #13		11.112 esi
Registration #14		11.777 esi
Registration #15		11.777 esi
Registration #16		11.117 esi
Registration #17		11.117 esi
Registration #18		11.112 esi
Registration #19		11.117 esi
Registration #20		11.117 esi
Registration #21		11.777 esi

More info >





Car features

S0225	Air conditioning
S0295	
S0482	
\$0501	
S0566	
\$0567	
S0569	

Safety ratings

NCAP rating

Video

**** see crash video



Dimensions & weight	
Width	1746 mm
Height	1512 mm
Length	4202 mm
Wheel base	2608 mm
Kerb weight	1410 kg
Max. allowed weight	1816 kg
Additional information	
Fuel tank capacity	60 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats CarCheck.co.uk	5 page 17/17