





report date: 2024-03-29

General information

Make	PEUGEOT
Model	307 ALLURE COUPE CABRIOLET
Colour	Silver
Year of manufacture	2007
Top speed	119 mph
0 - 60 mph	12.7 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	107 BHP
Max. torque	147 Nm at 4.000 rpm
Engine capacity	1.587 cc
Cylinders	4
Fuel type	Petrol
Consumption city	27.7 mpg
Consumption extra urban	45.6 mpg
Consumption combined	37.2 mpg
CO2 emission	178 g/km
CO2 label	ı



CarCheck.co.uk page 1/18



Internet history

Entry 1


Date 2022-01-19

Pictures 19

Listing price <u>View report</u>





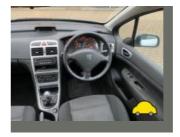



source: autotrader.co.uk

CarCheck.co.uk page 2/18



MOT history

MOT expiry date	2024-08-01
MOT pass rate	61 %
MOT passed	14
Failed MOT tests	9
Total advice items	50
Total items failed	33

MOT #23	2023-08-02 12:08
MOT test number	680807413298
Result	✓ Passed
Next expiry date	2024-08-01
Advice Front Anti-roll bar linkage ball joint has slight play Both sides (5.3.4 (a) (i))	

CarCheck.co.uk page 3/18



Advice

CV57GJY report date: 2024-03-29

MOT #22 2023-07-26 10:12

942032630498 **MOT** test number Result × Failed **Advice** Rear Brake pad(s) wearing thin (1.1.13 (a) (ii)) Fail Nearside Front Lower Suspension component ball joint excessively worn (5.3.4 (a) (i)) Nearside Headlamp aim too low (4.1.2 (a)) Fail Parking brake efficiency below requirements (1.4.2 (a) (i)) Fail **Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)) **Minor** Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i)) Nearside Track rod end ball joint has excessive play (2.1.3 (b) (i)) Fail Fail Brake pedal anti-slip provision missing (1.1.2 (c)) Fail Anti-lock braking system warning lamp indicates an ABS fault (1.6 (b))

Minor Nearside Rear Position lamp with a multiple light source up to 1/2 not functioning (4.2.1 (a) (i))

Offside Play in steering rack inner joint(s)

CarCheck.co.uk page 4/18



MOT #21 2023-07-26 10:02

MOT test number 199103252406

Result X Failed

Fail Nearside Front Lower Suspension component ball joint excessively worn (5.3.4 (a) (i))

Advice Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Advice Offside Play in steering rack inner joint(s)

Fail Nearside Headlamp aim too low (4.1.2 (a))

Minor Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Fail Nearside Track rod end ball joint has excessive play (2.1.3 (b) (i))

Fail Brake pedal anti-slip provision missing (1.1.2 (c))

Advice Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))

Fail Parking brake efficiency below requirements (1.4.2 (a) (i))

Minor Nearside Rear Position lamp with a multiple light source up to 1/2 not functioning (4.2.1 (a) (i))

MOT #20 2022-07-27 18:09

MOT test number 850088887389

Advice Offside Track rod end ball joint has slight play (2.1.3 (b) (i))

Advice Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))

Advice Steering rack has slight free play detected at steering wheel minor play rack knuckle ends (2.3 (a)

(i))

CarCheck.co.uk page 5/18



MOT #19 2022-07-27 18:09

MOT test number 678681869733

Result X Failed

Advice Offside Track rod end ball joint has slight play (2.1.3 (b) (i))

Pass with rectification Offside Windscreen washer provides insufficient washer liquid (3.5 (a))

Advice Steering rack has slight free play detected at steering wheel minor play rack knuckle ends (2.3 (a) (i))

Pass with rectification Nearside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))

Advice Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))

MOT #18 2022-01-13 12:26

MOT test number 568828974113

Result \(\sqrt{Passed} \)

MOT #17 2020-09-17 11:59

MOT test number 192660290153

Result \(\sqrt{Passed}\)

Advice Rear Exhaust mounting defective needs welding back on (6.1.2 (a))

Advice Front Brake pad(s) wearing thin 1/4 left on pads (1.1.13 (a) (ii))

Advice Play in steering rack inner joint(s) both n/s and o/s

Advice Oil leak, but not excessive slight gear box oil leak (8.4.1 (a) (i))

Advice Nearside Non obligatory mirror damaged cracked

Advice Front Exhaust has a minor leak of exhaust gases slight blow on front pipe joint (6.1.2 (a))

Advice Nearside Rear Child Seat fitted not allowing full inspection of adult belt

CarCheck.co.uk page 6/18



Result

CV57GJY report date: 2024-03-29

× Failed

MOT #16 2020-09-16 13:48

MOT test number 946721635379

Fail Nearside Headlamp not working on dipped beam (4.1.1 (a) (ii))

Advice Front Brake pad(s) wearing thin 1/4 left on pads (1.1.13 (a) (ii))

Advice Oil leak, but not excessive slight gear box oil leak (8.4.1 (a) (i))

Minor Battery insecure but not likely to fall from carrier (4.13 (a) (i))

Advice Nearside Rear Child Seat fitted not allowing full inspection of adult belt

Advice Rear Exhaust mounting defective needs welding back on (6.1.2 (a))

Fail Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))

Advice Play in steering rack inner joint(s) both n/s and o/s

Fail Nearside Rear Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))

Fail Nearside Rear Service brake excessively binding (1.2.1 (f))

Advice Nearside Non obligatory mirror damaged cracked

Advice Front Exhaust has a minor leak of exhaust gases slight blow on front pipe joint (6.1.2 (a))

MOT #15 2019-09-18 14:57

MOT test number 513146237107

Result \(\sqrt{Passed} \)

Advice Nearside Non obligatory mirror damaged

Advice Play in steering rack inner joint(s) Both sides

CarCheck.co.uk page 7/18



MOT #14 2019-09-18 13:04

MOT test number 422743919711

Result X Failed

Advice Nearside Non obligatory mirror damaged

Fail Nearside Rear Other passenger door cannot be opened from outside the vehicle (6.2.3 (a))

Advice Play in steering rack inner joint(s) Both sides

Fail Nearside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))

Fail Nearside Rear Coil spring fractured or broken (5.3.1 (b) (i))

MOT #13 2018-09-19 12:53

MOT test number 224646542081

Result \(\sqrt{Passed} \)

Advice Front Play in steering rack inner joint(s)

MOT #12 2018-09-18 16:08

MOT test number 580192876484

Result X Failed

Fail Nearside Front Wheel bearing has excessive play (5.1.3 (a) (i))

Fail Offside Rear Coil spring fractured or broken (5.3.1 (b) (i))

Advice Front Play in steering rack inner joint(s)

Fail Nearside Rear Stop lamp(s) all not working (4.3.1 (a) (iii))

Fail Front Windscreen washer provides insufficient washer liquid (3.5 (a))

Advice Front Brake fluid close to minimum mark (1.1.10 (d) (ii))

MOT #11 2017-09-16 09:34

MOT test number 221114161445

CarCheck.co.uk page 8/18



Fail

CV57GJY report date: 2024-03-29

MOT #10

MOT test number

849951852906

Result

Fail Anti-lock braking system warning lamp indicates an ABS fault (3.4.1c)

Fail Offside rear brake binding (3.7.B.1)

Fail Nearside rear brake binding (3.7.B.1)

Offside Track rod end ball joint has excessive play (2.2.B.1f)

MOT #9

MOT test number

Result

Advice Offside Track rod end ball joint has slight play (2.2.B.1f)

Advice Nearside Track rod end ball joint has slight play (2.2.B.1f)

MOT test number

219647520837

Result

Advice Steering system has slight free play detected at steering wheel suspect inner rack joints (2.2.A.1b)

Advice Offside Front Suspension arm rubber mounting deteriorated but not resulting in excessive movement (2.4.G.2)

Advice Nearside Front Suspension arm rubber mounting deteriorated but not resulting in excessive movement (2.4.G.2)

CarCheck.co.uk page 9/18



MOT #7 2015-09-15 13:47

MOT test number 246060199418

Result X Failed

Advice Steering system has slight free play detected at steering wheel suspect inner rack joints (2.2.A.1b)

Advice Offside Front Suspension arm rubber mounting deteriorated but not resulting in excessive movement (2.4.G.2)

Pass with rectification Windscreen washer provides insufficient washer liquid (8.2.3)

Advice Nearside Front Suspension arm rubber mounting deteriorated but not resulting in excessive movement (2.4.G.2)

Pass with rectification Nearside Rear passenger door cannot be opened from outside the vehicle (6.2.B.1c)

Pass with rectification Nearside Registration plate lamp not working (1.1.C.1d)

MOT #6 2014-09-12 11:32

MOT test number 429925454253

Result

Passed

Advice Nearside Front suspension has slight play in an outer ball joint (2.5.B.2a)

Advice Offside Front suspension has slight play in an outer ball joint (2.5.B.2a)

MOT #5 2013-09-06 16:16

MOT test number 106539443216

Result ✓ Passed

MOT #4 2013-09-06 13:12

MOT test number 138279443221

Result X Failed

Fail Offside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

Fail Nearside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

CarCheck.co.uk page 10/18



MOT #3	2012-09-05 10:25
MOT test number	365219642226
Result	✓ Passed
MOT #2	2011-09-06 10:38
MOT test number	155729641213
Result	✓ Passed
MOT #1	2010-08-27 12:10
MOT test number	560969530227
Result	✓ Passed
Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)	

CarCheck.co.uk page 11/18



Tax & MOT check



Tax status	Valid until 1 August
Days left	94
MOT expiry date	1 August 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	1
Single payment (12 months)	£ 320,00,-
Single six month payment	£ 176,00,-
Total payable by 12 monthly instalments	£ 336,00,-

CarCheck.co.uk page 12/18



Damage history

Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report here for the results.

Damage 1	
Date	
Category	
Туре	
Damage 2	
Date	
Category	
Type	



Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 13/18



Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 14/18



_		
Owne	 	
	ΙСΤ	nrv
	 IJL	

For how long did the current and previous owner(s) have this PEUGEOT? How many owner have? Check it in the premium report and see all owner registrations. Download the full is	
manus .	

manus .	

	More info >
Plate changes	
See in this check if this PEUGEOT had different number plates.	
Number of plates	,
Cornent registration	UK UK
Plate since	
Current registration	HK UK
Flate since	
	More info >

CarCheck.co.uk page 15/18



Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this PEUGEOT is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	

Contact info

More info >

CarCheck.co.uk page 16/18



Mileage check

Odometer	In miles
Mileage registrations	25
First mileage registration	2007-09-06
Last registration	2023-08-02
Complete history	See info



Registration #1	2007-09-06	7 mi
Registration #2	2010-08-27	29.799 mi
Registration #3	2011-09-06	38.189 mi
Registration #4	2012-09-05	48.263 mi
Registration #5	2013-09-06	53.969 mi
Registration #6	2013-09-06	53.969 mi
Registration #7	2014-09-12	59.053 mi
Registration #8	2015-09-15	64.491 mi
Registration #9	2015-09-15	64.491 mi
Registration #10	2016-09-14	69.669 mi
Registration #11	2017-09-12	73.608 mi
Registration #12	2017-09-16	73.608 mi
Registration #13	2018-09-18	78.254 mi
Registration #14		11.177 es
Registration #15		11.177 es
Registration #16		71.777 es
Registration #17		11.177 es
Registration #18		11.777 ea
Registration #19		11.777 es
Registration #20		11.777 es
Registration #21		11.777 ea
Registration #22		11.777 ea
Registration #23		11.777 es
Registration #24		11.777 es



Car features

S0225	Air conditioning
S0295	
50482	
50501	
50566	
S0567	
50569	

Safety ratings

NCAP rating	****
Video	see crash video



Dimensions & weight

Width	1757 mm
Height	1440 mm
Length	4357 mm
Wheel base	2605 mm
Kerb weight	1528 kg
Max. allowed weight	1850 kg

Additional information

Fuel tank capacity	60 I
Fuel delivery	Multi-Point Injection
Number of doors	2
Number of seats CarCheck.co.uk	4 page 18/18

Number of axles 2

Engine number FX7U3288774