





report date: 2024-03-28

General information

Make	FORD
Model	PUMA 16V
Colour	Silver
Year of manufacture	1999
Top speed	112 mph
0 - 60 mph	10.8 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	89 BHP
Max. torque	123 Nm at 4.000 rpm
Engine capacity	1.388 сс
Cylinders	4
Fuel type	Petrol
Consumption city	29.7 mpg
Consumption extra urban	47.9 mpg
Consumption combined	39.2 mpg



CarCheck.co.uk page 1/19



report date: 2024-03-28

Internet history

Entry 1

Date 2021-05-24

Pictures 9

Listing price <u>View report</u>









source: autotrader.co.uk

CarCheck.co.uk page 2/19



report date: 2024-03-28

MOT history

MOT expiry date	2022-12-09
MOT pass rate	64 %
MOT passed	16
Failed MOT tests	9
Total advice items	94
Total items failed	30

MOT #25	2021-12-10 19:00
MOT test number	589510179463
Result	✓ Passed
Next expiry date	2022-12-09
Advice Front Macpherson strut damaged but not seriously weakened x2 nsf o	sf (5.3.3 (b) (i))
Minor Nearside Front Track rod end ball joint dust cover damaged or deteriorating ingress of dirt (2.1.3 (g) (i))	ated, but preventing the
Advice Axle swivel pins and bushes swivel pin and/or bush slightly worn x2 (5	.1.2 (b) (i))
Advice Exhaust has a minor leak of exhaust gases backbox (6.1.2 (a))	
Minor Offside Front Anti-roll bar linkage ball joint dust cover severely deterior	rated (5.3.4 (b) (i))
Advice Power steering pump has slight seepage (2.1.5 (a))	
Advice Rear Exhaust mounting defective (6.1.2 (a))	

CarCheck.co.uk page 3/19



report date: 2024-03-28

MOT #24	2020-11-03 16:2
MOT test	number 69493633778
Result	✓ Passe
Advice	Brake pipe corroded, covered in grease or other material Bothside Front & Rear (1.1.11 (c))
Advice	Coil spring corroded Both Front & Rear (5.3.1 (b) (i))
Minor	Front Outer Drive shaft joint constant velocity boot severely deteriorated both side (6.1.7 (g) (i))
Advice	Nearside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
Advice	Rear exhaust silencer rubber mounts perished and splitting
Advice	Rear Service brake binding but not excessively both side (1.2.1 (f))
Advice	Spare tyre defective cracking
Advice (i))	Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a)
Advice	Both side Front top strut mount has play

MOT #23		2019-10-22 16:40
MOT test	number	165510933227
Result		✓ Passed
Advice	Spare tyre defective cracking	
Advice	Rear exhaust silencer rubber mounts perished and splitting	
Advice	Front Coil spring corroded both side (5.3.1 (b) (i))	
Advice (i))	Offside Front Suspension arm pin or bush worn but not resulting in excessive	ve movement (5.3.4 (a)
Advice	Front top strut mount has slight play both side	
Minor	Nearside Front Outer Drive shaft joint constant velocity boot severely deterior	orated (6.1.7 (g) (i))
Advice	Brake pipe corroded, covered in grease or other material Front and Rear (1	.1.11 (c))

CarCheck.co.uk page 4/19



report date: 2024-03-28

MOT #22 2018-10-30 16:54

MOT test number 682645447477

Result ✓ Passed

Advice Rear exhaust silencer rubber mounts perished and splitting

Advice Offside Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush

(5.3.4 (a) (i))

Advice Nearside Front top strut mount has play

Advice All metal brake pipes showing signs of corrosion

Advice Offside Rear Service brake binding but not excessively (1.2.1 (f))

Advice Offside Front top strut mount has play

MOT #21 2017-10-11 09:31

MOT test number 908779605865

Result ✓ Passed

Advice Front exhaust hanger corroded

Advice Nearside Front constant velocity joint is slightly worn (2.5.C.1b)

Advice Gearbox selector seal leaking

Advice O/s front inner wishbone bush coming away from unit.

Advice Power steering pipe(s) or hose(s) has slight seepage (2.3.3b)

MOT #20 2016-09-23 08:33

MOT test number 449767582312

Result ✓ Passed

CarCheck.co.uk page 5/19



report date: 2024-03-28

MOT #19 2016-09-14 16:02

MOT test number 636187505009

Result X Failed

Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

Advice Offside Rear tyre has cracking in tread area

Fail Offside Rear Suspension component mounting prescribed area is excessively corroded (2.4.A.3)

Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)

MOT #18 2015-10-09 14:35

MOT test number 508706487962

Result \(\sqrt{Passed} \)

Advice Offside Front Tyre worn close to the legal limit and worn on edges (4.1.E.1)

Advice Exhaust back box 2 of 3 rubber hangers snapped

Advice Suspension arm has slight play in a pin/bush NSR & OSR axle bushes (2.4.G.2)

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

Advice Rear tyres cracked and perished

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

Advice Engine management light does not illuminate

CarCheck.co.uk page 6/19



Fail

T854VWT

report date: 2024-03-28

MOT #17 2015-09-25 10:30

MOT test number 589978400688

Result X Failed

Fail Offside Front Seat belt anchorage prescribed area is excessively corroded outer sill (5.2.6)

Advice Offside Front Tyre worn close to the legal limit and worn on edges (4.1.E.1)

Fail Offside Windscreen wiper does not clear the windscreen effectively (8.2.2)

Advice Rear tyres cracked and perished

Advice Suspension arm has slight play in a pin/bush NSR & OSR axle bushes (2.4.G.2)

Fail Front brake application uneven (3.7.B.2)

Fail Offside Rear Seat belt anchorage prescribed area is excessively corroded outer sill (5.2.6)

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

Advice Engine management light does not illuminate

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

Fail Headlamp excessively deteriorated so that the light output is severely reduced NS & OS (1.7.5a)

Advice Exhaust back box 1 of 3 rubber hangers snapped

Nearside Rear Seat belt anchorage prescribed area is excessively corroded outer sill (5.2.6)

CarCheck.co.uk page 7/19



report date: 2024-03-28

× Failed

MOT #16 2014-09-25 13:01

MOT test number 995908564294

Result ✓ Passed

Notice Outer sills corroded

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

Notice Engine management light does not illuminate

Advice Headlamp deteriorated but light output not reduced (1.7.5a)

Notice Wipers starting to smear

Result

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #15 2014-09-24 10:28

MOT test number 277217464271

Fail Nearside Rear Shock absorber has an excessively worn bush (2.7.4)

Advice Headlamp deteriorated but light output not reduced (1.7.5a)

Notice Engine management light does not illuminate

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

Fail Offside Rear Brake pipe seriously damaged (found during steering lock to lock check) (2.2.D.2b)

Notice Wipers starting to smear

Fail Offside Rear Shock absorber has an excessively worn bush (2.7.4)

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

Notice Outer sills corroded

CarCheck.co.uk page 8/19



report date: 2024-03-28

MOT #14 2013-09-27 16:57

MOT test number 768230773234

Result ✓ Passed

Notice Wipers starting to smear

Notice Rear view mirror loose

Notice OS outer sill corroded

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #13 2013-09-27 10:28

MOT test number 786120773209

Result X Failed

Fail Offside rear parking brake recording little or no effort (3.7.B.6a)

Fail Nearside Rear Suspension arm has excessive play in a pin/bush (2.4.G.2)

Notice Rear view mirror loose

Fail Nearside Rear Brake hose excessively deteriorated (3.6.B.4d)

Notice OS outer sill corroded

Fail Parking brake: efficiency below requirements (3.7.B.7)

Fail Nearside rear parking brake recording little or no effort (3.7.B.6a)

Advice Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

Fail Nearside Headlamp aim too low (1.8)

Fail Offside Rear Suspension arm has excessive play in a pin/bush (2.4.G.2)

Notice Wipers starting to smear


Fail Offside Rear Brake hose excessively deteriorated (3.6.B.4d)

Advice Offside Front Brake pipe slightly corroded (3.6.B.2c)

CarCheck.co.uk page 9/19



report date: 2024-03-28

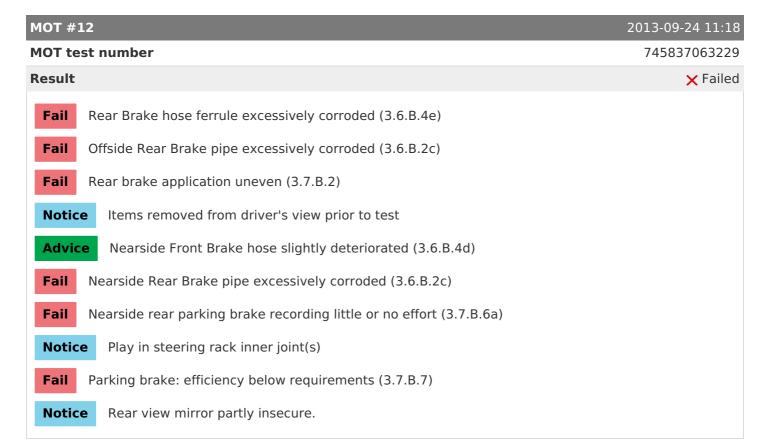

MOT #11	L 20)12-09-27 11:05
MOT test	number	407141872266
Result		✓ Passed
Advice (2.4.G.2)	,	sive movement
Advice	Offside Rear Brake pipe slightly corroded (3.6.B.2c)	
Advice (2.4.G.2)	·	'e movement

CarCheck.co.uk page 10/19



report date: 2024-03-28

MOT #10 2012-09-21 17:25

MOT test number 828985862257

Result X Failed

Advice Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

Advice Offside Rear Brake pipe slightly corroded (3.6.B.2c)

Fail Nearside Rear Tyre has a lump, caused by separation or partial failure of its structure (4.1.D.1b)

Advice Offside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2,4,G,2)

MOT #9 2011-09-27 11:59

MOT test number 255240571201

Result
✓ Passed

Notice Fuel tank corroded near filler pipe.

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

MOT #8 2011-09-26 12:02

MOT test number 448869461260

Result X Failed

Notice Fuel tank corroded near filler pipe.

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

Fail Offside Front Brake hose excessively deteriorated (3.6.B.4d)

MOT #7 2010-09-29 10:46

MOT test number 860432870262

Result \(\sqrt{Passed} \)

Advice Offside Front Brake hose slightly deteriorated (3.6.B.4d)

CarCheck.co.uk page 11/19



report date: 2024-03-28

MOT #6 2009-09-25 11:05

MOT test number 320768069452

Result ✓ Passed

Advice Nearside Front Lower Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

MOT #5 2009-09-23 11:54

MOT test number 880596569233

Result X Failed

Advice Nearside Front Lower Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

Fail Parking brake: efficiency below requirements (3.7.B.7)

MOT #4 2008-10-06 10:43

MOT test number 374830088401

Notice Offside front tyre tread cracking slightly

Advice Offside Front Brake hose slightly deteriorated (3.6.B.4d)

MOT #3 2007-10-25 09:25

MOT test number 494948597221

Advice Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement

(2.4.G.2)

CarCheck.co.uk page 12/19



report date: 2024-03-28

MOT #2 2007-10-20 10:29

MOT test number 624693297206

Result X Failed

Fail Rear Exhaust system not adequately supported (7.1.1)

Fail Nearside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

Fail Offside Front Suspension arm rubber bush deteriorated resulting in excessive movement (2.4.G.2)

Advice Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

MOT #1 2006-10-28 15:42

MOT test number 504161306374

CarCheck.co.uk page 13/19



T854VWT report date: 2024-03-28

Tax & MOT check



X MOT

Expired: 9 December 2022

Tax status Expired at 22 July 2022

Days left 647 days too late

MOT expiry date 9 December 2022

Full MOT history See MOT history

CarCheck.co.uk page 14/19



report date: 2024-03-28

Damage history

Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report <u>here</u> for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 15/19



T854VWT report date: 2024-03-28

Owner history	
For how long did the current and previous owner(s) have this FORD? How many owners d Check it in the premium report and see all owner registrations. Download the full report h	
processor .	

	More info >
Plate changes	
See in this check if this FORD had different number plates.	
Number of plates	,
Current registration	OK SIES
Flate since	
Current registration	NK SIE
Plate since	
	More info >

CarCheck.co.uk page 16/19



report date: 2024-03-28

Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this FORD is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

More info >


CarCheck.co.uk page 17/19



T854VWT report date: 2024-03-28

Mileage check

Odometer	In miles
Mileage registrations	27
First mileage registration	1999-03-25
Last registration	2021-12-10
Complete history	See info

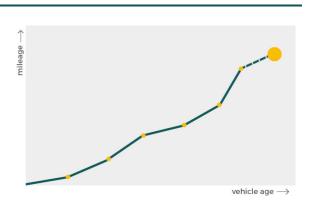

Registration #1	1999-03-25	21 mi
Registration #2	2006-10-28	56.144 mi
Registration #3	2007-10-20	59.424 mi
Registration #4	2007-10-25	59.463 mi
Registration #5	2008-10-06	62.615 mi
Registration #6	2009-09-23	65.532 mi
Registration #7	2009-09-25	65.561 mi
Registration #8	2010-09-29	68.799 mi
Registration #9	2011-09-26	71.800 mi
Registration #10	2011-09-27	71.808 mi
Registration #11	2012-09-21	74.764 mi
Registration #12	2012-09-27	74.764 mi
Registration #13	2013-09-24	77.751 mi
Registration #14	2013-09-27	77.791 mi
Registration #15		11.777 es
Registration #16		11.777 es
Registration #17		11.777 es
Registration #18		11.777 es
Registration #19		11.777 es
Registration #20		11.777 es
Registration #21		11.777 es
Registration #22		11.777 es
Registration #23		11.777 es
Registration #24		11.777 es
Registration #25		11.777 es
Registration #26		n.m 44
CarCheck.co.uk		page 18/19

More info >



report date: 2024-03-28

Car features

50225	Air conditioning
50295	
50482	
50501	
50566	
60567	
50569	

Safety ratings

NCAP rating	****
Video	see crash video



Dimensions & weight

Width	1837 mm
Height	1344 mm
Length	3984 mm
Wheel base	2446 mm
Kerb weight	1035 kg

Additional information

Fuel tank capacity	42 l
Fuel delivery	Multi-Point Injection
Number of doors	3
Engine number	XY65472

CarCheck.co.uk page 19/19