



RENAULT



report date: 2024-03-28

General information

Make	RENAULT
Model	TRAFIC SL27DCI 100 SWB P/V
Colour	White
Year of manufacture	2004
Top speed	97 mph
Gearbox	6 speed Manual

Engine & fuel consumption

Power	100 BHP
Max. torque	240 Nm at 2.000 rpm
Engine capacity	1.870 cc
Cylinders	4
Fuel type	Diesel
Consumption city	31.7 mpg
Consumption extra urban	43.5 mpg
Consumption combined	38.2 mpg




LABEL UNKNOWN



Internet history

Entry 1

Date	2021-08-27
Pictures	3
Listing price	View report

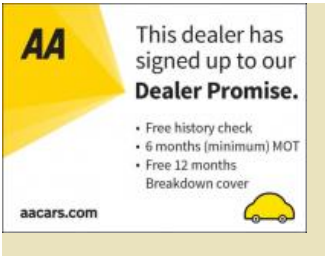

source: cargurus.co.uk



MOT history

MOT expiry date	2025-01-18
MOT pass rate	63 %
MOT passed	17
Failed MOT tests	10
Total advice items	122
Total items failed	46

MOT #27	2024-01-19 16:14
MOT test number	977355617121
Result	✓ Passed
Next expiry date	2025-01-18
Advice	Nearside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))
Advice	Nearside Front steering rack gaiter badly twisted
Advice	Oil leak, but not excessive engine (8.4.1 (a) (i))
Advice	Offside Front Shock absorbers has light misting of oil (5.3.2 (b))
Advice	Steering rack has slight free play detected at steering wheel (2.3 (a) (i))
Advice	Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))
Advice	Offside Front steering rack gaiter badly twisted
Advice	Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))



MOT #26

2024-01-19 16:14

MOT test number

967503302537

Result		✗ Failed
Advice	Oil leak, but not excessive engine (8.4.1 (a) (i))	
Advice	Offside Front Shock absorbers has light misting of oil (5.3.2 (b))	
Advice	Nearside Front steering rack gaiter badly twisted	
Advice	Steering rack has slight free play detected at steering wheel (2.3 (a) (i))	
Advice	Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))	
Advice	Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))	
Pass with rectification	Offside Headlamp aim too low (4.1.2 (a))	
Advice	Offside Front steering rack gaiter badly twisted	
Advice	Nearside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))	



MOT #25

2023-10-11 09:24

MOT test number

925621779970

Result		✗ Failed
Fail	Central Upper Stop lamp(s) not working (4.3.1 (a) (ii))	
Advice	Nearside Front steering rack gaiter very badly twisted	
Advice	Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))	
Minor	Offside Headlamp lens slightly defective (4.1.1 (b) (i))	
Advice	Oil leak, but not excessive engine (8.4.1 (a) (i))	
Fail	Rear fog lamp not working (4.5.1 (a) (ii))	
Fail	Offside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))	
Fail	Steering rack has excessive free play detected at the steering wheel (steering rack fitted) (2.3 (a) (i))	
Minor	Nearside Headlamp lens slightly defective (4.1.1 (b) (i))	
Advice	Offside Front steering rack gaiter very badly twisted	
Advice	Offside Front Shock absorbers has light misting of oil (5.3.2 (b))	
Fail	Hazard warning lamps inoperative (4.4.1 (e))	



MOT #24

2022-09-02 12:00

MOT test number

383373386859

Result

✓ Passed

- Advice

Offside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Minor

Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Advice

Offside Front Play in steering rack inner joint(s)
- Advice

Power steering component has slight seepage from a component steering pump (2.1.5 (a))
- Advice

Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Advice

Nearside Front Play in steering rack inner joint(s)
- Advice

Oil leak, but not excessive (8.4.1 (a) (i))
- Advice

Front Exhaust has a minor leak of exhaust gases flexi (6.1.2 (a))

**MOT #23**

2022-08-31 10:53

MOT test number

227379879286

Result**✗ Failed**

- Fail** Nearside Rear Parking brake inoperative on one side (1.4.1 (a))
- Advice** Offside Front Play in steering rack inner joint(s)
- Fail** Nearside Front Anti-roll bar pin or bush excessively worn (5.3.4 (a) (i))
- Advice** Offside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Fail** Nearside Front Position lamp not working (4.2.1 (a) (ii))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Fail** Nearside Front Macpherson strut top bush or bearing has excessive wear or free play (5.3.4 (a) (i))
- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))
- Advice** Front Exhaust has a minor leak of exhaust gases flexi (6.1.2 (a))
- Fail** Nearside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))
- Advice** Nearside Front Play in steering rack inner joint(s)
- Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Fail** Offside Front Inner Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
- Fail** Offside Front Anti-roll bar pin or bush excessively worn (5.3.4 (a) (i))
- Advice** Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Fail** Offside Front Position lamp light intensity significantly reduced (4.2.3 (a) (ii))
- Advice** Power steering component has slight seepage from a component steering pump (2.1.5 (a))
- Fail** Offside Front Macpherson strut top bush or bearing has excessive wear or free play (5.3.4 (a) (i))
- Advice** Brake hydraulic reservoir close to minimum mark (1.1.10 (d) (i))
- Fail** Nearside Rear Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
- Fail** Central Stop lamp(s) not working (4.3.1 (a) (ii))
- Fail** Parking brake efficiency below requirements (1.4.2 (a) (i))



MOT #222021-05-04 10:59

MOT test number325955496576

Result✓ Passed

- Advice** Nearside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Minor** Offside Obligatory mirror slightly damaged (3.3 (b) (i))
- Advice** Front Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Fluid leak, but not excessive Power steering pump (8.4.1 (a) (i))
- Advice** Nearside Play in steering rack inner joint(s)

**MOT #21**

2021-04-30 10:46

MOT test number

661746550617

Result**✗ Failed**

- Fail** Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Fail** Offside Rear Coil spring fractured or broken (5.3.1 (b) (i))
- Fail** Offside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))
- Advice** Nearside Play in steering rack inner joint(s)
- Advice** Front Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Fail** Central Stop lamp(s) not working (4.3.1 (a) (ii))
- Advice** Fluid leak, but not excessive Power steering pump (8.4.1 (a) (i))
- Fail** Nearside Front Upper Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Fail** Nearside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))
- Advice** Nearside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))
- Advice** Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Fail** Windscreen washer not working Both (3.5 (a))
- Minor** Offside Obligatory mirror slightly damaged (3.3 (b) (i))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))

**MOT #20**

2020-06-02 17:45

MOT test number

682278272950

Result

✓ Passed

- Advice** Nearside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Nearside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
- Advice** Offside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))

MOT #19

2020-06-02 17:45

MOT test number

418584278054

Result

✗ Failed

- Advice** Offside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))
- Pass with rectification** Offside Rear Position lamp adversely affected by the operation of another lamp (4.2.3 (c))
- Pass with rectification** Offside Front Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))
- Pass with rectification** Windscreen washer provides insufficient washer liquid (3.5 (a))
- Advice** Nearside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))
- Pass with rectification** Offside Front Position lamp not working (4.2.1 (a) (ii))
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Pass with rectification** Supplementary restraint system warning lamp indicates a fault (7.1.6 (a))
- Advice** Nearside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))



MOT #18

2019-03-06 11:17

MOT test number

673875112075

Result

✓ Passed

- Advice** Nearside Play in steering rack inner joint(s)
- Advice** Fuel flap damaged but still functions
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Offside Front Road wheel slightly distorted (5.2.2 (c) (i))
- Advice** Nearside Rear light lens edges covered with tape
- Minor** Offside Obligatory mirror slightly damaged lens cracked but not restricting view (3.3 (b) (i))
- Advice** Front Brake disc worn, pitted or scored, but not seriously weakened and rears (1.1.14 (a) (ii))

MOT #17

2019-03-06 09:21

MOT test number

887822557439

Result

✗ Failed

- Fail** Windscreen washer not working (3.5 (a))
- Advice** Fuel flap damaged but still functions
- Advice** Offside Front Road wheel slightly distorted (5.2.2 (c) (i))
- Minor** Offside Obligatory mirror slightly damaged lens cracked but not restricting view (3.3 (b) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Fail** Offside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))
- Advice** Nearside Play in steering rack inner joint(s)
- Advice** Nearside Rear light lens edges covered with tape
- Advice** Front Brake disc worn, pitted or scored, but not seriously weakened and rears (1.1.14 (a) (ii))



MOT #162018-02-09 10:35

MOT test number493083396511

Result✓ Passed

- Advice** Offside Front Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
- Advice** Steering system has slight free play detected at steering wheel poss cause inner rack joints worn (2.2.A.1b)
- Advice** Offside Front Non obligatory mirror damaged cracked class
- Advice** Washer filler cap missing
- Advice** Vehicles internal headlight adjuster altered to recheck lights both were low
- Advice** Spare tyre defective
- Advice** Both rear tyres worn on edges n/s also perished
- Advice** Front Play in steering rack inner joint(s) n/s and o/s close to excess

**MOT #15**

2018-02-07 11:15

MOT test number

978086653828

Result**✗ Failed**

- Advice** Rear Brake pad(s) wearing thin n/s and o/s (3.5.1g)
- Advice** Steering system has slight free play detected at steering wheel poss cause inner rack joints worn (2.2.A.1b)
- Advice** Vehicles internal headlight adjuster altered to recheck lights both were low
- Advice** Offside Front Non obligatory mirror damaged cracked class
- Advice** Both rear tyres worn on edges n/s also perished
- Fail** Offside Front Upper Anti-roll bar linkage ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt (2.4.G.2)
- Advice** Power steering pump drivebelt perished and poor condition
- Pass with rectification** Nearside Headlamp aim too high (1.8)
- Fail** Offside Front Lower Suspension arm has excessive play in a ball joint outer (2.4.G.2)
- Fail** Nearside Rear Body has a sharp edge caused by damage light lens broken (6.1.C.1)
- Fail** Central Registration plate lamp not working (1.1.C.1d)
- Advice** Spare tyre defective
- Advice** Offside Front Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
- Advice** Front Play in steering rack inner joint(s) n/s and o/s close to excess
- Fail** Nearside Rear position lamp(s) not working (1.1.A.3b)
- Advice** Washer filler cap missing
- Fail** Nearside Front Lower Suspension arm has excessive play in a ball joint outer (2.4.G.2)
- Fail** Hazard warning switch faulty ign on or off very intermittent not reliable (1.4.B.1d)

**MOT #14** 2017-01-12 13:03**MOT test number** 310317888463**Result** ✓ Passed

- Advice** Slight play in n/s steering rack inner ball joint
- Advice** O/s wiper arm parking on scuttle panel
- Advice** Both front wheel arch liners missing
- Advice** Air filter box insecure
- Advice** O/s/f lower suspension arm ball joint dust cover split
- Advice** Slight play in both front lower suspension arm ball joints
- Advice** Front and rear brake pads slightly worn
- Advice** N/s/r light lens damaged and temporarily repaired
- Advice** N/s/r tyre worn on edges
- Advice** Driver seat worn
- Advice** O/s/f tyre worn close to the legal limit and heavily worn on inner edge

MOT #13 2015-12-19 13:03**MOT test number** 180816556103**Result** ✓ Passed

- Advice** Slight play in both inner rack joints

MOT #12 2015-01-13 08:21**MOT test number** 227143015049**Result** ✓ Passed

- Notice** Play in steering rack inner joint(s)

**MOT #11** 2015-01-12 12:40**MOT test number** 485312715055**Result** ✗ Failed**Fail** Offside Front Suspension arm has excessive play in a ball joint (2.4.G.2)**Notice** Play in steering rack inner joint(s)**MOT #10** 2013-11-27 09:40**MOT test number** 977231233331**Result** ✓ Passed**Advice** Offside Inner Steering pivot point has slight play (2.2.B.1g)**Advice** Nearside Inner Steering pivot point has slight play (2.2.B.1g)**MOT #9** 2012-12-18 10:31**MOT test number** 876353852393**Result** ✓ Passed**Notice** Play in steering rack inner joint(s)**Advice** Offside Front Anti-roll bar has slight play in a ball joint (2.4.G.2)**Notice** Glow plug light on**Advice** Nearside Front Anti-roll bar has slight play in a ball joint (2.4.G.2)

**MOT #8** 2011-12-29 11:35**MOT test number** 348083861320**Result** ✓ Passed**Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**Notice** Both front tyres getting low**Advice** Offside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**Notice** Centre brake light not working**Notice** Slight play in both inner rack ends**MOT #7** 2010-12-22 11:31**MOT test number** 271796050304**Result** ✓ Passed**MOT #6** 2010-12-21 14:39**MOT test number** 673205250321**Result** ✗ Failed**Fail** Nearside Front Track rod end ball joint has excessive play (2.2.B.1f)**Fail** Offside Front Track rod end ball joint has excessive play (2.2.B.1f)**MOT #5** 2009-12-18 12:02**MOT test number** 461592159426**Result** ✓ Passed**MOT #4** 2009-06-12 08:10**MOT test number** 262803469192**Result** ✓ Passed**Advice** Steering system has slight free play detected at steering wheel (2.2.A.1b)



MOT #3	2009-06-11 09:49
MOT test number	501472969146
Result	✗ Failed
Advice	Steering system has slight free play detected at steering wheel (2.2.A.1b)
Fail	Offside Rear reflector missing (1.5.1a)

MOT #2	2008-06-16 15:57
MOT test number	251368468111
Result	✓ Passed

MOT #1	2007-06-21 14:51
MOT test number	352722477111
Result	✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 March 2025

✓
MOT
Expires:
18 January 2025

Tax status		Valid until 1 March
Days left		307
MOT expiry date		18 January 2025
Full MOT history		See MOT history



Damage history

Check the damage history for this RENAULT. See if, where and when this RENAULT had damage and the car repair costs. We also check if this RENAULT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra RENAULT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Owner history

For how long did the current and previous owner(s) have this RENAULT? How many owners did this RENAULT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this RENAULT had different number plates.

Number of plates	1
Current registration	XXXXXX
Plate since	2019-01-01
Current registration	XXXXXX
Plate since	2019-01-01

More info >



Finance check

Check if this RENAULT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this RENAULT has been settled.

If not, and you buy this RENAULT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this RENAULT is financed.

Finance company	REDACTED	REDACTED
Date of agreement	REDACTED	REDACTED
Agreement type	REDACTED	REDACTED
Agreement term	REDACTED	REDACTED
Agreement number	REDACTED	REDACTED
Contact info	REDACTED	REDACTED

More info >



Mileage check

Odometer	In miles
Mileage registrations	29
First mileage registration	2004-07-08
Last registration	2024-01-19
Complete history	See info



Registration #1	2004-07-08	19 mi
Registration #2	2007-06-21	16.074 mi
Registration #3	2008-06-16	20.717 mi
Registration #4	2009-06-11	28.462 mi
Registration #5	2009-06-12	28.462 mi
Registration #6	2009-12-18	38.061 mi
Registration #7	2010-12-21	48.369 mi
Registration #8	2010-12-22	48.388 mi
Registration #9	2011-12-29	54.987 mi
Registration #10	2012-12-18	59.688 mi
Registration #11	2013-11-27	64.548 mi
Registration #12	2015-01-12	69.936 mi
Registration #13	2015-01-13	69.986 mi
Registration #14	2015-12-19	74.634 mi
Registration #15	2017-01-12	80.594 mi
Registration #16	2019-05-20	95.277 mi
Registration #17	2019-05-20	95.277 mi
Registration #18	2019-05-20	95.277 mi
Registration #19	2019-05-20	95.277 mi
Registration #20	2019-05-20	95.277 mi
Registration #21	2019-05-20	95.277 mi
Registration #22	2019-05-20	95.277 mi
Registration #23	2019-05-20	95.277 mi
Registration #24	2019-05-20	95.277 mi
Registration #25	2019-05-20	95.277 mi
Registration #26	2019-05-20	95.277 mi

Registration #27	2025-25-25	25,252,442
Registration #28	2025-25-25	25,252,442
Registration #29	2025-25-25	25,252,442

More info >



Car features

The RENAULT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete RENAULT factory list for this vehicle [here](#).

More info >

Dimensions & weight

Width	2232 mm
Height	1959 mm
Length	4782 mm

Additional information

Fuel tank capacity	90 l
Fuel delivery	Direct Injection
Number of doors	4
Number of seats	3
Engine number	C334563