



report date: 2025-02-13

General information

Make	FIAT
Model	KNAUS MOTORHOME OTHERS
Colour	White
Year of manufacture	2001
Gearbox	-MANUAL

Engine & fuel consumption

Engine capacity	2.800 cc
Fuel type	Diesel



LABEL UNKNOWN



Internet history

Entry 1

Date	2022-01-29
Pictures	4
Listing price	View report



source: cargurus.co.uk



MOT history

MOT expiry date	2025-05-21
MOT pass rate	58 %
MOT passed	19
Failed MOT tests	14
Total advice items	130
Total items failed	80

MOT #33 2024-05-22 15:26

MOT test number 586057539075

Result ✔ Passed

Next expiry date 2025-05-21

Advice Central Rear Exhaust mounting defective mounting rubber perishing (6.1.2 (a))

Advice Offside Rear light cluster lens cracked



MOT #32	2024-04-13 09:37
MOT test number	497001288524
Result	✗ Failed

Fail Nearside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

Fail Nearside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))

Fail Nearside Front Position lamp not working (4.2.1 (a) (ii))

Fail Horn not working (7.7 (a))

Fail Offside Rear Outline marker lamp does not illuminate simultaneously with the position lamps (4.2.2 (a))

Fail Nearside Rear Position lamp adversely affected by the operation of another lamp (4.2.3 (c))

Minor Nearside Rear Position lamp insecure (4.2.1 (c) (i))

Fail Offside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))

Advice Offside Front Service brake fluctuating, but not excessively (1.2.1 (e))

Advice Central Rear Exhaust mounting defective Rubber mountings perished (6.1.2 (a))

Minor Nearside Rear Direction indicator insecure (4.4.1 (c) (i))

Fail Offside Rear Service brake excessively fluctuating (1.2.1 (e))

Fail Offside Front Outer Integral body structure corroded to the extent that the rigidity of the assembly is significantly reduced Step/Sill (6.1.1 (c) (i))

Fail Nearside Rear Position lamp not working (4.2.1 (a) (ii))

Fail Offside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

Fail Offside Front Outline marker lamp does not illuminate simultaneously with the position lamps (4.2.2 (a))

Fail Nearside Stop lamp(s) not working (4.3.1 (a) (ii))

Minor Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Fail Nearside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))

Fail Nearside Front Service brake excessively fluctuating (1.2.1 (e))

Fail Nearside Rear Direction indicator not working (4.4.1 (a) (ii))

Fail Offside Rear Position lamp adversely affected by the operation of another lamp (4.2.3 (c))

Minor Nearside Rear Stop lamp(s) insecure (4.3.1 (c) (i))

Fail Nearside Rear Service brake excessively fluctuating (1.2.1 (e))

Advice Coolant Low

Fail Offside Front Inner Integral body structure corroded to the extent that the rigidity of the assembly is significantly reduced Step/Sill (6.1.1 (c) (i))



MOT #31 2023-04-21 14:47

MOT test number 778724398557

Result ✔ Passed

Advice Offside Front Inner Integral body structure is corroded but structural rigidity is not significantly reduced Wheel arch by engine mounting (6.1.1 (c) (i))

MOT #30 2023-04-21 14:47

MOT test number 532829780622

Result ✘ Failed

Pass with rectification Nearside Headlamp aim too high and too far to the right. (4.1.2 (a))

Advice Offside Front Inner Integral body structure is corroded but structural rigidity is not significantly reduced Wheel arch by engine mounting (6.1.1 (c) (i))

Pass with rectification Offside Headlamp aim too high and too far to the right. (4.1.2 (a))

MOT #29 2022-04-25 15:29

MOT test number 748861509837

Result ✔ Passed

Advice Nearside Front Inner inner wheel arch corroded

MOT #28 2022-04-13 11:04

MOT test number 847643073945

Result ✘ Failed

Fail Nearside Front Direction indicator not working (4.4.1 (a) (ii))

Fail Offside Front Lower Suspension component mounting prescribed area excessively corroded significantly reducing structural strength sub frame mounting area (5.3.6 (a) (i))

Fail Nearside Rear Position lamp not working (4.2.1 (a) (ii))

Advice Nearside Front Inner inner wheel arch corroded



MOT #27 2021-10-22 10:24

MOT test number 317581692349

Result ✔ Passed

- Advice** Corrosion n/s front inner sill
- Minor** Offside Obligatory mirror slightly damaged (3.3 (b) (i))
- Advice** O/s/r light lens slightly damaged
- Advice** Upper Stop lamp(s) non-obligatory stop lamp not working (4.3.1 (a) (ii))
- Advice** Corrosion o/s/f inner sill

MOT #26 2021-10-21 14:03

MOT test number 337731056263

Result ✘ Failed

- Fail** Offside Headlamp aim projected beam image is obviously incorrect beam image kick up to the right (4.1.2 (c))
- Fail** Nearside Headlamp aim projected beam image is obviously incorrect beam image kick up to the right (4.1.2 (c))
- Advice** O/s/r light lens slightly damaged
- Minor** Offside Obligatory mirror slightly damaged (3.3 (b) (i))
- Advice** Upper Stop lamp(s) non-obligatory stop lamp not working (4.3.1 (a) (ii))
- Fail** Offside Rear fog lamp not working (4.5.1 (a) (ii))
- Advice** Corrosion n/s front inner sill
- Advice** Corrosion o/s/f inner sill



MOT #25 2020-10-28 10:50

MOT test number 851291047612

Result ✔ Passed

- Advice** Upper Stop lamp(s) non-obligatory stop lamp not working (4.3.1 (a) (ii))
- Advice** Offside Front Subframe mounting prescribed area is corroded but not considered excessive (5.3.6 (a) (i))
- Advice** Rear Exhaust mounting defective (6.1.2 (a))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Minor** Offside Front Obligatory mirror slightly damaged (3.3 (b) (i))
- Advice** Offside Front Service brake binding but not excessively (1.2.1 (f))

MOT #24 2019-11-14 15:04

MOT test number 128726814504

Result ✔ Passed

- Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Nearside Rear Wheel bearing slightly noisy (5.1.3 (b) (i))



MOT #23 2019-10-21 16:00

MOT test number 665106868648

Result ✗ Failed

Fail Exhaust system insecure x4 rubbers and x1 hanger required (6.1.2 (a))

Fail Nearside Front Vehicle structure corroded to the extent that the rigidity of the assembly is significantly reduced around jacking point and subframe mounting areas (6.1.1 (c) (i))

Minor Brake pipe inadequately clipped or supported (1.1.11 (d) (i))

Fail Nearside Front Upper Suspension component mounting prescribed area excessively corroded significantly reducing structural strength (5.3.6 (a) (i))

Advice Signs of leak around fuel pump area

Fail Offside Front Suspension arm ball joint excessively worn (5.3.4 (a) (i))

Fail Offside Front Vehicle structure corroded to the extent that the rigidity of the assembly is significantly reduced Around jacking points and subframe mounting areas (6.1.1 (c) (i))

Fail Nearside Front Wheel bearing rough when rotated (5.1.3 (b) (i))

MOT #22 2018-11-01 11:17

MOT test number 591682845503

Result ✓ Passed

Advice Corrosion forming o/s/f chassis area near rear mounting bolts.

Advice O/S/R light lens slightly insecure and has minor damage. Centre stop lamp not working. O/S door mirror glass slightly damaged.

Advice Offside Front Brake pipe corroded, covered in grease or other material (1.1.11 (c))

Advice Corrosion on o/s/f outer sill area near door step, outside of prescribed area (Benefit of doubt given, recommend attention soon)

Advice Fuel residue from pump area, Can't be certain leaking (Benefit of doubt given)

Advice Registration plate deteriorated but not likely to be misread Both (0.1 (b))

Advice All exhaust rubbers except 1 heavily perished (Recommend attention soon)



MOT #21 2018-10-25 16:41

MOT test number 865828397927

Result ✗ Failed

Advice All exhaust rubbers except 1 heavily perished (Recommend attention soon)

Fail Nearside Rear Service brake excessively fluctuating (1.2.1 (e))

Advice Offside Front Brake pipe corroded, covered in grease or other material (1.1.11 (c))

Fail Offside Front Inner Suspension component mounting prescribed area is corroded to the extent that control of the vehicle is likely to be adversely affected Wheel arch area x3 (5.3.6 (a) (ii))

Advice Corrosion forming o/s/f chassis area near rear mounting bolts.

Fail Offside Front Inner Subframe mounting prescribed area is corroded to the extent that control of the vehicle is likely to be adversely affected Wheel arch x5 (5.3.6 (a) (ii))

Advice O/S/R light lens slightly insecure and has minor damage. Centre stop lamp not working. O/S door mirror glass slightly damaged.

Fail Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Advice Nearside Front Service brake fluctuating, but not excessively (1.2.1 (e))

Advice Registration plate deteriorated but not likely to be misread Both (0.1 (b))

Advice Corrosion on o/s/f outer sill area near door step, outside of prescribed area (Benefit of doubt given, recommend attention soon)

Fail Nearside Front Inner Subframe mounting prescribed area is corroded to the extent that control of the vehicle is likely to be adversely affected Wheel arch x4 (5.3.6 (a) (ii))

Advice Fuel residue from pump area, Can't be certain leaking (Benefit of doubt given)

Fail Offside Sub-frame corroded and seriously weakened Near upper mounting bolt area (5.3.3 (b) (i))

MOT #20 2017-10-30 12:09

MOT test number 666414595426

Result ✔ Passed



MOT #19 2017-10-25 14:26

MOT test number 266734556084

Result ✗ Failed

- Fail** Nearside Headlamp aim beam image obviously incorrect (1.8.A.1b)
- Fail** Nearside Rear Front wheel bearing has excessive play (2.5.A.3c)
- Fail** Nearside Registration plate lamp not working (1.1.C.1d)
- Fail** Offside Rear fog lamp not working (1.3.2b)
- Fail** Front Anti-roll bar attachment bracket/mounting insecure lower (2.4.G.1)
- Advice** Offside Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
- Advice** Nearside Front wheel bearing has slight play (2.5.A.3c)
- Fail** Offside Headlamp aim beam image obviously incorrect (1.8.A.1b)
- Advice** Nearside marker light not working
- Fail** Rear Brakes imbalanced across an axle Axle 2 (3.7.B.5b)
- Fail** Rear fog lamp switch faulty (1.3.1a)
- Fail** Stop lamp not working center (1.2.1b)
- Fail** Offside Front Vehicle structure has excessive corrosion, seriously affecting its strength within 30cm of the body mountings step (6.1.B.2)

MOT #18 2016-10-25 07:01

MOT test number 275897936895

Result ✓ Passed

- Advice** Offside Front Lower suspension ball joint has slight play
- Advice** Nearside Front Lower side marker not working
- Advice** Centre stop light inoperative
- Advice** Nearside Rear wheel bearing has slight play (2.6.2)
- Advice** Diesel fuel smell from under bonnet no visible leaks advise investigation



MOT #17

2016-10-18 08:43

MOT test number

969294415380

Result

✗ Failed

- Fail** Nearside Upper Front position lamp(s) not working (1.1.A.3b)
- Fail** Offside Front Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)
- Fail** Nearside Stop lamp not working (1.2.1b)
- Advice** Nearside Front Lower side marker not working
- Advice** Nearside Rear wheel bearing has slight play (2.6.2)
- Fail** Nearside Rear position lamp(s) not working (1.1.A.3b)
- Fail** Offside Upper Rear position lamp(s) not working (1.1.A.3b)
- Fail** Nearside Front Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)
- Fail** Exhaust system not adequately supported (7.1.1)
- Fail** Nearside Front wheel bearing has excessive play (2.5.A.3c)
- Fail** Centre Stop lamp not working (1.2.1b)
- Advice** Diesel fuel smell from under bonnet no visible leaks advise investigation
- Fail** Nearside Upper Rear position lamp(s) not working (1.1.A.3b)



MOT #16 2015-10-14 16:02

MOT test number 698991440853

Result ✔ Passed

- Advice** Corrosion on floor of locker holding gas bottles
- Advice** Nearside Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
- Advice** Passenger side rear tyre sidewall cracking
- Advice** None gen ARB fitted to front. link arms worn. Gen ARB also fitted
- Advice** Lower covers fitted at time of test
- Advice** Rear most exhaust mount snapped

MOT #15 2015-10-14 11:21

MOT test number 364627740621

Result ✘ Failed

- Advice** Corrosion on floor of locker holding gas bottles
- Fail** Offside Headlamp aim beam image kick up to the offside (1.8)
- Advice** Passenger side rear tyre sidewall cracking
- Advice** Nearside Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
- Advice** None gen ARB fitted to front. link arms worn. Gen ARB also fitted
- Fail** Nearside Headlamp aim beam image kick up to the offside (1.8)
- Advice** Lower covers fitted at time of test
- Fail** Nearside Front Lower Suspension arm has excessive play in a ball joint (2.4.G.2)
- Fail** Parking brake: efficiency below requirements (3.7.B.7)
- Advice** Rear most exhaust mount snapped
- Fail** Rear fog lamp not working (1.3.2b)



MOT #14 2014-10-22 16:18

MOT test number 289545994265

Result ✔ Passed

- Notice** Slight play in nearside rear wheel bearing
- Notice** Offside front top side marker light not working
- Notice** Rear crossmember slightly damaged (bent)
- Notice** Nearside storage box badly corroded
- Notice** Both handbrake cables corroded
- Notice** Lower floor panels slightly corroded

MOT #13 2014-10-21 09:27

MOT test number 238304394244

Result ✘ Failed

- Fail** Nearside Front Suspension component mounting prescribed area is excessively corroded (2.4.A.3)
- Notice** Both handbrake cables corroded
- Fail** Offside Rear Brake pipe excessively corroded (3.6.B.2c)
- Notice** Lower floor panels slightly corroded
- Notice** Nearside front brake disc slightly pitted/corroded
- Notice** Offside front top side marker light not working
- Fail** Offside Front Suspension component mounting prescribed area is excessively corroded (2.4.A.3)
- Notice** Rear crossmember slightly damaged (bent)
- Fail** Nearside Rear Brake pipe excessively corroded (3.6.B.2c)
- Notice** Nearside storage box badly corroded
- Notice** Slight play in nearside rear wheel bearing



MOT #12 2013-10-22 16:49

MOT test number 196545393236

Result ✔ Passed

- Notice** O/s n/s front tyres showing bulges inner side walls
- Notice** O/s mirror glass cracked
- Advice** Offside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)
- Notice** Front tyres showing rub marks inner edges after market anti roll bar fitted does not touch on lock to lock check
- Notice** Front discs showing corrosion

MOT #11 2013-10-18 10:28

MOT test number 995811993260

Result ✘ Failed

- Fail** Exhaust system not adequately supported (7.1.1)
- Advice** Offside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)
- Notice** O/s n/s front tyres showing bulges inner side walls
- Fail** Exhaust has a major leak of exhaust gases (7.1.2)
- Notice** O/s mirror glass cracked
- Fail** Nearside Front suspension has excessive play in a lower suspension ball joint (2.5.B.1a)
- Notice** Front tyres showing rub marks inner edges after market anti roll bar fitted does not touch on lock to lock check
- Fail** Offside Registration plate lamp not working (1.1.C.1d)
- Notice** Front discs showing corrosion



MOT #10

2012-10-24 15:58

MOT test number

247438192282

Result

✓ Passed

- Notice** Front disc corroded
- Notice** Rear tyres on max load rating
- Advice** Exhaust has a minor leak of exhaust gases (7.1.2)
- Notice** Off side rear tyre scuffed
- Advice** Offside Front wheel bearing has slight play (2.5.A.3c)
- Notice** Near and off side marker lights not working
- Advice** Rear Brake pipe slightly corroded (3.6.B.2c)
- Notice** Both rear tyres starting to perish
- Advice** Nearside Front wheel bearing has slight play (2.5.A.3c)
- Advice** Nearside Rear Rear wheel bearing has slight play (2.6.2)



MOT #9 2012-10-24 10:06

MOT test number 517618292234

Result ✗ Failed

Advice Nearside Front wheel bearing has slight play (2.5.A.3c)

Fail Offside Front Direction indicator incorrect colour (1.4.A.2f)

Notice Number plate light dim

Advice Nearside Rear Rear wheel bearing has slight play (2.6.2)

Fail Offside Rear Direction indicator incorrect colour (1.4.A.2f)

Notice Rear tyres on max load rating

Fail Brake pipe excessively corroded (3.6.B.2c)

Notice Off side rear tyre scuffed

Advice Exhaust has a minor leak of exhaust gases (7.1.2)

Fail Nearside Front Direction indicator incorrect colour (1.4.A.2f)

Advice Offside Front wheel bearing has slight play (2.5.A.3c)

Fail Nearside Rear Direction indicator incorrect colour (1.4.A.2f)

Notice Near and off side marker lights not working

Fail Offside Stop lamp not working (1.2.1b)

Notice Both rear tyres starting to perish

Notice Front disc corroded

Advice Rear Brake pipe slightly corroded (3.6.B.2c)



MOT #8 2011-08-30 15:46

MOT test number 408692041259

Result ✓ Passed

- Notice** O/s/front outer chassis member body coating has come off showing rust by jack point
- Notice** Slight play o/s n/s front hub bearings
- Notice** Body coating has come off by n/s/rear handbrake cable fixture showing rust
- Notice** O/s/rear cross axle brake pipe showing slight corrosion
- Notice** O/s/rear side marker not working

MOT #7 2010-09-01 11:14

MOT test number 331824140271

Result ✓ Passed

- Notice** Add on anti roll bar bushes split

MOT #6 2010-09-01 11:14

MOT test number 363134640239

Result ✗ Failed

- Pass with rectification** Front passenger door cannot be opened from inside the vehicle (6.2.B.1b)
- Notice** Add on anti roll bar bushes split

MOT #5 2009-09-14 15:33

MOT test number 744917859231

Result ✓ Passed

- Notice** Slight play n/s front hub
- Notice** Beam deflectors fitted to headlights
- Notice** Tail pipe end missing



MOT #4 2009-09-11 17:16

MOT test number 222974959243

Result ✗ Failed

- Notice Slight play n/s front hub
- Notice Front pads getting thin 80%worn
- Fail Offside Registration plate lamp not working (1.1.5c)
- Notice Beam deflectors fitted to headlights
- Notice Tail pipe end missing

MOT #3 2008-10-14 16:55

MOT test number 950468888262

Result ✓ Passed

MOT #2 2007-10-19 11:58

MOT test number 711472997276

Result ✓ Passed

MOT #1 2006-10-20 08:39

MOT test number 702753696294

Result ✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 May 2025

✓
MOT
Expires:
21 May 2025

Tax status Valid until 1 May

Days left 45

MOT expiry date 21 May 2025

Full MOT history [See MOT history](#)




Damage history

Check the damage history for this FIAT. See if, where and when this FIAT had damage and the car repair costs. We also check if this FIAT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

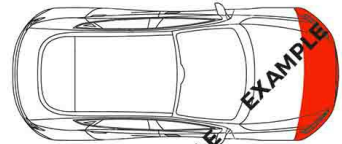

Damage 2

Date	
Category	
Type	



Extra FIAT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Owner history

For how long did the current and previous owner(s) have this FIAT? How many owners did this FIAT have? Check it in the premium report and see all owner registrations. Due to strict data protection laws, we cannot and do not provide the personal details of a vehicle's owner. Download the full report [here](#).

Owner	Start	End
Owner	Start	End
Owner	Start	End
Owner	Start	End
Owner	Start	End
Owner	Start	End
Owner	Start	End

More info >

Plate changes

See in this check if this FIAT had different number plates.

Number of plates	1
Current registration	Y752JOW
Plate since	2019-09-29
Current registration	Y752JOW
Plate since	2019-09-29

More info >



Finance check

Check if this FIAT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FIAT has been settled.

If not, and you buy this FIAT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FIAT is financed.


Finance company	REDACTED
Date of agreement	REDACTED
Agreement type	REDACTED
Agreement term	REDACTED
Agreement number	REDACTED
Contact info	REDACTED

More info >



Mileage check

Odometer	In kilometers
Mileage registrations	34
First mileage registration	2001-07-17
Last registration	2024-05-22
Complete history	See info

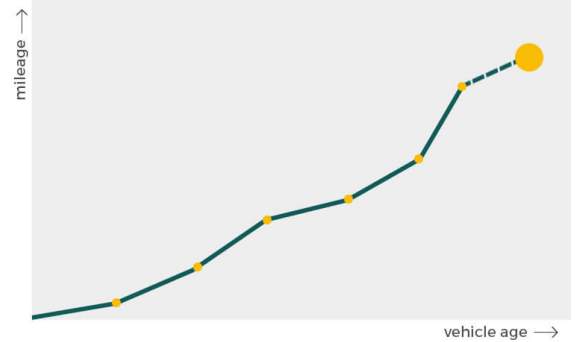

Registration #1	2001-07-17	23 mi
Registration #2	2006-10-20	30.216 mi
Registration #3	2007-10-19	30.829 mi
Registration #4	2008-10-14	46.870 mi
Registration #5	2009-09-11	58.710 mi
Registration #6	2009-09-14	58.710 mi
Registration #7	2010-09-01	68.883 mi
Registration #8	2011-08-30	75.160 mi
Registration #9	2012-10-24	51.083 mi
Registration #10	2012-10-24	51.083 mi
Registration #11	2013-10-18	54.160 mi
Registration #12	2013-10-22	54.160 mi
Registration #13	2014-10-21	58.541 mi
Registration #14	2014-10-22	94.192 mi
Registration #15	2015-10-14	98.986 mi
Registration #16	2015-10-14	98.986 mi
Registration #17	2016-10-18	104.504 mi
Registration #18	2016-10-18	104.504 mi
Registration #19	2016-10-18	104.504 mi
Registration #20	2016-10-18	104.504 mi
Registration #21	2016-10-18	104.504 mi
Registration #22	2016-10-18	104.504 mi
Registration #23	2016-10-18	104.504 mi
Registration #24	2016-10-18	104.504 mi
Registration #25	2016-10-18	104.504 mi
Registration #26	2016-10-18	104.504 mi

Registration #27	2025-05-27	25,277,462
Registration #28	2025-05-27	25,277,462
Registration #29	2025-05-27	25,277,462
Registration #30	2025-05-27	25,277,462
Registration #31	2025-05-27	25,277,462
Registration #32	2025-05-27	25,277,462
Registration #33	2025-05-27	25,277,462
Registration #34	2025-05-27	25,277,462

More info >



Car features

The FIAT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FIAT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★☆

Video [see crash video](#)



Dimensions & weight

Width	2180 mm
Max. allowed weight	3500 kg

Additional information

Number of axles	2
Engine number	3359974