



N743BRC

report date: 2024-03-29

General information

Make	MAZDA
Model	BONGO
Colour	White
Year of manufacture	1996
Gearbox	-

Engine & fuel consumption

Engine capacity	2.500 cc
Fuel type	Diesel




LABEL UNKNOWN



Internet history

Entry 3

Date	2022-11-30
Pictures	14
Listing price	<a href="#">View report</a>

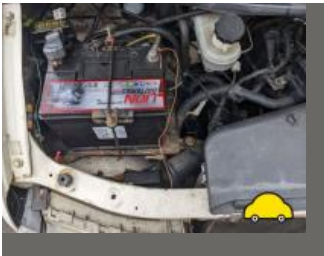

source: [autotrader.co.uk](#)

Entry 2

Date	2021-08-02
Pictures	11
Listing price	<a href="#">View report</a>



source: [autotrader.co.uk](#)

Entry 1

Date	2021-07-14
Pictures	11
Listing price	<a href="#">View report</a>



source: [autotrader.co.uk](#)



MOT history

MOT expiry date	2024-09-04
MOT pass rate	63 %
MOT passed	15
Failed MOT tests	9
Total advice items	51
Total items failed	45

MOT #24	2023-08-22 14:59
MOT test number	124777233075
Result	✓ Passed
Next expiry date	2024-09-04
Advice	Rear Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))

MOT #23	2023-08-22 14:59
MOT test number	497784665626
Result	✗ Failed
Advice	Rear Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))
Pass with rectification	Offside Battery insecure and likely to cause a short circuit (4.13 (a) (ii))
Pass with rectification	Nearside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

**MOT #22**

2022-09-05 10:09

**MOT test number**

440252180912

**Result**

✓ Passed

**Advice** Nearside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**Advice** Coolant leak**Minor** Nearside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**Advice** Offside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**Minor** Offside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))**MOT #21**

2022-09-01 14:56

**MOT test number**

404723094212

**Result**

✗ Failed

**Minor** Offside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))**Fail** Nearside Rear Anti-roll bar pin or bush excessively worn (5.3.4 (a) (i))**Fail** Nearside Rear Anti-roll bar linkage pin or bush excessively worn (5.3.4 (a) (i))**Fail** Offside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))**Advice** Offside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**Minor** Nearside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))**Fail** Offside Rear Anti-roll bar pin or bush excessively worn (5.3.4 (a) (i))**Advice** Coolant leak**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**Fail** Front Windscreen washer not working (3.5 (a))**Advice** Nearside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**Fail** Nearside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength sill end (5.3.6 (a) (i))



**MOT #20** 2021-05-06 14:03**MOT test number** 820559898190**Result** ✓ Passed**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**MOT #19** 2020-05-29 08:12**MOT test number** 900696233862**Result** ✓ Passed**MOT #18** 2019-07-16 14:37**MOT test number** 895447378999**Result** ✓ Passed**MOT #17** 2019-07-15 12:25**MOT test number** 463379040226**Result** ✗ Failed**Fail** Nearside Headlamp not working on dipped beam (4.1.1 (a) (ii))**Fail** Nearside Stop lamp(s) not working (4.3.1 (a) (ii))**Fail** Horn not working (7.7 (a) (ii))**Fail** Offside Stop lamp(s) not working (4.3.1 (a) (ii))**MOT #16** 2018-06-01 15:23**MOT test number** 872278801087**Result** ✓ Passed**Advice** Nearside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))



MOT #15	2018-05-30 11:16
MOT test number	862955174144
Result	✗ Failed
Fail	Emissions not tested (8.2.2.2 (e))
Advice	Nearside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))
Fail	Exhaust emissions likely to be affected by an exhaust leak (8.2.2.1 (b))
Fail	Nearside Front Headlamp aim too high (4.1.2 (a))

MOT #14	2016-05-27 09:08
MOT test number	225068020991
Result	✓ Passed

**MOT #13**

2016-05-16 15:18

**MOT test number**

563853854371

**Result****✗ Failed**

- Advice** Nearside Front Anti-roll bar has slight play in a pin/bush (2.4.G.2)
- Fail** Registration plate lamp not working (1.1.C.1d)
- Advice** Nearside Front Suspension arm has slight play in a pin/bush (2.4.G.2)
- Fail** Offside Front Headlamp aim too low (1.8)
- Fail** Nearside Front Subframe mounting prescribed area is excessively corroded (2.4.A.3)
- Advice** Nearside Rear Anti-roll bar has slight play in a pin/bush link (2.4.G.2)
- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Fail** Offside Rear Anti-roll bar has excessive play in a pin/bush d/bush (2.4.G.2)
- Fail** Windscreen washer provides insufficient washer liquid (8.2.3)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Offside Front Anti-roll bar has slight play in a pin/bush (2.4.G.2)
- Fail** Nearside Front Headlamp aim too low (1.8)
- Advice** Offside Front Suspension arm has slight play in a pin/bush (2.4.G.2)
- Fail** Nearside Front Front suspension has excessive play in a lower suspension ball joint (2.5.B.1a)
- Fail** Offside Rear Seat belt anchorage prescribed area is excessively corroded sill (5.2.6)
- Fail** Nearside Rear Anti-roll bar has excessive play in a pin/bush d/bush (2.4.G.2)
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)



**MOT #12**

2016-05-10 09:50

**MOT test number**

730874903423

**Result****✗ Failed**

- Fail** Nearside Rear Anti-roll bar linkage has excessive play in a ball joint (2.4.G.2)
- Fail** Windscreen washer provides insufficient washer liquid (8.2.3)
- Fail** Nearside Rear Anti-roll bar has excessive play in a pin/bush D bush (2.4.G.2)
- Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Fail** Nearside Registration plate lamp not working (1.1.C.1d)
- Advice** Rear Brake pad(s) wearing thin (3.5.1g)
- Fail** Nearside Front Suspension arm has excessive play in a ball joint (2.4.G.2)
- Fail** Offside Vehicle structure has excessive corrosion, seriously affecting its strength within 30cm of the body mountings Outer sill (6.1.B.2)
- Fail** Offside Rear Anti-roll bar linkage has excessive play in a ball joint (2.4.G.2)
- Fail** Power steering component(s) leaking Steering rack (2.3.3b)
- Fail** Offside Rear Anti-roll bar has excessive play in a pin/bush D bush (2.4.G.2)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Exhaust has a minor leak of exhaust gases Flexi (7.1.2)
- Fail** Nearside Front Vehicle structure has excessive corrosion, seriously affecting its strength within 30cm of the body mountings Inner sill (6.1.B.2)
- Fail** Exhaust emits an excessive level of metered smoke for a turbo charged engine (7.4.B.3b)

**MOT #11**

2015-05-12 12:25

**MOT test number**

528802135192

**Result**

✓ Passed

**Advice** Offside Front Lower Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

**Advice** Exhaust has a minor leak of exhaust gases (7.1.2)

**Advice** Nearside Front Lower Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

**Advice** Front Brake pad(s) wearing thin (3.5.1g)

**MOT #10**

2014-05-23 16:41

**MOT test number**

395753344175

**Result**

✓ Passed

**Advice** Offside Rear Anti-roll bar has slight play in a pin/bush (2.4.G.2)

**Notice** Oil leak

**Advice** Nearside Front Anti-roll bar has slight play in a ball joint (2.4.G.2)

**Advice** Nearside Rear Anti-roll bar has slight play in a pin/bush (2.4.G.2)

**Advice** Nearside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)

**Notice** N/s/r tyre cracks tread /side walls

**Advice** Nearside Rear Anti-roll bar has slight play in a pin/bush (2.4.G.2)

**MOT #9** 2014-05-21 09:24**MOT test number** 466311844151**Result** ✗ Failed

- Fail** Parking brake: efficiency below requirements (3.7.C.1b)
- Fail** Windscreen washer provides insufficient washer liquid (8.2.3)
- Advice** Nearside Rear Anti-roll bar has slight play in a pin/bush (2.4.G.2)
- Fail** Nearside Front Headlamp aim too high (1.8)
- Notice** Oil leak
- Advice** Offside Rear Anti-roll bar has slight play in a pin/bush (2.4.G.2)
- Fail** Offside Rear Anti-roll bar has excessive play in a pin/bush (2.4.G.2)
- Fail** Parking brake lever has no reserve travel (3.1.6b)
- Advice** Nearside Front Anti-roll bar has slight play in a ball joint (2.4.G.2)
- Fail** Registration plate lamp not working (1.1.C.1d)
- Notice** N/s/r tyre cracks tread /side walls
- Advice** Nearside Rear Anti-roll bar has slight play in a pin/bush (2.4.G.2)
- Fail** Offside Front Headlamp aim too low (1.8)
- Advice** Nearside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)
- Fail** Offside Front Shock absorber has a serious fluid leak (2.7.3)

**MOT #8** 2013-05-20 13:10**MOT test number** 995600143193**Result** ✓ Passed

- Advice** Anti-roll bar rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Advice** Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)

**MOT #7** 2011-06-29 16:33**MOT test number** 645590381175**Result** ✓ Passed**MOT #6** 2011-06-28 15:19**MOT test number** 167419271176**Result** ✗ Failed**Fail** Centre Exhaust has part of the system excessively deteriorated (7.1.1a)**MOT #5** 2009-07-28 13:07**MOT test number** 153619709272**Result** ✓ Passed**MOT #4** 2008-02-04 19:46**MOT test number** 860485838062**Result** ✓ Passed**MOT #3** 2007-02-17 15:55**MOT test number** 814208547067**Result** ✓ Passed**Advice** Offside Front Front drive shaft coupling flexible rubber or fabric coupling unit slightly cracked (2.5.C.1d)**MOT #2** 2007-02-17 15:55**MOT test number** 270088547001**Result** ✗ Failed**Advice** Offside Front Front drive shaft coupling flexible rubber or fabric coupling unit slightly cracked (2.5.C.1d)**Pass with rectification** Nearside Headlamp aim too low (1.8)



MOT #1	2006-02-15 14:48
MOT test number	630166746038
Result	✓ Passed



Tax & MOT check

✓  
**Taxed**  
**Tax due:**  
1 July 2024

✓  
**MOT**  
**Expires:**  
4 September 2024

Tax status		Valid until 1 July
Days left		62
MOT expiry date		4 September 2024
Full MOT history		<a href="#">See MOT history</a>



Damage history

Check the damage history for this MAZDA. See if, where and when this MAZDA had damage and the car repair costs. We also check if this MAZDA was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	



Damage 2

Date	
Category	
Type	

Extra MAZDA salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Owner history

For how long did the current and previous owner(s) have this MAZDA? How many owners did this MAZDA have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****

More info >

Plate changes

See in this check if this MAZDA had different number plates.

Number of plates	1
Current registration	*****
Plate since	2023-03-29
Current registration	*****
Plate since	2023-03-29

More info >





Finance check

Check if this MAZDA is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this MAZDA has been settled.

If not, and you buy this MAZDA then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this MAZDA is financed.

Finance company	REDACTED	REDACTED
Date of agreement	REDACTED	REDACTED
Agreement type	REDACTED	REDACTED
Agreement term	REDACTED	REDACTED
Agreement number	REDACTED	REDACTED
Contact info	REDACTED	REDACTED

More info >



Mileage check

Odometer	In miles
Mileage registrations	27
First mileage registration	2006-02-01
Last registration	2023-08-22
Complete history	<a href="#">See info</a>



Registration #1	2006-02-01	27 mi
Registration #2	2006-02-15	55.209 mi
Registration #3	2007-02-17	61.685 mi
Registration #4	2008-02-04	69.891 mi
Registration #5	2009-07-28	77.645 mi
Registration #6	2011-06-28	80.574 mi
Registration #7	2011-06-29	80.754 mi
Registration #8	2013-05-20	81.872 mi
Registration #9	2014-05-21	85.247 mi
Registration #10	2014-05-23	85.247 mi
Registration #11	2015-05-12	53.631 mi
Registration #12	2016-05-10	86.814 mi
Registration #13	2016-05-16	86.846 mi
Registration #14	2016-05-27	86.846 mi
Registration #15	2016-05-27	86.846 mi
Registration #16	2016-05-27	86.846 mi
Registration #17	2016-05-27	86.846 mi
Registration #18	2016-05-27	86.846 mi
Registration #19	2016-05-27	86.846 mi
Registration #20	2016-05-27	86.846 mi
Registration #21	2016-05-27	86.846 mi
Registration #22	2016-05-27	86.846 mi
Registration #23	2016-05-27	86.846 mi
Registration #24	2016-05-27	86.846 mi
Registration #25	2016-05-27	86.846 mi
Registration #26	2016-05-27	86.846 mi

More info >



Additional information

Number of seats	8
Engine number	WL