





report date: 2024-03-29

General information

Make	LAND ROVER
Model	DEFENDER TDI PU
Colour	White
Year of manufacture	1993
Gearbox	-Manual

Engine & fuel consumption

Power	107 BHP
Engine capacity	2.495 сс
Cylinders	4
Fuel type	Diesel



CarCheck.co.uk page 1/19



report date: 2024-03-29

Internet history

Entry 1

Date 2021-06-12

Pictures 18

Listing price <u>View report</u>









source: autotrader.co.uk

CarCheck.co.uk page 2/19



report date: 2024-03-29

MOT history

MOT expiry date	2024-06-08
MOT pass rate	52 %
MOT passed	14
Failed MOT tests	13
Total advice items	53
Total items failed	67

MOT #27		2023-06-08 11:56
MOT test	number	900424849772
Result		✓ Passed
Next expi	ry date	2024-06-08
Advice	Nearside Rear Shock absorbers has a slightly worn bush (5.3.2 (c))	
Advice	Offside Front axle swivel slight leaking	
Advice	Offside Front Brake pipe corroded, covered in grease or other material (1.1.11 (c))
Advice	Nearside Front axle swivel slight leaking	

MOT #26		2023-06-07 10:33
MOT test i	number	599129180778
Result		× Failed
Advice	Offside Front axle swivel slight leaking	
Advice	Offside Front Brake pipe corroded, covered in grease or other material (1.1.11 (c	2))
Advice	Nearside Front axle swivel slight leaking	
MAJOR	Fuel system component leaking (6.1.3 (b) (i))	
Advice	Nearside Rear Shock absorbers has a slightly worn bush (5.3.2 (c))	

CarCheck.co.uk page 3/19



report date: 2024-03-29

MOT #25 2022-06-09 09:04 **MOT test number** 579034947389 Result ✓ Passed **Advice** Rear Prop shaft joint worn, but not excessively both ends (6.1.7 (c) (i)) Offside Front Brake hose slightly deteriorated (1.1.12 (b) (ii)) Advice Offside Front Seat belt webbing slightly damaged or frayed (7.1.2 (b) (ii)) Advice Advice Nearside Front Brake hose slightly deteriorated (1.1.12 (b) (ii)) Nearside Front Seat belt webbing slightly damaged or frayed (7.1.2 (b) (ii)) **Advice**

MOT #24		2022-06-01 13:23
MOT test	number	243854333247
Result		× Failed
MAJOR	Nearside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))
Advice	Nearside Front Brake hose slightly deteriorated (1.1.12 (b) (ii))	
Pass wit	Chrectification Offside Headlamp aim too high and too far to the right. (4.1.2	(a))
Advice	Offside Front Seat belt webbing slightly damaged or frayed (7.1.2 (b) (ii))	
MAJOR longer pre	Offside Front Drag link end ball joint dust cover excessively damaged or deterior vents the ingress of dirt drop arm end $(2.1.3 (g) (ii))$	rated so that it no
MAJOR (b) (ii))	Central Rear Sub-frame ball joint dust cover no longer prevents the ingress of d	irt a frame (5.3.4
Advice	Rear Prop shaft joint worn, but not excessively both ends (6.1.7 (c) (i))	
MAJOR	Offside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))	
Advice	Offside Front Brake hose slightly deteriorated (1.1.12 (b) (ii))	
MAJOR	Rear fog lamp tell-tale not working (4.9.1 (a) (ii))	
Advice	Nearside Front Seat belt webbing slightly damaged or frayed (7.1.2 (b) (ii))	
MAJOR	Offside Front Brake disc contaminated (1.1.14 (b))	

CarCheck.co.uk page 4/19



report date: 2024-03-29

MOT #23 2021-06-05 11:47 317910129430 **MOT** test number Result ✓ Passed **MOT #22** 2017-04-28 13:49 **MOT** test number 367866971898 Result ✓ Passed **Advice** N/s and o/s front tyres inner side walls perished Advice O/s rear tyre perished Windscreen washers weak Advice **Advice** N/s and o/s front hub seals damp Advice Play in n/s front hub

MOT #21 2017-04-27 16:05 **MOT** test number 327721422767 Result × Failed **Advice** Play in n/s front hub Fail Offside Rear Stop lamp not working (1.2.1b) Advice N/s and o/s front tyres inner side walls perished Advice O/s rear tyre perished Fail Main beam 'tell-tale' not working (1.7.4c) Fail Fuel system component leaking back of fuel pump (7.2.3) Advice Windscreen washers weak Advice N/s and o/s front hub seals damp

CarCheck.co.uk page 5/19



report date: 2024-03-29

MOT #20

MOT test number

549578359290

Result

Advice Both rear tyres perished

MOT #19 2016-02-08 17:54 **MOT** test number 844016449622 Result **X** Failed Fail Offside Front Axle swivel joint has excessive play in a swivel pin (2.5.A.3b) Fail Windscreen washer provides insufficient washer liquid (8.2.3) Offside Stop lamp not working (1.2.1b) Fail Fail Nearside Front Axle swivel joint has excessive play in a swivel pin (2.5.A.3b) Offside Rear Seat belt anchorage prescribed area is excessively corroded door entry (5.2.6) Fail **Advice** Both rear tyres perished Fail Nearside Stop lamp not working (1.2.1b) Fail Nearside Rear Seat belt anchorage prescribed area is excessively corroded door entry (5.2.6) Fail Offside Rear Suspension component mounting prescribed area is excessively corroded chasis by tie bar mount (2.4.A.3)

MOT #18	2015-02-26 14:04
MOT test number	705797355037
Result	✓ Passed
Advice Offside Front Axle swivel joint has slight play (2.5.A.3b) Advice Nearside Front Axle swivel joint has slight play (2.5.A.3b)	

CarCheck.co.uk page 6/19



report date: 2024-03-29

2015-02-10 10:33 **MOT #17** 425631445093 **MOT** test number Result **★** Failed Fail Horn not loud enough to be heard by another road user (1.6.2b) Fail Nearside Front Drag link end ball joint has excessive play (2.2.B.1f) Fail Nearside Front Axle swivel joint has excessive play (2.5.A.3b) Fail Nearside Front Shock absorber insecure (2.7.2b) Fail Power steering pump drive system missing (2.3.6) Fail Offside Rear wheel bearing rough when rotated (2.6.1) Offside Drag link end ball joint dust cover insecure so that it no longer prevents the ingress of dirt Fail (2.2.C.1c) Offside Front Axle swivel joint has excessive play (2.5.A.3b) Fail Offside Rear fog lamp emits a light other than red (1.3.2e) Fail

MOT #16	2014-01-22 14:36
MOT test number	378812924020
Result	✓ Passed
Notice Wipers slow	

CarCheck.co.uk page 7/19



report date: 2024-03-29

MOT #15 2014-01-20 09:23 **MOT test number** 717090124003 Result × Failed Fail Nearside Rear reflector missing (1.5.1a) Notice Wipers slow Fail Nearside Front Axle swivel joint has excessive play (2.5.A.3b) Fail Offside Front Drag link end ball joint dust cover insecure so that it no longer prevents the ingress of dirt (2.2.C.1c) Notice Throttle very stiff Fail Exhaust system not adequately supported (7.1.1) Fail Offside Front Axle swivel joint has excessive play (2.5.A.3b) Offside Rear Suspension component mounting prescribed area is excessively corroded (2.4.A.3) Fail

MOT #14		2013-02-20 09:13
MOT test	number	907301553050
Result		✓ Passed
Advice	Offside Front Brake hose slightly deteriorated (3.6.B.4d)	
Advice	Nearside Front wheel bearing has slight play (2.5.A.3c)	
Advice	Nearside Front Brake hose slightly deteriorated (3.6.B.4d)	
Advice	Offside Front wheel bearing has slight play (2.5.A.3c)	

CarCheck.co.uk page 8/19



report date: 2024-03-29

MOT #13 2013-02-18 15:46

MOT test number 727159743049

Result X Failed

Advice Nearside Front wheel bearing has slight play (2.5.A.3c)

Advice Nearside Front Brake hose slightly deteriorated (3.6.B.4d)

Fail Offside Track rod end loose (2.2.B.1d)

Fail Offside Rear Suspension component mounting prescribed area is excessively corroded (2.4.A.3)

Fail Rear Tyre(s) incorrect because different size tyres are fitted on the same axle. (4.1.A.1a)

Advice Offside Front wheel bearing has slight play (2.5.A.3c)

Fail Offside Drag link end ball joint has excessive play (2.2.B.1f)

Advice Offside Front Brake hose slightly deteriorated (3.6.B.4d)

Fail Offside Suspension component mounting prescribed area is excessively corroded (2.4.A.3)

Fail Centre Exhaust has a major leak of exhaust gases (7.1.2)

MOT #12 2012-02-09 14:29

MOT test number 235180142068

Result

Passed

CarCheck.co.uk page 9/19



Fail

Fail

Offside Rear fog lamp not working (1.3.2b)

Offside Drag link end ball joint has excessive play (2.2.B.1f)

K946ATM

report date: 2024-03-29

MOT #	11 2012-02-03 14:58
MOT te	est number 226034832035
Result	★ Failed
Fail	Offside Rear Suspension component mounting prescribed area is excessively corroded (2.4.A.3)
Fail	Offside Rear Suspension component mounting prescribed area is excessively corroded (2.4.A.3)
Fail	Nearside Front position lamp(s) not working (1.1.A.3b)
Fail	Nearside Drag link end ball joint has excessive play (2.2.B.1f)
Fail	Offside Track rod end ball joint has excessive play (2.2.B.1f)
Fail	Nearside Rear Suspension component mounting prescribed area is excessively corroded (2.4.A.3)

MOT #10	2011-01-25 13:12
MOT test number	619935721010
Result	✓ Passed

CarCheck.co.uk page 10/19



report date: 2024-03-29

2011-01-20 14:12 MOT #9 778860321071 **MOT** test number Result **★** Failed Fail Brake pedal spongy (3.3.B.1b) Fail Nearside Front Brake pipe excessively chafed (3.6.B.2c) Notice High pitch noise from rear brakes Fail Rear Exhaust has part of the system excessively deteriorated (7.1.1a) Fail Towbar component excessively corroded (6.6.1) Fail Offside Front Suspension component mounting prescribed area is excessively corroded (2.4.A.3) Notice Front brake pads/discs very worn Fail Parking brake lever has no reserve travel (3.1.6b)

MOT #8

MOT test number

912016120042

Result

✓ Passed

CarCheck.co.uk page 11/19



report date: 2024-03-29

MOT #7	2010-01-22 11:51
MOT test number	702372320015
Result	★ Failed
Fail Nearside Headlamp aim too lo	w (1.8)
Fail Nearside Front Suspension arn	n rubber bush deteriorated resulting in excessive movement (2.4.G.2)
Fail Rear Exhaust has part of the s	ystem excessively deteriorated (7.1.1a)
Notice Front /rear uj worn	
Fail Offside Front Brake pad(s) less	s than 1.5 mm thick (3.5.1g)
Fail Steering column universal join	t has excessive play (2.1.5)
Fail Offside Front Suspension arm	rubber bush deteriorated resulting in excessive movement (2.4.G.2)
Fail Nearside Front Brake pad(s) le	ss than 1.5 mm thick (3.5.1g)

MOT #6	2009-02-04 12:04
MOT test number	321925239020
Result	✓ Passed

MOT #	5	2009-02-03 11:21
MOT te	st number	564884739053
Result		× Failed
Fail	Front passenger door cannot be opened from inside the vehicle (6.2.B.1b)	
Fail	Offside Windscreen wiper does not clear the windscreen effectively (8.2.2)	
Fail radial-p	Fail Nearside Rear Tyre(s) incorrect because cross-ply or bias-belted tyres are fitted on the rear axle and radial-ply tyres are fitted on the front axle. (4.1.A.2b)	
Fail	Nearside Windscreen wiper does not clear the windscreen effectively (8.2.2)	
Fail	Nearside Front Track rod end ball joint has excessive play (2.2.B.1f)	

CarCheck.co.uk page 12/19



report date: 2024-03-29

MOT #4 2008-02-02 08:28

MOT test number 722903838051

MOT #3 2008-02-01 09:23

MOT test number 302282938045

Result X Failed

Fail Offside Front Power steering component(s) leaking (2.3.3b)

Fail Offside Rear fog lamp not working (1.3.2b)

Fail Offside Front suspension has excessive movement at a suspension ball joint (2.5.A.1c)

Fail Offside Front position lamp(s) not working (1.1.A.3b)

MOT #2 2007-01-25 14:14

MOT test number 542995227001

Result ✓ Passed

MOT #1 2007-01-03 11:03

MOT test number 763893407085

Result X Failed

Fail Offside Front Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)

Fail Offside Rear Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)

Fail Nearside Rear Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)

Fail Offside Rear fog lamp not working (1.3.2b)

CarCheck.co.uk page 13/19



report date: 2024-03-29

Tax & MOT check



MOT expiry date 8 June 2024

Full MOT history See MOT history

CarCheck.co.uk page 14/19



report date: 2024-03-29

Damage history

Check the damage history for this LAND ROVER. See if, where and when this LAND ROVER had damage and the car repair costs. We also check if this LAND ROVER was scrapped. Download the premium report <u>here</u> for the results.

Damage 1


Date
Category
Type

Damage 2

Date

Category

Type

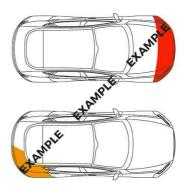

Extra LAND ROVER salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 15/19



deer of plates

factor scincol

K946ATM

report date: 2024-03-29

Owner history For how long did the current and previous owner(s) have this LAND ROVER? How many owners did this LAND ROVER have? Check it in the premium report and see all owner registrations. Download the full report here. More info > Plate changes See in this check if this LAND ROVER had different number plates.

ÜK UK

More info >

CarCheck.co.uk page 16/19



K946ATM report date: 2024-03-29

Finance check

Check if this LAND ROVER is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this LAND ROVER has been settled.

If not, and you buy this LAND ROVER then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this LAND ROVER is financed.

Finance company

Date of agreement

Agreement type

Agreement term

Agreement number

Contact info

More info >


CarCheck.co.uk page 17/19



K946ATM report date: 2024-03-29

Mileage check

Odometer	In miles
Mileage registrations	29
First mileage registration	1993-03-10
Last registration	2023-06-08
Complete history	See info

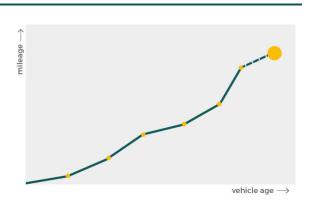

Registration #1	1993-03-10	12 mi
Registration #2	2007-01-03	178.182 mi
Registration #3	2007-01-25	178.249 mi
Registration #4	2008-02-01	182.360 mi
Registration #5	2008-02-02	182.364 mi
Registration #6	2009-02-03	188.484 mi
Registration #7	2009-02-04	188.484 mi
Registration #8	2010-01-22	194.537 mi
Registration #9	2010-01-26	194.540 mi
Registration #10	2011-01-20	203.425 mi
Registration #11	2011-01-25	203.446 mi
Registration #12	2012-02-03	211.172 mi
Registration #13	2012-02-09	211.172 mi
Registration #14	2013-02-18	218.354 mi
Registration #15	2013-02-20	218.354 mi
Registration #16		71.777 es
Registration #17		11.777 es
Registration #18		71.777 es
Registration #19		11.777 es
Registration #20		11.777 es
Registration #21		11.777 es
Registration #22		71.777 es
Registration #23		11.777 es
Registration #24		11.777 es
Registration #25		11.777 es
Registration #26		11.777 es
CarCheck.co.uk		page 18/19

Registration #27	11.00 40
Registration #28	71,777 66
Registration #29	11.777 es

More info >



report date: 2024-03-29

Additional information

Fuel delivery	Direct Injection
Number of doors	2
Engine number	11L29527A

CarCheck.co.uk page 19/19