



PEUGEOT




report date: 2022-08-08

General information

Make	PEUGEOT
Model	407 HDI SW SE
Colour	Grey
Year of manufacture	2007
Top speed	126 mph
Gearbox	6 speed Manual

Engine & fuel consumption

Power	134 BHP
Max. torque	320 Nm at 2.000 rpm
Engine capacity	1.997 cc
Cylinders	4
Fuel type	Diesel
Consumption city	35.8 mpg
Consumption extra urban	56.5 mpg
Consumption combined	47.1 mpg
CO2 emission	159 g/km
CO2 label	G

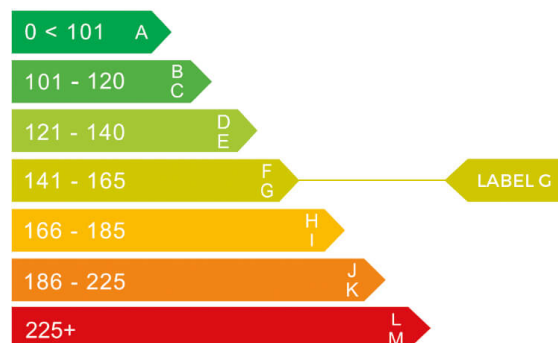



MOT history

MOT expiry date	2023-05-20
MOT pass rate	52 %
MOT passed	13
Failed MOT tests	12
Total advice items	94
Total items failed	47

MOT #25	2022-05-16 16:16
MOT test number	732883977862
Result	✓ Passed
Next expiry date	2023-05-20
Advice	Nearside Front Direction indicator slightly discoloured (4.4.3 (a))
Advice	Rear exhaust heat shield insecure
Advice	Engine management light on
Advice	Offside Front Tyre worn close to legal limit/worn on edge Wearing inner edge (5.2.3 (e))

MOT #24	2021-05-17 10:16
MOT test number	332897454728
Result	✓ Passed

MOT #23	2020-05-21 12:28
MOT test number	560761816916
Result	✓ Passed
Advice	Offside Front Suspension component pin or bush slightly worn swivel bearing joint (5.3.4 (a) (i))
Advice	Nearside Front Suspension component pin or bush slightly worn swivel bearing joint (5.3.4 (a) (i))

**MOT #22**

2020-05-20 09:46

MOT test number

392999005419

Result**✗ Failed**

- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Nearside Front Suspension component pin or bush slightly worn swivel bearing joint (5.3.4 (a) (i))
- Advice** Offside Front Suspension component pin or bush slightly worn swivel bearing joint (5.3.4 (a) (i))
- Fail** Offside Rear Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))
- Fail** Nearside Front Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))

MOT #21

2019-05-24 15:57

MOT test number

409678008330

Result**✓ Passed**

- Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))
- Minor** Offside Obligatory mirror slightly loose (3.3 (b) (i))
- Advice** Rear Brake disc worn, but not excessively (1.1.14 (a) (i))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Under tray fitted covering items
- Advice** Nearside Front Direction indicator slightly discoloured (4.4.3 (a))
- Advice** Front Brake disc worn, but not excessively (1.1.14 (a) (i))
- Advice** Offside Rear Child Seat fitted not allowing full inspection of adult belt

**MOT #20**

2019-05-23 14:49

MOT test number

367311389517

Result**✗ Failed****Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))**Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))**Advice** Rear Brake disc worn, but not excessively (1.1.14 (a) (i))**Advice** Offside Rear Child Seat fitted not allowing full inspection of adult belt**Fail** Nearside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt Insecure (6.1.7 (g) (ii))**Advice** Offside Front Brake pad(s) wearing thin (1.1.13 (a) (ii))**Fail** Nearside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))**Minor** Offside Obligatory mirror slightly loose (3.3 (b) (i))**Advice** Nearside Front Direction indicator slightly discoloured (4.4.3 (a))**Advice** Front Brake disc worn, but not excessively (1.1.14 (a) (i))**Advice** Under tray fitted covering items

**MOT #19**

2018-05-24 13:11

MOT test number

280482271251

Result

✓ Passed

- Advice** Offside Rear Child Seat fitted not allowing full inspection of adult belt
- Advice** Under tray fitted covering items
- Advice** Front registration plate deteriorated but not likely to be misread (6.3.1d)
- Advice** Nearside Front Under tray not secure
- Advice** Rear brake disc worn, pitted or scored, but not seriously weakened Both (3.5.1i)
- Advice** Noise from suspension on full lock
- Advice** Engine cover fitted covering items
- Advice** Rear registration plate faded but not likely to be misread (6.3.1d)
- Advice** Nearside Front Tyre worn excessive on outer edge
- Advice** Front brake disc worn, pitted or scored, but not seriously weakened Both (3.5.1i)
- Advice** Offside Front Arch liner catching on wheel when on full lock
- Advice** Oil leak
- Advice** Rear Registration bulbs dim

**MOT #18**

2018-05-15 15:10

MOT test number

869344929002

Result**✗ Failed**

- Advice** Oil leak
- Advice** Offside Rear Child Seat fitted not allowing full inspection of adult belt
- Advice** Front registration plate deteriorated but not likely to be misread (6.3.1d)
- Advice** Nearside Front Under tray not secure
- Advice** Rear Registration bulbs dim
- Advice** Noise from suspension on full lock
- Advice** Rear brake disc worn, pitted or scored, but not seriously weakened Both (3.5.1i)
- Advice** Under tray fitted covering items
- Fail** Offside Front Front constant velocity joint gaiter damaged to the extent that it no longer prevents the ingress of dirt etc (2.5.C.1a)
- Fail** Anti-lock braking system warning lamp indicates an ABS fault (3.4.1c)
- Advice** Rear registration plate faded but not likely to be misread (6.3.1d)
- Advice** Nearside Front Tyre worn excessive on outer edge
- Advice** Front brake disc worn, pitted or scored, but not seriously weakened Both (3.5.1i)
- Advice** Offside Front Arch liner catching on wheel when on full lock
- Advice** Engine cover fitted covering items
- Fail** Nearside Front Front constant velocity joint gaiter damaged to the extent that it no longer prevents the ingress of dirt etc (2.5.C.1a)

**MOT #17**

2017-05-16 12:06

MOT test number

570928258431

Result

✓ Passed

- Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)
- Advice** Oil leak
- Advice** Nearside Front Tyre worn close to the legal limit outer edge wearing (4.1.E.1)
- Advice** Brake pipe slightly corroded front to rear (3.6.B.2c)
- Advice** Play in steering rack inner joint(s)

MOT #16

2017-05-10 13:07

MOT test number

324915129642

Result

✗ Failed

- Fail** Nearside Rear Anti-roll bar linkage has excessive play in a ball joint (2.4.G.2)
- Advice** Play in steering rack inner joint(s)
- Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)
- Fail** Anti-lock braking system warning lamp indicates an ABS fault (3.4.1c)
- Fail** Offside Front Seat belt stitching badly frayed (5.2.2b)
- Advice** Oil leak
- Advice** Nearside Front Tyre worn close to the legal limit outer edge wearing (4.1.E.1)
- Advice** Brake pipe slightly corroded front to rear (3.6.B.2c)

MOT #15

2016-05-11 15:54

MOT test number

351592332861

Result

✓ Passed

- Advice** Under tray fitted obscuring some underside components
- Advice** Both front tyres wearing inner edges

**MOT #14**

2016-05-09 12:15

MOT test number

238231759028

Result**✗ Failed****Advice** Under tray fitted obscuring some underside components**Fail** Power steering fluid level below minimum empty (2.3.1)**Fail** Offside Front Brake pad(s) less than 1.5 mm thick metal to metal (3.5.1g)**Fail** Nearside Front Lower Suspension arm rubber bush deteriorated resulting in excessive movement bush where suspension leg mounts (2.4.G.2)**Fail** Offside Stop lamp not working (1.2.1b)**Fail** Registration plate lamp insecure both lamps (1.1.C.1c)**Fail** Offside Front constant velocity joint gaiter damaged to the extent that it no longer prevents the ingress of dirt etc (2.5.C.1a)**Advice** Both front tyres wearing inner edges**Fail** Power steering malfunctioning (2.3.3a)**Fail** Offside Front brake disc in such a condition that it is seriously weakened due to front pad (3.5.1i)**Fail** Offside Front Lower Suspension arm rubber bush deteriorated resulting in excessive movement bush where lower suspension arm mounts (2.4.G.2)**Fail** Offside Rear Stop lamp adversely affected by the operation of another lamp lamp has a bad earth (1.2.1f)**Fail** Nearside Front constant velocity joint gaiter damaged to the extent that it no longer prevents the ingress of dirt etc (2.5.C.1a)**MOT #13**

2015-04-07 14:34

MOT test number

258367795059

Result**✓ Passed****Notice** Front tyres wearing off on inner edges**Notice** Child seat fitted not allowing full inspection of adult belt

**MOT #12**

2015-04-02 16:38

MOT test number

665612895055

Result**✗ Failed****Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)**Notice** Front tyres wearing off on inner edges**Fail** Offside Rear Rear wheel bearing rough when rotated (2.6.1)**Notice** Child seat fitted not allowing full inspection of adult belt**Fail** Nearside Rear Rear wheel bearing rough when rotated (2.6.1)**Advice** Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**MOT #11**

2014-04-07 17:19

MOT test number

909407994027

Result**✓ Passed****Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Advice** Nearside Rear Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**Notice** Child seat fitted not allowing full inspection of adult belt**Advice** Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

**MOT #10**

2014-04-04 17:23

MOT test number

839284394040

Result**✗ Failed****Pass with rectification**

Windscreen washer provides insufficient washer liquid (8.2.3)

Fail

Offside Front suspension has excessive play in a lower suspension ball joint (2.5.B.1a)

Advice

Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Notice

Child seat fitted not allowing full inspection of adult belt

Fail

Nearside Front suspension has excessive play in a lower suspension ball joint (2.5.B.1a)

Advice

Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Advice

Nearside Rear Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)

MOT #9

2013-03-18 16:38

MOT test number

416687973036

Result**✓ Passed****Advice**

Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)

Notice

Nail in offside rear tyre

Notice

Nail in nearside rear tyre

Advice

Offside Front Tyre worn close to the legal limit (4.1.E.1)

**MOT #8**

2013-03-18 15:43

MOT test number

696377573090

Result**✗ Failed****Notice** Nail in nearside rear tyre**Pass with rectification** Driver's seat fore and aft adjustment mechanism not functioning as intended.
(6.2.A.3)**Fail** Nearside Rear Brake hose has insufficient room to move, resulting in fouling on any part (3.6.B.4a)**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**Pass with rectification** Headlamp aim too high (1.8)**Notice** Nail in offside rear tyre**Fail** Nearside Rear Brake hose stretched (3.6.B.4c)**Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**MOT #7**

2012-03-05 13:30

MOT test number

256065562074

Result**✓ Passed****Advice** Nearside Outer Front Lower Suspension arm has slight play in a pin/bush (2.4.G.2)**MOT #6**

2012-03-05 12:06

MOT test number

138715062056



Result**✗ Failed****Fail** Registration plate lamp not working (1.1.C.1d)**Fail** Nearside Outer Front Lower Suspension arm attachment bracket/mounting nut missing (2.4.G.1)**Pass with rectification** Windscreen washer provides insufficient washer liquid (8.2.3)**Pass with rectification** Headlamp aim too low (1.8)**Advice** Nearside Outer Front Lower Suspension arm has slight play in a pin/bush (2.4.G.2)

**MOT #5** 2011-03-09 14:31**MOT test number** 548908361077**Result** ✓ Passed**MOT #4** 2011-03-07 16:45**MOT test number** 618746561020**Result** ✗ Failed

- Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)
- Fail** Nearside Rear Brake lining(s) less than 1.5 mm thick (3.5.1g)
- Notice** Nail in nearside rear tyre
- Fail** Nearside Lower Front suspension has excessive play in a lower suspension ball joint (2.5.B.1a)
- Fail** Nearside rear brake binding (3.7.B.1)

MOT #3 2011-03-04 12:28**MOT test number** 318723261061**Result** ✗ Failed

- Fail** Nearside Rear Brake pad(s) less than 1.5 mm thick (3.5.1g)
- Fail** Offside Rear rear brake binding (3.7.B.1)
- Notice** Nail in nearside rear tyre
- Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)
- Fail** Nearside Front Axle swivel joint has excessive play (2.5.A.3b)
- Fail** Nearside Rear rear brake binding (3.7.B.1)
- Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)
- Notice** Child seat fitted not allowing full inspection of adult belt

**MOT #2** 2010-03-06 11:02**MOT test number** 162765560471**Result**  Passed**MOT #1** 2010-03-05 17:18**MOT test number** 820074160060**Result**  Failed**Fail** Nearside Front Windscreen washer provides insufficient washer liquid (8.2.3)**Fail** Nearside Headlamp aim too low (1.8)**Fail** Offside Front Windscreen washer provides insufficient washer liquid (8.2.3)**Fail** Offside Headlamp not working on dipped beam (1.7.5a)



Damage history


Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	

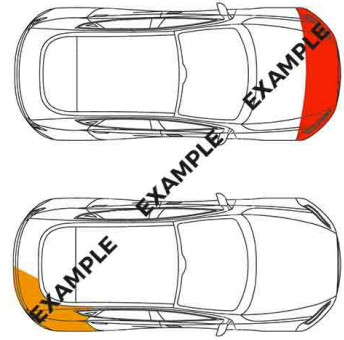

Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this PEUGEOT? How many owners did this PEUGEOT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this PEUGEOT had different number plates.

Number of plates	1
Current registration	 KY07KKL
Plate since	2019-08-29
Current registration	 KY07KKL
Plate since	2019-08-29

More info >



Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this PEUGEOT is financed.


Finance company	XXXXXXXX	XXXX
Date of agreement	XXXXXXXX	XXXX
Agreement type	XXXXXXXX	XXXX
Agreement term	XXXXXXXX	XXXX
Agreement number	XXXXXXXX	XXXX
Contact info	XXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	26
First mileage registration	2007-03-05
Last registration	2022-05-16
Complete history	See info

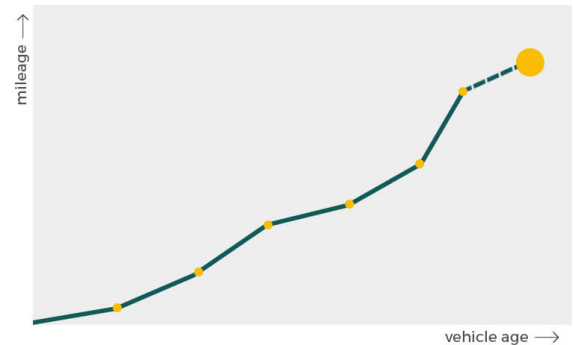

Registration #1	2007-03-05	23 mi
Registration #2	2010-03-05	42.772 mi
Registration #3	2010-03-06	42.801 mi
Registration #4	2011-03-04	57.213 mi
Registration #5	2011-03-07	57.281 mi
Registration #6	2011-03-09	57.285 mi
Registration #7	2012-03-05	73.219 mi
Registration #8	2012-03-05	73.222 mi
Registration #9	2013-03-18	83.435 mi
Registration #10	2013-03-18	83.435 mi
Registration #11	2014-04-04	93.988 mi
Registration #12	2014-04-07	93.993 mi
Registration #13	2015-04-02	103.203 mi
Registration #14	2015-04-02	103.203 mi
Registration #15	2015-04-02	103.203 mi
Registration #16	2015-04-02	103.203 mi
Registration #17	2015-04-02	103.203 mi
Registration #18	2015-04-02	103.203 mi
Registration #19	2015-04-02	103.203 mi
Registration #20	2015-04-02	103.203 mi
Registration #21	2015-04-02	103.203 mi
Registration #22	2015-04-02	103.203 mi
Registration #23	2015-04-02	103.203 mi
Registration #24	2015-04-02	103.203 mi
Registration #25	2015-04-02	103.203 mi
Registration #26	2015-04-02	103.203 mi

More info >



Car features

The PEUGEOT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete PEUGEOT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating



Video

[see crash video](#)



Dimensions & weight

Width	1811 mm
Height	1494 mm
Length	4763 mm
Wheel base	2725 mm
Kerb weight	1635 kg
Max. allowed weight	2195 kg

Additional information

Fuel tank capacity	66 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	5

Number of axles	2
Engine number	DYUK4021278