



BD06XPE

report date: 2024-03-28

General information

| | |
|---------------------|-------------------------|
| Make | FORD |
| Model | TRANSIT 350 MWB DRW C/C |
| Colour | White |
| Year of manufacture | 2006 |
| Gearbox | 5 speed Manual |

Engine & fuel consumption

| | |
|-----------------|----------|
| Power | 74 BHP |
| Engine capacity | 2.402 cc |
| Cylinders | 4 |
| Fuel type | Diesel |



LABEL UNKNOWN



Internet history

Entry 1

| | |
|---------------|-----------------------------|
| Date | 2021-05-26 |
| Pictures | 1 |
| Listing price | View report |



source: autoonline.co.uk



MOT history

| | |
|--------------------|------------|
| MOT expiry date | 2020-11-20 |
| MOT pass rate | 57 % |
| MOT passed | 8 |
| Failed MOT tests | 6 |
| Total advice items | 39 |
| Total items failed | 40 |

| | |
|------------------|------------------|
| MOT #14 | 2019-05-14 11:25 |
| MOT test number | 762753311814 |
| Result | ✓ Passed |
| Next expiry date | 2020-11-20 |

| | |
|-----------------|--|
| MOT #13 | 2019-05-09 15:09 |
| MOT test number | 963219687751 |
| Result | ✗ Failed |
| MAJOR | Fuel cap/sealing device missing fuel cap missing (6.1.3 (b) (i)) |
| MAJOR | Nearside Front Wheel bearing has excessive play (5.1.3 (a) (i)) |
| MAJOR | Offside Stop lamp(s) not working (4.3.1 (a) (ii)) |
| MAJOR | Offside Front Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii)) |
| MAJOR | Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii)) |

| | |
|-----------------|--|
| MOT #12 | 2018-05-21 10:52 |
| MOT test number | 857919788273 |
| Result | ✓ Passed |
| Advice | Clutch pedal rubber missing |
| Advice | Offside Front Brake pad(s) wearing thin off side front brake pads low (3.5.1g) |

**MOT #11**

2018-05-10 11:50

MOT test number

384798347418

Result**✗ Failed**

- Fail** Offside Front Outer Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings off side outer sill corroded (6.1.B.2)
- Fail** Nearside Rear Inner Tyre tread depth below requirements of 1.6mm near side rear inner tyre worn (4.1.E.1)
- Advice** Offside Front Brake pad(s) wearing thin off side front brake pads low (3.5.1g)
- Fail** Rear Rear fog lamp not working (1.3.2b)
- Fail** Offside Front Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings off side underside/ door step corroded (6.1.B.2)
- Fail** Fuel tank leaking fuel leak from tank (7.2.3)
- Fail** Nearside Rear Outer Tyre incorrectly seated on the wheel rim near side rear outer tyre flat (4.1.D.1d)
- Advice** Clutch pedal rubber missing
- Fail** Hazard warning lamps inoperative (1.4.B.1b)
- Fail** Statutory seat belt missing rear crew cab seat belts missing (5.1.1)

MOT #10

2017-04-26 07:06

MOT test number

640579676141

Result**✓ Passed****MOT #9**

2016-05-10 16:19

MOT test number

371637318191

Result**✓ Passed**

**MOT #8**

2016-04-26 14:52

MOT test number

345147133502

Result**✗ Failed**

- Fail** Offside Headlamp aim beam image obviously incorrect (1.8.A.1b)
- Fail** Nearside Front Lower Suspension arm rubber mounting deteriorated resulting in excessive movement rear (2.4.G.2)
- Fail** Offside rear brake excessively fluctuating (3.7.B.3)
- Fail** Nearside Rear position lamp(s) incorrect colour (1.1.A.3e)
- Fail** Nearside Headlamp aim too high (1.8)
- Fail** Offside Front Lower Suspension arm rubber mounting deteriorated resulting in excessive movement rear (2.4.G.2)
- Fail** Registration plate lamp not working both (1.1.C.1d)

MOT #7

2015-05-11 14:44

MOT test number

227151635404

Result**✓ Passed**

- Notice** Oil leak
- Advice** Parking brake lever has little reserve travel (3.1.6b)
- Notice** Passenger seat(s) missing at time of test
- Advice** Offside Track rod end ball joint has slight play (2.2.B.1f)
- Notice** Play in steering rack inner joint(s)
- Advice** Offside Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
- Notice** Os sill is corroded but not in prescribed area
- Advice** Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)



MOT #62015-05-11 12:48

MOT test number185091835127

| Result | | ✗ Failed |
|--------|--|----------|
| Notice | Play in steering rack inner joint(s) | |
| Advice | Parking brake lever has little reserve travel (3.1.6b) | |
| Notice | Os sill is corroded but not in prescribed area | |
| Advice | Offside Track rod end ball joint has slight play (2.2.B.1f) | |
| Advice | Rear Service brake: service brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7) | |
| Notice | Oil leak | |
| Fail | Nearside Front Track rod end ball joint has excessive play (2.2.B.1f) | |
| Notice | Passenger seat(s) missing at time of test | |
| Advice | Offside Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a) | |
| Advice | Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2) | |

**MOT #5**

2015-04-15 17:13

MOT test number

608225705193

Result**✗ Failed**

Fail Nearside Front Lower Suspension arm rubber bush deteriorated resulting in excessive movement (2.4.G.2)

Fail Nearside Front position lamp(s) not working (1.1.A.3b)

Fail Fuel cap/sealing device does not fasten securely maintaining the sealing arrangement (7.2.4b)

Fail Parking brake lever has no reserve travel (3.1.6b)

Fail Nearside Registration plate lamp not working (1.1.C.1d)

Fail Offside Windscreen wiper does not clear the windscreen effectively (8.2.2)

Fail Offside Obligatory mirror seriously damaged, affecting the rear view (8.1.2a)

Fail Rear Passenger's seat insecure (6.2.A.1)

Fail Offside Track rod end ball joint has excessive play (2.2.B.1f)

Fail Offside Rear fog lamp not working (1.3.2b)

Fail Anti-lock braking system warning lamp indicates an ABS fault (3.4.1c)

Fail Offside Rear Wheel nut(s) missing (4.2.A.1e)

Fail Offside Rear position lamp(s) not working (1.1.A.3b)

Fail Nearside Windscreen wiper does not clear the windscreen effectively (8.2.2)

Fail Parking brake: efficiency below requirements (3.7.B.7)

Fail Offside Registration plate lamp not working (1.1.C.1d)

Fail Rear Statutory seat belt missing (5.1.1)

Fail Offside Side repeater not working (1.4.A.2c)

Fail Driver's seat insecure (6.2.A.1)

**MOT #4** 2014-03-13 12:00**MOT test number** 205232274087**Result** ✓ Passed

- Advice** Offside Track rod end ball joint has slight play (2.2.B.1f)
- Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Offside Front Brake pipe slightly corroded (3.6.B.2c)
- Advice** Offside Parking brake: parking brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7)

MOT #3 2011-01-13 18:12**MOT test number** 878083711063**Result** ✓ Passed**MOT #2** 2009-06-13 12:54**MOT test number** 492604169133**Result** ✓ Passed

- Notice** Propshaft component defective
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Nearside Inner Rear Tyre worn close to the legal limit (4.1.E.1)
- Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)



| | |
|-----------------|--|
| MOT #1 | 2009-06-12 12:41 |
| MOT test number | 721313569131 |
| Result | ✗ Failed |
| Advice | Nearside Inner Rear Tyre worn close to the legal limit (4.1.E.1) |
| Fail | Brake pedal anti-slip provision worn smooth (3.3.A.1b) |
| Fail | Nearside Upper Front position lamp(s) not working (1.1.A.3b) |
| Fail | Rear Anti-roll bar synthetic bush deteriorated resulting in excessive movement (2.4.G.2) |
| Advice | Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i) |
| Notice | Propshaft component defective |
| Fail | Nearside Front Windscreen wiper does not clear the windscreen effectively (8.2.2) |
| Fail | Offside Front Front wheel bearing rough when rotated (2.5.A.2) |
| Advice | Front Brake pad(s) wearing thin (3.5.1g) |



Tax & MOT check

X
Untaxed

Tax expired:
7 October 2020

X
MOT

Expired:
20 November 2020

| | |
|------------------|---------------------------------|
| Tax status | Expired at 7 October 2020 |
| Days left | 1299 days too late |
| MOT expiry date | 20 November 2020 |
| Full MOT history | See MOT history |



Damage history

Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report [here](#) for the results.

Damage 1

| | |
|----------|--|
| Date | |
| Category | |
| Type | |

Damage 2

| | |
|----------|--|
| Date | |
| Category | |
| Type | |



Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

| | |
|-----------------------------|----------|
| Trade retail value | £ 19,999 |
| Auction value | £ 19,999 |
| Average private trade value | £ 19,999 |

More info >



Owner history

For how long did the current and previous owner(s) have this FORD? How many owners did this FORD have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

| | |
|-------|------------|
| Owner | Start date |
| Owner | Start date |
| Owner | Start date |
| Owner | Start date |
| Owner | Start date |
| Owner | Start date |
| Owner | Start date |

More info >

Plate changes

See in this check if this FORD had different number plates.

| | |
|----------------------|----------------|
| Number of plates | 1 |
| Current registration | BD06XPE |
| Plate since | 2019-03-28 |
| Current registration | BD06XPE |
| Plate since | 2019-03-28 |

More info >



Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FORD is financed.


| | | |
|-------------------|------------|------|
| Finance company | XXXXXXXXXX | XXXX |
| Date of agreement | XXXXXXXXXX | XXXX |
| Agreement type | XXXXXXXXXX | XXXX |
| Agreement term | XXXXXXXXXX | XXXX |
| Agreement number | XXXXXXXXXX | XXXX |
| Contact info | XXXXXXXXXX | XXXX |

More info >



Mileage check

| | |
|----------------------------|--------------------------|
| Odometer | In miles |
| Mileage registrations | 16 |
| First mileage registration | 2006-06-14 |
| Last registration | 2019-05-14 |
| Complete history | See info |

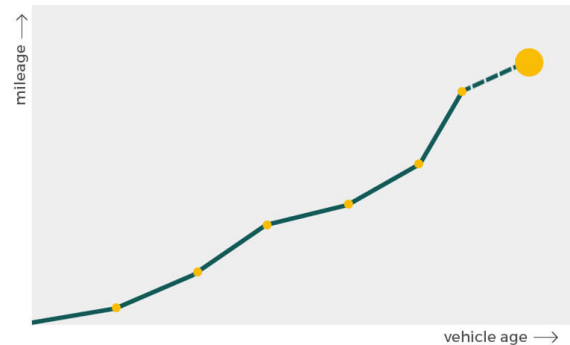

| | | |
|------------------|------------|------------|
| Registration #1 | 2006-06-14 | 28 mi |
| Registration #2 | 2009-06-12 | 79.956 mi |
| Registration #3 | 2009-06-13 | 79.956 mi |
| Registration #4 | 2011-01-13 | 109.278 mi |
| Registration #5 | 2014-03-13 | 133.649 mi |
| Registration #6 | 2015-04-15 | 153.166 mi |
| Registration #7 | 2015-05-11 | 153.344 mi |
| Registration #8 | 2015-05-11 | 153.344 mi |
| Registration #9 | 2015-05-11 | 153.344 mi |
| Registration #10 | 2015-05-11 | 153.344 mi |
| Registration #11 | 2015-05-11 | 153.344 mi |
| Registration #12 | 2015-05-11 | 153.344 mi |
| Registration #13 | 2015-05-11 | 153.344 mi |
| Registration #14 | 2015-05-11 | 153.344 mi |
| Registration #15 | 2015-05-11 | 153.344 mi |
| Registration #16 | 2015-05-11 | 153.344 mi |

More info >



Car features

The FORD factory car options list is only available in the premium report.

| | |
|-------|------------------|
| S0225 | Air conditioning |
| S0295 | |
| S0482 | |
| S0501 | |
| S0566 | |
| S0567 | |
| S0569 | |

View the complete FORD factory list for this vehicle [here](#).

More info >

Additional information

| | |
|-----------------|------------------|
| Fuel delivery | Direct Injection |
| Number of doors | 2 |
| Number of seats | 3 |
| Engine number | 5D79409 |