



report date: 2024-03-28

General information

Make	FIAT
Model	DOBLO ACTIVE
Colour	Grey
Year of manufacture	-
Top speed	105 mph
Gearbox	5 speed Manual

Engine & fuel consumption

Power	105 BHP
Max. torque	205 Nm at 1.750 rpm
Cylinders	4
Fuel type	Diesel
Consumption city	37.7 mpg
Consumption extra urban	58.9 mpg
Consumption combined	48.7 mpg




LABEL UNKNOWN



Internet history

Entry 1

Date	2021-05-20
Pictures	15
Listing price	View report

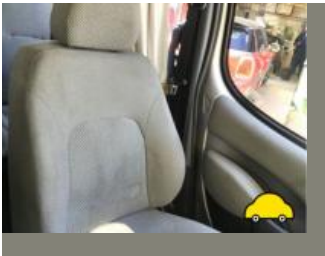

source: autotrader.co.uk



MOT history

MOT #21

2023-10-18 15:00

MOT test number

426971061477

Result**✗ Failed****MAJOR** Offside Front Direction indicator incorrect colour (4.4.3 (a))**Advice** Offside Front Tyre worn close to legal limit/worn on edge inner edge (5.2.3 (e))**MAJOR** Offside Front Suspension arm pin or bush excessively worn front bush + ball joint has excessive wear (5.3.4 (a) (i))**MAJOR** Nearside Rear Direction indicator incorrect colour (4.4.3 (a))**Advice** Rear Exhaust has a minor leak of exhaust gases rear silencer is missing (6.1.2 (a))**MAJOR** Offside Headlamp has a product on the lens so that the light output is severely reduced (4.1.4 (b))**Advice** Offside Rear Anti-roll bar linkage pin or bush worn but not resulting in excessive movement 'D' bush (5.3.4 (a) (i))**MAJOR** Nearside Front Direction indicator incorrect colour (4.4.3 (a))**Advice** Rear service brake only just met requirements, overall percentage is at 52%. minimum + 50%**MAJOR** Nearside Front Suspension arm pin or bush excessively worn front bush (5.3.4 (a) (i))**MAJOR** Offside Rear Direction indicator incorrect colour (4.4.3 (a))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge inner edge (5.2.3 (e))**MAJOR** Front Exhaust has a major leak of exhaust gases (6.1.2 (a))**MAJOR** Nearside Headlamp has a product on the lens so that the light output is severely reduced (4.1.4 (b))**Advice** Brake fluid close to minimum mark (1.1.10 (d) (ii))**MAJOR** Brake lever pivot has excessive wear or free play insecure (1.1.1 (b))**Minor** Registration plate lamp inoperative in the case of multiple lamps or light sources x1 (4.7.1 (b) (i))**MAJOR** Offside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))

**MOT #20**

2022-10-17 11:06

MOT test number

513492922553

Result

✓ Passed

- Advice** Rear Passenger seat(s) missing at time of test
- Advice** Offside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Nearside Rear Direction indicator slightly discoloured (4.4.3 (a))
- Minor** Nearside Headlamp lens slightly defective (4.1.1 (b) (i))
- Advice** Front Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Front Brake pad(s) wearing thin Close to limit (1.1.13 (a) (ii))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Offside Rear Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))
- Advice** Offside Rear Direction indicator slightly discoloured (4.4.3 (a))
- Minor** Offside Headlamp lens slightly defective (4.1.1 (b) (i))

**MOT #19**

2021-10-19 09:07

MOT test number

920522829379

Result

✓ Passed

- Advice** Offside Rear Wheel bearing slightly noisy (5.1.3 (b) (i))
- Advice** Offside Front Tyre worn close to legal limit/worn on edge Bald on inner edge (5.2.3 (e))
- Advice** Front Registration plate deteriorated but not likely to be misread Damaged (0.1 (b))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement Rear-most (5.3.4 (a) (i))
- Advice** Rear Passenger seat(s) missing at time of test Offside and Centre
- Advice** Oil leak, but not excessive Slight (8.4.1 (a) (i))
- Advice** Rear Direction indicator slightly discoloured Both (4.4.3 (a))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement Rear-most (5.3.4 (a) (i))

MOT #18

2020-10-21 09:01

MOT test number

695318428620

Result

✓ Passed

- Advice** Nearside Front Oil leak, but not excessive (8.4.1 (a) (i))
- Minor** Central Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement front wishbone rear bush (5.3.4 (a) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge wearing on inner edge (5.2.3 (e))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Minor** Offside Front Suspension arm ball joint dust cover severely deteriorated (5.3.4 (b) (i))
- Advice** Rear Passenger seat(s) missing at time of test
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge wearing on inner edge (5.2.3 (e))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement front wishbone rear bush (5.3.4 (a) (i))

**MOT #17**

2020-10-12 08:56

MOT test number

458942653507

Result**✗ Failed****Minor**

Central Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))

Advice

Offside Front Suspension arm pin or bush worn but not resulting in excessive movement front wishbone rear bush (5.3.4 (a) (i))

Advice

Front Registration plate deteriorated but not likely to be misread (0.1 (b))

Advice

Rear Passenger seat(s) missing at time of test

Advice

Offside Rear Tyre worn close to legal limit/worn on edge wearing on inner edge (5.2.3 (e))

MAJOR

Nearside Rear Wheel bearing rough when rotated (5.1.3 (b) (i))

Minor

Offside Front Suspension arm ball joint dust cover severely deteriorated (5.3.4 (b) (i))

Advice

Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement front wishbone rear bush (5.3.4 (a) (i))

Advice

Nearside Front Oil leak, but not excessive (8.4.1 (a) (i))

Advice

Nearside Rear Tyre worn close to legal limit/worn on edge wearing on inner edge (5.2.3 (e))

MAJOR

Nearside Front Suspension arm ball joint excessively worn (5.3.4 (a) (i))

MOT #16

2019-04-17 14:41

MOT test number

690455609837

Result**✓ Passed****Advice**

Offside Front Inner Tyre worn close to legal limit/worn on edge EDGE, RIGHT ON LEGAL LIMITS. (5.2.3 (e))

Minor

Central Front Lower Windscreen damaged but not adversely affecting driver's view `A` Zone. (3.2 (a) (i))

Advice

Nearside Front Inner Tyre worn close to legal limit/worn on edge EDGE. (5.2.3 (e))



MOT #15

2019-04-09 17:35

MOT test number

881979905378

Result

✗ Failed

- MAJOR** Central Rear Exhaust has a major leak of exhaust gases (6.1.2 (a))
- Advice** Offside Front Inner Tyre worn close to legal limit/worn on edge EDGE, RIGHT ON LEGAL LIMITS. (5.2.3 (e))
- MAJOR** Nearside Rear Direction indicator incorrect colour (4.4.3 (a))
- MAJOR** Nearside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- MAJOR** Nearside Rear Upper Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))
- Advice** Nearside Front Inner Tyre worn close to legal limit/worn on edge EDGE. (5.2.3 (e))
- MAJOR** Offside Rear Direction indicator incorrect colour (4.4.3 (a))
- Minor** Central Front Lower Windscreen damaged but not adversely affecting driver's view `A` Zone. (3.2 (a) (i))
- MAJOR** Offside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

MOT #14

2018-04-18 11:03

MOT test number

241546675730

Result

✓ Passed

- Advice** Nearside Lower Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)
- Advice** Offside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Advice** Nearside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Advice** Exhaust has a minor leak of exhaust gases SYSTEM HAS SMALL LEAKS. (7.1.2)

MOT #13

2017-03-02 08:31

MOT test number

352026226806

Result

✓ Passed

- Advice** Central Rear Exhaust has a minor leak of exhaust gases (7.1.2)
- Advice** Offside Front Headlamp deteriorated but light output not reduced (1.7.5a)

**MOT #12** 2016-02-22 13:01**MOT test number** 154841767919**Result** ✓ Passed**Advice** Nearside Rear Tyre wearing on outer edge.**Advice** Offside Front Tyre wearing on inner edge.**MOT #11** 2015-03-02 13:08**MOT test number** 446101065049**Result** ✓ Passed**Advice** Lower Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)**MOT #10** 2014-03-03 15:37**MOT test number** 117082864014**Result** ✓ Passed**Advice** Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)**MOT #9** 2013-03-22 15:39**MOT test number** 527531883080**Result** ✓ Passed**MOT #8** 2013-03-21 17:10**MOT test number** 375890883087**Result** ✗ Failed**Fail** Offside Windscreen wiper does not clear the windscreen effectively (8.2.2)**Fail** Nearside Windscreen wiper does not clear the windscreen effectively (8.2.2)**Fail** Nearside Rear Anti-roll bar has excessive play in a pin/bush (2.4.G.2)

**MOT #7** 2012-02-24 10:43**MOT test number** 417035352084**Result** ✓ Passed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**MOT #6** 2011-02-25 14:48**MOT test number** 707766051047**Result** ✓ Passed**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**MOT #5** 2011-02-18 14:30**MOT test number** 809689041029**Result** ✗ Failed**Advice** Rear Upper Shock absorber has a slightly worn bush (2.7.4)**Fail** Exhaust emits an excessive level of metered smoke for a turbo charged engine (7.4.B.3b)**Notice** Both front brake discs very worn**Advice** Offside Inner Front Tyre worn close to the legal limit (4.1.E.2a)**MOT #4** 2010-02-19 09:55**MOT test number** 864780750076**Result** ✓ Passed**Advice** Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)**Advice** Exhaust has part of the system slightly deteriorated (7.1.1a)**Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Advice** Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)



MOT #3	2009-02-17 11:54
MOT test number	601548349084
Result	✓ Passed
Advice	Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)
Advice	Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

MOT #2	2008-02-18 14:49
MOT test number	511729048016
Result	✓ Passed
Advice	Nearside Rear Tyre worn close to the legal limit (4.1.E.1)
Advice	Offside Front Tyre worn close to the legal limit (4.1.E.1)

MOT #1	2007-02-20 10:54
MOT test number	863751457057
Result	✓ Passed



Damage history

Check the damage history for this FIAT. See if, where and when this FIAT had damage and the car repair costs. We also check if this FIAT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra FIAT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FIAT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,299
Auction value	£ 19,299
Average private trade value	£ 19,299

More info >



Owner history

For how long did the current and previous owner(s) have this FIAT? How many owners did this FIAT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date

More info >

Plate changes

See in this check if this FIAT had different number plates.

Number of plates	1
Current registration	
Plate since	2024-03-28
Current registration	
Plate since	2024-03-28

More info >



Finance check

Check if this FIAT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FIAT has been settled.

If not, and you buy this FIAT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FIAT is financed.

Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	23
First mileage registration	2004-02-27
Last registration	2023-10-18
Complete history	See info



Registration #1	2004-02-27	23 mi
Registration #2	2007-02-20	28.790 mi
Registration #3	2008-02-18	37.496 mi
Registration #4	2009-02-17	45.135 mi
Registration #5	2010-02-19	51.844 mi
Registration #6	2011-02-18	56.133 mi
Registration #7	2011-02-25	56.304 mi
Registration #8	2012-02-24	61.038 mi
Registration #9	2013-03-21	63.988 mi
Registration #10	2013-03-22	63.988 mi
Registration #11	2014-03-03	67.995 mi
Registration #12	2015-03-02	70.613 mi
Registration #13	2016-03-02	75.222 mi
Registration #14	2017-03-02	79.831 mi
Registration #15	2018-03-02	84.440 mi
Registration #16	2019-03-02	89.049 mi
Registration #17	2020-03-02	93.658 mi
Registration #18	2021-03-02	98.267 mi
Registration #19	2022-03-02	102.876 mi
Registration #20	2023-03-02	107.485 mi
Registration #21	2024-03-02	112.094 mi
Registration #22	2025-03-02	116.703 mi
Registration #23	2026-03-02	121.312 mi

More info >



Car features

The FIAT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FIAT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★☆

Video [see crash video](#)



Dimensions & weight

Width	1714 mm
Height	1800 mm
Length	4159 mm
Wheel base	2583 mm
Kerb weight	1320 kg
Max. allowed weight	2975 kg

Additional information

Fuel tank capacity	60 l
Fuel delivery	Direct Injection
Number of doors	5
Number of axles	2

Engine number	3880050
---------------	---------