





report date: 2024-03-28

General information

Make	PEUGEOT
Model	207 URBAN
Colour	Red
Year of manufacture	-
Top speed	106 mph
0 - 60 mph	15.7 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	72 BHP
Max. torque	118 Nm at 3.300 rpm
Cylinders	4
Fuel type	Petrol
Consumption city	33.6 mpg
Consumption extra urban	56.5 mpg
Consumption combined	44.8 mpg



CarCheck.co.uk page 1/11



report date: 2024-03-28

MOT history

MOT #12 2020-03-27 15:03

MOT test number 315485590329

Result \(\sqrt{Passed} \)

Next expiry date 2021-03-26

Advice Offside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))

Advice Oil leak, but not excessive At perforated sump (8.4.1 (a) (i))

Advice Offside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

Minor Nearside Front Upper Anti-roll bar ball joint dust cover severely deteriorated (5.3.4 (b) (i))

MOT #11 2020-03-27 11:57

MOT test number 293734571162

Result X Failed

DANGEROUS Nearside Rear Tyre has a lump, caused by separation or partial failure of its structure (5.2.3 (d) (ii))

Advice Offside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

Minor Nearside Front Upper Anti-roll bar ball joint dust cover severely deteriorated (5.3.4 (b) (i))

Advice Offside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))

Pass with rectification Nearside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))

DANGEROUS Offside Front Tyre tread depth below requirements of 1.6mm At 1.57 mm (5.2.3 (e))

Advice Oil leak, but not excessive At perforated sump (8.4.1 (a) (i))

MOT #10 2019-03-21 14:29

MOT test number 745917448713

Result ✓ Passed

Advice Nearside Rear Tyre worn close to legal limit/worn on edge at 1.89 mm (5.2.3 (e))

CarCheck.co.uk page 2/11



report date: 2024-03-28

MOT test number
941788242614

Result

MAJOR Nearside Front Coil spring fractured or broken (5.3.1 (b) (i))

Advice Rear Exhaust mounting defective detached (6.1.2 (a))

Advice Nearside Rear Tyre worn close to legal limit/worn on edge at 1.89 mm (5.2.3 (e))

MOT #8

MOT test number

487125052710

Result

Advice REAR silencer mount detached

MOT #7 2018-03-19 09:23 **MOT** test number 929032583911 Result × Failed Nearside Headlamp not working on dipped beam (1.7.5a) **Fail** Fail Nearside Front Tyre tread depth below requirements of 1.6mm At 1.29 mm (4.1.E.1) Brake hydraulic reservoir cap missing (3.6.G.1a) Fail Fail Offside Windscreen wiper does not clear the windscreen effectively (8.2.2) Fail Offside Front Tyre tread depth below requirements of 1.6mm At 1.23 mm (4.1.E.1) **Advice** REAR silencer mount detached Fail Offside Front Inner Brake pad(s) less than 1.5 mm thick (3.5.1g)

CarCheck.co.uk page 3/11



report date: 2024-03-28

MOT #6		2017-03-09 12:03
MOT test	number	885939049920
Result		✓ Passed
Advice	Rear exhaust mount loose	
Advice	Offside Front tyre worn on edges	

MOT #5	2016-03-22 11:11
MOT test number	403940197865
Result	✓ Passed
Advice Rear silencer mount detached	

MOT #4	2015-03-16 13:31
MOT test number	867035275063
Result	✓ Passed
Notice Rear silencer metal mount deteriorated	


MOT #3	2014-03-19 15:56
MOT test number	145798174084
Result	✓ Passed
Notice Nail in offside rear tyre	

MOT #2	2013-03-22 10:30
MOT test number	996731983089
Result	✓ Passed
Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)	

CarCheck.co.uk page 4/11



report date: 2024-03-28

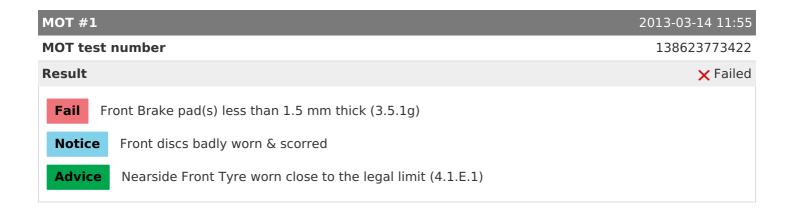

CarCheck.co.uk page 5/11



report date: 2024-03-28

Damage history

Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report here for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 6/11



report date: 2024-03-28

Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 7/11



report date: 2024-03-28

Owner history

e when miscory	
For how long did the current and previous owner(s) have this PEUGEOT? How many owner have? Check it in the premium report and see all owner registrations. Download the full report and see all owner registrations.	

Plate changes	More info >
See in this check if this PEUGEOT had different number plates.	
Number of plates	,
Current registration	NIK.
Plate since	
Current registration	OK SIE
Plate since	
	More info >

CarCheck.co.uk page 8/11



report date: 2024-03-28

Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this PEUGEOT is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	

Contact info

More info >

CarCheck.co.uk page 9/11



report date: 2024-03-28

Mileage check

Odometer	In miles
Mileage registrations	13
First mileage registration	2010-03-26
Last registration	2020-03-27
Complete history	See info



Registration #1	2010-03-26	11 mi
Registration #2	2013-03-14	21.149 mi
Registration #3	2013-03-22	21.265 mi
Registration #4	2014-03-19	28.001 mi
Registration #5	2015-03-16	35.661 mi
Registration #6	2016-03-22	43.770 mi
Registration #7	2017-03-09	50.484 mi
Registration #8		11.777 es
Registration #9		11.777 es
Registration #10		11.777 es
Registration #11		11.777 es
Registration #12		11.777 es
Registration #13		10.377 au

More info >

CarCheck.co.uk page 10/11



report date: 2024-03-28

Car features

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

Safety ratings

NCAP rating	****
Video	see crash video



Dimensions & weight

Width	1720 mm
Height	1473 mm
Length	4030 mm
Wheel base	2540 mm
Kerb weight	1215 kg
Max. allowed weight	1617 kg

Additional information

Fuel tank capacity	50 I
Fuel delivery	Multi-Point Injection
Number of doors	5
Number of seats CarCheck.co.uk	5 page 11/11

Number of axles 2

Engine number FSW86180392