





report date: 2024-03-28

General information

Make	FORD
Model	TRANSIT 260 SPORT LR P/V
Colour	Red
Year of manufacture	2008
Gearbox	6 speed Manual

Engine & fuel consumption

Power	140 BHP
Max. torque	350 Nm at 1.800 rpm
Engine capacity	2.198 cc
Cylinders	4
Fuel type	Diesel



CarCheck.co.uk page 1/17



report date: 2024-03-28

MOT history

MOT expiry date	2021-03-05
MOT pass rate	63 %
MOT passed	10
Failed MOT tests	6
Total advice items	84
Total items failed	28

MOT #16		2020-03-06 15:58
MOT test number	er	727725494555
Result		✓ Passed
Next expiry dat	e	2021-03-05
Advice Offsion	de Front Exhaust silencer slightly loose box outer skin (8.1.1 (b) (i)))
Advice Offside Front Inner Integral body structure is corroded but structural rigidity is not significantly reduced drivers side door step under back edge (6.1.1 (c) (i))		
Advice Offsion	de Front Wheel bearing has slight play (5.1.3 (a) (i))	

MOT #15	2019-04-25	5 13:42
MOT test	number 2379683	326718
Result	✓	Passed
Advice	Brake pipe corroded, covered in grease or other material both front to rear (1.1.11 (c))	
Advice (5.3.4 (a) (Offside Front Lower Suspension arm pin or bush worn but not resulting in excessive moveme	nt
Advice	Parking brake just made the efficiency. nearside cable or caliper sticking	
Advice	Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))	
Advice (a) (i))	Seat belt anchorage prescribed area is corroded but not considered excessive drivers step (7	7.1.1
Advice	Nearside Play in steering rack inner joint(s)	

CarCheck.co.uk page 2/17



report date: 2024-03-28

MOT #14 2019-04-24 11:26

MOT test number 816372923665

Result X Failed

Advice Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Fail Nearside Rear Direction indicator incorrect colour (4.4.3 (a))

Fail Central Upper Stop lamp(s) not working (4.3.1 (a) (ii))

Advice Nearside Play in steering rack inner joint(s)

Advice Brake pipe corroded, covered in grease or other material both front to rear (1.1.11 (c))

Advice Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Advice Offside Front Lower Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))

Fail Offside Rear Direction indicator incorrect colour (4.4.3 (a))

Advice Parking brake just made the efficiency. nearside cable or caliper sticking

Advice Offside Rear Nail in tyre

Fail

Nearside Front Service brake excessively fluctuating (1.2.1 (e))

Advice Seat belt anchorage prescribed area is corroded but not considered excessive drivers step (7.1.1 (a) (i))

MOT #13 2018-04-18 16:17

MOT test number 902297782358

Advice Front and rear tyres different sizes

Advice Offside Rear Nail in tyre

Advice Nearside side door wont open


Advice Offside Front Lower Suspension arm rubber bush deteriorated but not resulting in excessive

movement (2.4.G.2)

CarCheck.co.uk page 3/17



report date: 2024-03-28

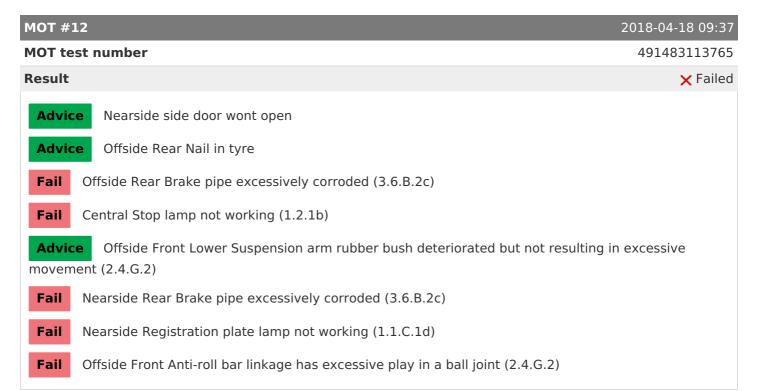

MOT #11		2017-04-26 10:44
MOT test	number	488730511713
Result		✓ Passed
Advice	Offside Rear Brake pipe slightly corroded (3.6.B.2c)	
Advice	Corrosion and holes in drivers step	
Advice	Nearside Rear Brake pipe slightly corroded (3.6.B.2c)	
Advice movement	Offside Front Lower Suspension arm rubber bush deteriorated but not resulting (2.4.G.2)	ng in excessive

CarCheck.co.uk page 4/17



report date: 2024-03-28

MOT #10 2016-04-27 10:55

MOT test number 263681296472

Advice Oil leak on sump

Advice Rear Brake pad(s) wearing thin on limit (3.5.1g)

Advice High level brake light not working

Advice Offside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement

Advice Rear brake disc worn, pitted or scored, but not seriously weakened both discs (3.5.1i)

rear bush (2.4.G.2)

CarCheck.co.uk page 5/17



report date: 2024-03-28

MOT #9 2016-04-25 10:49

MOT test number 729770602853

Result X Failed

Advice Oil leak on sump

Fail Offside Front Power steering pipe(s) or hose(s) leaking on chassis (2.3.3b)

Fail Nearside front brake excessively fluctuating (3.7.B.3)

Advice Offside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement rear bush (2.4.G.2)

Advice Rear brake disc worn, pitted or scored, but not seriously weakened both discs (3.5.1i)

Fail Offside Headlamp aim too low and too far to the right. (1.8)

Advice Rear Brake pad(s) wearing thin on limit (3.5.1g)

Fail Offside Front Brake pipe excessively corroded (3.6.B.2c)

Advice High level brake light not working

Fail Offside Rear Direction indicator incorrect colour (1.4.A.2f)

Fail Nearside Front Steering system has excessive free play detected at the steering wheel (steering rack fitted) rackend/drumstick (2.2.A.1b)

Advice Front brake disc worn, pitted or scored, but not seriously weakened both discs (3.5.1i)

Fail Nearside Front Suspension arm rubber bush bonding deteriorated resulting in excessive movement rear bush (2.4.G.2)

Advice Front Brake pad(s) wearing thin (3.5.1g)

Fail

Nearside Front Brake pipe excessively corroded (3.6.B.2c)

CarCheck.co.uk page 6/17



report date: 2024-03-28

MOT #8 2016-04-20 10:20

MOT test number 782489286318

Result × Failed

Fail Offside Front Brake pipe excessively corroded (3.6.B.2c)

Advice Wipers starting to smear screen

Advice Offside Rear Brake pipe slightly corroded (3.6.B.2c)

Advice Nearside Stop lamp slightly discoloured (1.2.1e)

Advice Oil leaks

Advice Nearside Front coil spring corroded (2.4.C.1b)

Advice Offside Rear fog lamp slightly discoloured (1.3.2e)

Advice General under body corrosion

Advice Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

(2111012)

Fail Nearside Front Brake pipe excessively corroded (3.6.B.2c)

Advice Nearside Rear Brake pipe slightly corroded (3.6.B.2c)

Fail Offside Rear Direction indicator incorrect colour (1.4.A.2f)

Advice Brake pad warning light on

Fail Offside Power steering pipe(s) or hose(s) leaking (2.3.3b)

Advice Offside Stop lamp slightly discoloured (1.2.1e)

Advice Offside rear park brake cable close to shock absorber

Advice Offside Front coil spring corroded (2.4.C.1b)

Fail Nearside Front front brake excessively fluctuating (3.7.B.3)

Advice Slight play steering rack joints nearside

Advice Offside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement

(2.4.G.2)

CarCheck.co.uk page 7/17



report date: 2024-03-28

MOT test number

Result

Advice Brake pipe slightly corroded (3.6.B.2c)

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Advice Power steering pipe(s) or hose(s) has slight seepage (2.3.3b)

MOT #6 2015-04-25 11:29 **MOT** test number 695425815104 Result × Failed Pass with rectification Offside Front position lamp(s) not working (1.1.A.3b) **Advice** Power steering pipe(s) or hose(s) has slight seepage (2.3.3b) Advice Brake pipe slightly corroded (3.6.B.2c) Pass with rectification Offside rear parking brake recording little or no effort (3.7.B.6a) Pass with rectification Offside Headlamp not working on main beam (1.7.5a) **Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

MOT test number

Fesult

Notice Play in steering rack inner joint(s)

Advice Power steering pipe(s) or hose(s) has slight seepage (2.3.3b)

Notice N/s + o/s rear tyres slight deterioration on sidewalls

CarCheck.co.uk page 8/17



Advice

RO08FYD

report date: 2024-03-28

MOT #4 2013-04-26 15:06 **MOT test number** 366276113193 Result ✓ Passed Notice Oil leak Advice Offside Front Power steering pipe(s) or hose(s) has slight seepage (2.3.3b) Advice Offside Front Tyre worn close to the legal limit (4.1.E.1) Notice Nail in nearside front tyre Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i) Notice Nail in offside front tyre Notice **EMISSIONS POOR SMOKE** Advice Offside Rear Direction indicator slightly discoloured (1.4.A.2f)

Nearside Front Tyre worn close to the legal limit (4.1.E.1)

CarCheck.co.uk page 9/17



report date: 2024-03-28

MOT #3 2013-04-22 15:55

MOT test number 815022213138

Result X Failed

Fail Front Windscreen has damage to the swept area in excess of a 40mm circle outside zone 'A' (8.3.1d)

Advice Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)

Notice Nail in nearside front tyre

Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)

Notice Oil leak

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Fail Offside Front Track rod end ball joint has excessive play (2.2.B.1f)

Advice Offside Front Power steering pipe(s) or hose(s) has slight seepage (2.3.3b)

Advice Offside Rear Direction indicator slightly discoloured (1.4.A.2f)

Notice Nail in offside front tyre

Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)

Fail Nearside Front Track rod end ball joint has excessive play (2.2.B.1f)

MOT #2 2012-04-30 11:51

MOT test number 539841122162

Result ✓ Passed

MOT #1 2011-05-09 11:50

MOT test number 298239321180

Advice Offside Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)

Notice NEARSIDE REAR TYRE ON 3MM

CarCheck.co.uk page 10/17



report date: 2024-03-28

Tax & MOT check





Tax status Expired at 16 November 2020

Days left 1261 days too late

MOT expiry date 5 March 2021

Full MOT history See MOT history

CarCheck.co.uk page 11/17



report date: 2024-03-28

Damage history

Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report <u>here</u> for the results.

Damage 1	
Date	
Category	
Туре	
Damage 2	
Date	
Category	
Туре	



Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 12/17



report date: 2024-03-28

Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 13/17



report date: 2024-03-28

Owner history

For how long did the current and previous owner(s) have this FORD? How many owners of Check it in the premium report and see all owner registrations. Download the full report by	
THE STATE OF THE S	

	More info >
Plate changes	
See in this check if this FORD had different number plates.	
Number of plates	,
Current registration	NK SIE
Plate since	
Current registration	AK SIE
Plate since	
	More info >

CarCheck.co.uk page 14/17



report date: 2024-03-28

Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this FORD is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

More info >

CarCheck.co.uk page 15/17



report date: 2024-03-28

Mileage check

Registration #16

Odometer	In miles
Mileage registrations	16
First mileage registration	2008-05-26
Last registration	2020-03-06
Complete history	See info



Registration #1	2008-05-26	24 mi
Registration #2	2011-05-09	39.468 mi
Registration #3	2012-04-30	58.024 mi
Registration #4	2013-04-22	68.137 mi
Registration #5	2013-04-26	68.161 mi
Registration #6	2014-04-10	74.498 mi
Registration #7	2015-04-25	80.941 mi
Registration #8	2016-04-20	85.220 mi
Registration #9		11.777 es
Registration #10		11.777 es
Registration #11		11.777 es
Registration #12		11.777 es
Registration #13		11.777 es
Registration #14		11.777 es
Registration #15		11.777 es

7070.70.70

More info >

77. 777 mg

CarCheck.co.uk page 16/17



report date: 2024-03-28

Car features

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

Dimensions & weight

Width	1974 mm
Height	2067 mm
Length	4863 mm
Wheel base	2933 mm
Kerb weight	1710 kg
Max. allowed weight	2600 kg

Additional information

Fuel tank capacity	80 I
Fuel delivery	Direct Injection
Number of seats	3
Number of axles	2
Engine number	8Y32525

CarCheck.co.uk page 17/17