



report date: 2024-03-28

General information

Make	CITROEN
Model	XSARA DESIRE 16V PICASSO E4
Colour	Bronze
Year of manufacture	-
Top speed	112 mph
Gearbox	5 speed Manual

Engine & fuel consumption

Power	107 BHP
Max. torque	147 Nm at 4.000 rpm
Cylinders	4
Fuel type	Petrol
Consumption city	29.7 mpg
Consumption extra urban	47.1 mpg
Consumption combined	38.7 mpg



LABEL UNKNOWN



Internet history

Entry 1

Date	2022-01-07
Pictures	2
Listing price	View report



source: [autotrader.co.uk](https://www.autotrader.co.uk)

**MOT history**

MOT #19	2023-01-18 09:27
MOT test number	584026148763
Result	✓ Passed
Next expiry date	2024-01-25

MOT #18	2022-01-26 16:07
MOT test number	635644366854
Result	✓ Passed

- Advice** Offside Rear Brake pipe corroded, covered in grease or other material unable to re assess failure brake pipe due to covering of grease [DANGEROUS] (1.1.11 (c))
- Advice** Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))
- Advice** Offside Suspension component mounting repair covered in underseal sill (5.3.6 (a) (i))
- Advice** Brake pipe corroded, covered in grease or other material unable to re assess front to rear failure brake pipe due to covering of grease [DANGEROUS] (1.1.11 (c))
- Advice** Nearside Suspension component mounting repair covered in underseal sill (5.3.6 (a) (i))

**MOT #17**

2022-01-25 13:50

MOT test number

943707842273

Result

✗ Failed

- Advice** Nearside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))
- MAJOR** Front Registration plate does not conform to the specified requirements deteriorated (0.1 (d))
- MAJOR** Offside Front Suspension component mounting prescribed area excessively corroded significantly reducing structural strength sill (5.3.6 (a) (i))
- Advice** Nearside front wheel arch cover insecure
- Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- MAJOR** Offside Front Lower Suspension arm pin or bush excessively worn front arm rear bush (5.3.4 (a) (i))
- MAJOR** Brake pipe excessively corroded front to rear (1.1.11 (c))
- Advice** Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))
- MAJOR** Nearside Suspension component mounting prescribed area excessively corroded significantly reducing structural strength sill (5.3.6 (a) (i))
- MAJOR** Nearside Front Lower Suspension arm pin or bush excessively worn front arm rear bush (5.3.4 (a) (i))
- Advice** Exhaust has a minor leak of exhaust gases front connection leaking (6.1.2 (a))
- MAJOR** Offside Rear Brake pipe excessively corroded (1.1.11 (c))

MOT #16

2021-05-07 08:14

MOT test number

147074243499

Result

✓ Passed

- Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt
- Advice** Central Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Central Rear Child Seat fitted not allowing full inspection of adult belt
- Minor** Offside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

**MOT #15**

2020-05-11 13:53

MOT test number

945503173731

Result

✓ Passed

Advice Central Front Registration plate deteriorated but not likely to be misread (0.1 (b))**Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt**Advice** Offside Rear Child Seat fitted not allowing full inspection of adult belt**MOT #14**

2019-04-30 16:21

MOT test number

713741358678

Result

✓ Passed

Minor Offside Front Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Offside Tyre worn close to legal limit/worn on edge (5.2.3 (e))**MOT #13**

2018-05-04 10:41

MOT test number

807867405975

Result

✓ Passed

Advice Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Advice** Offside Rear Direction indicator slightly discoloured (1.4.A.2f)**Advice** Nearside Rear tyre cracking between tread**Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)



MOT #12	2018-05-03 08:59
MOT test number	638203784722
Result	✗ Failed
Advice	Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Advice	Offside Rear Direction indicator slightly discoloured (1.4.A.2f)
Advice	Nearside Rear tyre cracking between tread
Fail	Offside Front constant velocity joint gaiter insecure to the extent that it no longer prevents the ingress of dirt etc (2.5.C.1a)
Advice	Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Fail	Nearside Rear Registration plate lamp not working (1.1.C.1d)
Advice	Offside Rear Nail in tyre

MOT #11	2017-05-17 11:46
MOT test number	750588459298
Result	✓ Passed
Advice	EML light on
Advice	Front Brake pad(s) wearing thin (3.5.1g)
Advice	Rear wiper torn

**MOT #10**

2017-05-15 08:19

MOT test number

493935781362

Result**✗ Failed****Pass with rectification**

Nearside Headlamp aim too high (1.8)

Fail

Offside Front Tie bar/rod ball joint dust cover excessively deteriorated so that it no longer prevents the ingress of dirt (2.4.G.2)

Advice

Rear wiper torn

Advice

Front Brake pad(s) wearing thin (3.5.1g)

Advice

Offside Front Tyre worn close to the legal limit worn on the inside edge (4.1.E.1)

Advice

EML light on

MOT #9

2017-04-07 15:38

MOT test number

783955740606

Result**✗ Failed****Advice**

Eml on

Advice

Exhaust back box clamp deteriorated

Advice

Child seats fitted

Advice

Offside Front tyre worn on edges

Advice

Rear wiper torn

Fail

Exhaust emissions Lambda reading after 2nd fast idle outside specified limits (7.3.D.3)

Advice

Oil leak at gear box

**MOT #8** 2016-04-28 15:16**MOT test number** 651919822946**Result** ✓ Passed**Advice** Front registration plate deteriorated but not likely to be misread (6.3.1d)**Advice** Oil leak from gear box**Advice** Rear Exhaust has a minor leak of exhaust gases slight leak at back box (7.1.2)**Advice** Rear wiper blade torn**Advice** Child seats fitted**MOT #7** 2015-04-23 11:27**MOT test number** 909303015156**Result** ✓ Passed**Advice** Front registration plate deteriorated but not likely to be misread (6.3.1d)**MOT #6** 2014-04-29 14:21**MOT test number** 926239714126**Result** ✓ Passed**Notice** Child seat fitted not allowing full inspection of adult belt

**MOT #5**

2013-04-24 14:10

MOT test number

635134913128

Result

✓ Passed

Notice Child seat fitted not allowing full inspection of adult belt**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**Notice** Nail in offside rear tyre**Notice** Items removed from driver's view prior to test**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**MOT #4**

2013-04-24 12:19

MOT test number

667704713186

Result

✗ Failed

Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)**Notice** Nail in offside rear tyre**Notice** Items removed from driver's view prior to test**Pass with rectification** Nearside Headlamp aim too low (1.8)**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Advice** Brake hydraulic reservoir fluid close to minimum level (3.6.G.1b)**Notice** Child seat fitted not allowing full inspection of adult belt**Fail** Nearside Rear Tyre has ply or cords exposed (4.1.D.1b)**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)



MOT #3	2012-04-26 14:44
MOT test number	576397212103
Result	✓ Passed
Advice	Nearside Rear Tyre worn close to the legal limit (4.1.E.1)
Advice	Offside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #2	2012-04-26 10:34
MOT test number	529447112122
Result	✗ Failed
Fail	Rear Exhaust system not adequately supported (7.1.1)
Advice	Offside Rear Tyre worn close to the legal limit (4.1.E.1)
Advice	Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #1	2011-04-25 14:28
MOT test number	437065611155
Result	✓ Passed



Damage history

Check the damage history for this CITROEN. See if, where and when this CITROEN had damage and the car repair costs. We also check if this CITROEN was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra CITROEN salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this CITROEN in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,299
Auction value	£ 19,299
Average private trade value	£ 19,299

More info >



Owner history

For how long did the current and previous owner(s) have this CITROEN? How many owners did this CITROEN have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this CITROEN had different number plates.

Number of plates	1
Current registration	SK08MBX
Plate since	2019-09-29
Current registration	SK08MBX
Plate since	2019-09-29

More info >



Finance check

Check if this CITROEN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this CITROEN has been settled.

If not, and you buy this CITROEN then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this CITROEN is financed.


Finance company	XXXXXXXX	XXXX
Date of agreement	XXXXXXXX	XXXX
Agreement type	XXXXXXXX	XXXX
Agreement term	XXXXXXXX	XXXX
Agreement number	XXXXXXXX	XXXX
Contact info	XXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	21
First mileage registration	2008-04-30
Last registration	2023-01-18
Complete history	See info

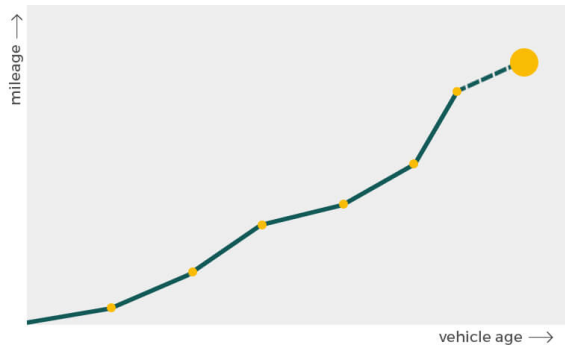

Registration #1	2008-04-30	16 mi
Registration #2	2011-04-25	17.866 mi
Registration #3	2012-04-26	21.586 mi
Registration #4	2012-04-26	21.588 mi
Registration #5	2013-04-24	26.309 mi
Registration #6	2013-04-24	26.309 mi
Registration #7	2014-04-29	31.936 mi
Registration #8	2015-04-23	37.717 mi
Registration #9	2016-04-28	44.012 mi
Registration #10	2017-04-07	49.060 mi
Registration #11	2017-05-15	49.334 mi
Registration #12	2018-05-20	55.277 mi
Registration #13	2019-05-20	55.277 mi
Registration #14	2020-05-20	55.277 mi
Registration #15	2021-05-20	55.277 mi
Registration #16	2022-05-20	55.277 mi
Registration #17	2023-05-20	55.277 mi
Registration #18	2024-05-20	55.277 mi
Registration #19	2025-05-20	55.277 mi
Registration #20	2026-05-20	55.277 mi
Registration #21	2027-05-20	55.277 mi

More info >



Safety ratings

NCAP rating

★ ★ ★ ★ ★

Video [see crash video](#)

Dimensions & weight

Width	1751 mm
Height	1637 mm
Length	4276 mm
Wheel base	2760 mm
Kerb weight	1240 kg
Max. allowed weight	1800 kg

Additional information

Fuel tank capacity	55 l
Fuel delivery	Multi-Point Injection
Number of doors	5
Number of seats	5
Number of axles	2
Engine number	FX7U3328960