



NKIOEWL

report date: 2024-03-28

General information

Make	FIAT
Model	DOBLO 8V DYNAMIC H/R
Colour	Blue
Year of manufacture	-
Top speed	90 mph
Gearbox	5 speed Manual

Engine & fuel consumption

Power	76 BHP
Max. torque	115 Nm at 3.000 rpm
Cylinders	4
Fuel type	Petrol
Consumption city	30.1 mpg
Consumption extra urban	43.5 mpg
Consumption combined	37.2 mpg



LABEL UNKNOWN



MOT history

MOT #11	2019-02-08 09:16
MOT test number	603670065047
Result	✓ Passed
Next expiry date	2020-02-07
Advice	Front Registration plate deteriorated but not likely to be misread (0.1 (b))

**MOT #10**

2019-02-04 10:32

MOT test number

864861764273

Result**✗ Failed**

- Advice** Offside Front Service brake binding but not excessively (1.2.1 (f))
- Fail** Offside Headlamp aim too low and too far to the right. (4.1.2 (a))
- Advice** Front Brakes imbalanced requirements only just met. It would appear that the braking system requires adjustment or repair. (1.2.1 (b) (i))
- Advice** Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))
- Advice** Offside Rear leaf spring fixing straps broken
- Fail** Offside Headlamp insecure (4.1.1 (c))
- Fail** Offside Front Position lamp not working (4.2.1 (a))
- Fail** Nearside Rear Seat belt buckle not functioning as intended (7.1.2 (d))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Fail** Offside Rear Direction indicator incorrect colour (4.4.3 (a))
- Fail** Rear Brakes imbalanced across an axle (1.2.1 (b) (i))
- Fail** Nearside Headlamp aim too high and too far to the left. (4.1.2 (a))
- Fail** Offside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))
- Advice** Nearside Front Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Minor** Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Fail** Rear Bumper insecure (6.1.4 (a) (i))
- Fail** Nearside Obligatory mirror insecure (3.3 (b) (ii))
- Fail** Nearside Rear Direction indicator incorrect colour (4.4.3 (a))



MOT #9	2018-01-02 13:18
MOT test number	115753362023
Result	✓ Passed
Advice	Passenger seat(s) missing at time of test

MOT #8	2017-01-09 12:18
MOT test number	921287058727
Result	✓ Passed
Advice	Exhaust has a minor leak of exhaust gases (7.1.2)

MOT #7	2015-12-08 16:35
MOT test number	323375411948
Result	✓ Passed
Advice	Nearside mirror damaged

MOT #6	2015-12-07 14:30
MOT test number	628441468021
Result	✗ Failed
Advice	Nearside mirror damaged
Pass with rectification	Nearside Headlamp aim too high (1.8)
Fail	Exhaust system not adequately supported (7.1.1)
Advice	Exhaust in poor condtion
Pass with rectification	Offside Headlamp aim too high (1.8)
Advice	Both rear tyres are badly perished/near minium limits

**MOT #5** 2015-12-02 15:52**MOT test number** 578330496012**Result** ✗ Failed**Fail** Nearside Rear Suspension has inadequate clearance with the bump stop (2.4.A.1a)**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Advice** Centre exhaust section support strap broken**Fail** Offside Front Suspension has inadequate clearance with the bump stop (2.4.A.1a)**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Advice** Both rear tyres in a very poor condition (due to AGE)**MOT #4** 2014-09-16 17:26**MOT test number** 365239054283**Result** ✓ Passed**Notice** Windscreen cracked**Notice** Fuel filler breather hose perished**Notice** Rear tyres perishing

**MOT #3** 2014-09-16 12:49**MOT test number** 329529654421**Result** ✗ Failed**Notice** Windscreen cracked**Notice** Fuel filler breather hose perished**Fail** Offside Front Obligatory mirror missing (8.1.1)**Notice** Rear tyres perishing**Fail** Nearside Rear Seat belt locking mechanism does not secure or release (5.2.5a)**MOT #2** 2013-07-08 16:34**MOT test number** 786399183107**Result** ✓ Passed**Notice** Brake discs in poor condision**MOT #1** 2013-07-08 11:02**MOT test number** 469419483178**Result** ✗ Failed**Notice** Brake discs in poor condision**Fail** Nearside Rear Seat belt locking mechanism does not secure or release (5.2.5a)



Damage history

Check the damage history for this FIAT. See if, where and when this FIAT had damage and the car repair costs. We also check if this FIAT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra FIAT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FIAT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 10,000
Auction value	£ 10,000
Average private trade value	£ 10,000

More info >



Owner history

For how long did the current and previous owner(s) have this FIAT? How many owners did this FIAT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this FIAT had different number plates.

Number of plates	1
Current registration	
Plate since	2024-03-28
Current registration	
Plate since	2024-03-28

More info >



Finance check

Check if this FIAT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FIAT has been settled.

If not, and you buy this FIAT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FIAT is financed.


Finance company	XXXXXXXX XX
Date of agreement	XXXXXXXX XX
Agreement type	XXXXXXXX XX
Agreement term	XXXXXXXX XX
Agreement number	XXXXXXXX XX
Contact info	XXXXXXXX XX

More info >



Mileage check

Odometer	In miles
Mileage registrations	12
First mileage registration	2010-07-05
Last registration	2019-02-08
Complete history	See info

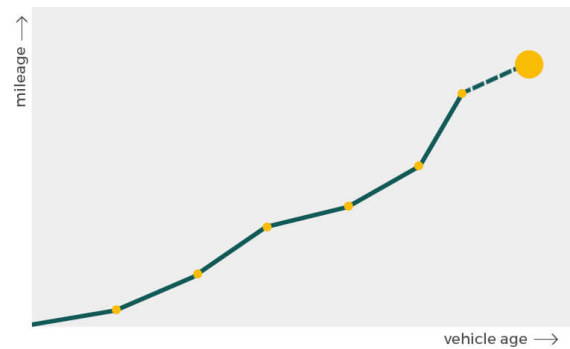

Registration #1	2010-07-05	19 mi
Registration #2	2013-07-08	29.475 mi
Registration #3	2013-07-08	29.475 mi
Registration #4	2014-09-16	45.601 mi
Registration #5	2014-09-16	45.603 mi
Registration #6	2015-12-02	55.683 mi
Registration #7	2019-02-08	55.683 mi
Registration #8	2019-02-08	55.683 mi
Registration #9	2019-02-08	55.683 mi
Registration #10	2019-02-08	55.683 mi
Registration #11	2019-02-08	55.683 mi
Registration #12	2019-02-08	55.683 mi

More info >



Car features

The FIAT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FIAT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★☆

Video [see crash video](#)



Dimensions & weight

Width	1722 mm
Height	2073 mm
Length	4253 mm
Wheel base	2583 mm
Kerb weight	1230 kg
Max. allowed weight	1830 kg

Additional information

Fuel tank capacity	60 l
Fuel delivery	Multi-Point Injection
Number of doors	5
Number of seats	5

Number of axles	2
Engine number	5485287