



report date: 2024-03-28

General information

Make	AUDI
Model	A3 SPORTBACK MPI TECHNIK
Colour	White
Year of manufacture	2010
Top speed	115 mph
Gearbox	5 speed Manual

Engine & fuel consumption

Power	101 BHP
Max. torque	148 Nm at 3.800 rpm
Engine capacity	1.595 cc
Cylinders	4
Fuel type	Petrol
Consumption city	29.7 mpg
Consumption extra urban	52.3 mpg
Consumption combined	40.9 mpg
CO2 emission	164 g/km
CO2 label	G







Internet history

Entry 1

Date	2021-01-27
Pictures	10
Listing price	View report

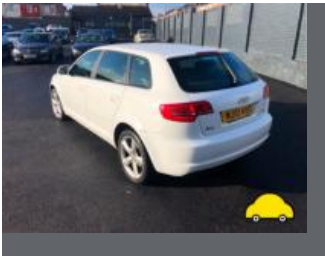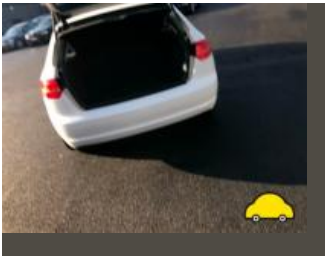

source: [autoonline.co.uk](https://www.autoonline.co.uk)



MOT history

MOT expiry date	2025-02-06
MOT pass rate	58 %
MOT passed	11
Failed MOT tests	8
Total advice items	72
Total items failed	23

MOT #19 2024-02-07 14:04

MOT test number 186967078477

Result ✓ Passed

Next expiry date 2025-02-06

Advice Front Lower Suspension arm pin or bush worn but not resulting in excessive movement both sides rear bushes (5.3.4 (a) (i))

Minor Nearside Obligatory mirror slightly damaged door mirror (3.3 (b) (i))

Advice Front Brake disc worn, pitted or scored, but not seriously weakened both sides (1.1.14 (a) (ii))

MOT #18 2024-02-01 11:53

MOT test number 616678073806

Result ✗ Failed

Fail Front Brake pad(s) less than 1.5 mm thick both sides (1.1.13 (a) (ii))

Advice Front Brake disc worn, pitted or scored, but not seriously weakened both sides (1.1.14 (a) (ii))

Advice Front Lower Suspension arm pin or bush worn but not resulting in excessive movement both sides rear bushes (5.3.4 (a) (i))

Minor Nearside Obligatory mirror slightly damaged door mirror (3.3 (b) (i))

Fail Nearside Front Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))

**MOT #17**

2023-02-04 11:57

MOT test number

620598640750

Result

✓ Passed

Advice

Nearside Front Anti-roll bar ball joint has slight play (5.3.4 (a) (i))

Advice

Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush (5.3.4 (a) (i))

Advice

Front Oil leak, but not excessive (8.4.1 (a) (i))

MOT #16

2022-02-01 13:53

MOT test number

898574781478

Result

✓ Passed

Advice

Nearside Rear Nail in tyre

Advice

Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

Advice

Front Oil leak, but not excessive (8.4.1 (a) (i))

Advice

Offside Rear Nail in tyre

Advice

Offside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

**MOT #15**

2022-01-31 11:57

MOT test number

287189475126

Result**✗ Failed**

- Fail** Reversing lamp inoperative (4.6.1 (a))
- Fail** Offside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Advice** Nearside Rear Nail in tyre
- Fail** Nearside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Advice** Offside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))
- Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))
- Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Advice** Front Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))
- Advice** Offside Rear Nail in tyre
- Fail** Front Registration plate does not conform to the specified requirements (0.1 (d))

MOT #14

2020-11-23 14:50

MOT test number

658370176940

Result**✓ Passed**

- Advice** Front tyres worn inner edges inner pads appear low

MOT #13

2020-11-23 14:50

MOT test number

520709650204

Result**✗ Failed**

- Pass with rectification** Offside Headlamp aim too low and too far to the right. (4.1.2 (a))
- Advice** Front tyres worn inner edges inner pads appear low

**MOT #12**

2020-10-16 09:02

MOT test number

334902771088

Result**✗ Failed****Advice** Rear Registration plate deteriorated but not likely to be misread water damage (0.1 (b))**Advice** Nearside Rear Nail in tyre**Fail** Exhaust Lambda reading after 2nd fast idle outside specified limits (8.2.1.2 (c))**Advice** Offside Front Tyre slightly damaged run out inner edges (5.2.3 (d) (ii))**Fail** Offside Front Headlamp aim too high (4.1.2 (a))**Fail** Nearside Front Anti-roll bar ball joint dust cover no longer prevents the ingress of dirt lower drop link boot split (5.3.4 (b) (ii))**Advice** Exhaust emits blue smoke during acceleration (8.2.1.2 (g))**Advice** Nearside Front Tyre slightly damaged run out inner edges (5.2.3 (d) (ii))**Advice** Nearside Rear Tyre slightly damaged run out inner edges also side wall perished / cracks in tyre treads (5.2.3 (d) (ii))**Fail** Nearside Front Headlamp aim too high (4.1.2 (a))



MOT #11

2019-05-04 14:05

MOT test number

255573477980

Result		✓ Passed
Advice	Nearside Front Non obligatory mirror damaged cracked glass	
Advice	Oil leak, but not excessive driveshaft seals damp (8.4.1 (a) (i))	
Advice	Central Front Vac pump insecure	
Advice	Front Suspension arm pin or bush worn but not resulting in excessive movement both rear bushes worn (5.3.4 (a) (i))	
Advice	Front signs of coolant loss around the radiator area	
Advice	Nearside Rear Nail in tyre	
Advice	Offside Rear door has a sharp edge but not excessive	
Advice	Rear Registration plate deteriorated but not likely to be misread (0.1 (b))	
Advice	Exhaust emits blue smoke during acceleration (8.2.1.2 (g))	
Advice	Coolant level well above max	

**MOT #10**

2019-04-27 08:47

MOT test number

304286585913

Result**✗ Failed**

- Advice** Central Front Vac pump insecure
- Advice** Oil leak, but not excessive driveshaft seals damp (8.4.1 (a) (i))
- Advice** Front signs of coolant loss around the radiator area
- Advice** Front Suspension arm pin or bush worn but not resulting in excessive movement both rear bushes worn (5.3.4 (a) (i))
- Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Fail** Headlamp aim too low both sides to low (4.1.2 (a))
- Advice** Offside Rear door has a sharp edge but not excessive
- Advice** Nearside Rear Nail in tyre
- Fail** Nearside Front Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (5.2.3 (d) (i))
- Advice** Coolant level well above max
- Advice** Exhaust emits blue smoke during acceleration (8.2.1.2 (g))
- Fail** Offside Front Tyre has a bulge, caused by separation or partial failure of its structure (5.2.3 (d) (ii))
- Fail** Offside Front Seat belt retracting mechanism defective (7.1.2 (e))
- Advice** Nearside Front Non obligatory mirror damaged cracked glass
- Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))

MOT #9

2018-05-05 12:14

MOT test number

960611339327

Result**✓ Passed**

- Advice** Rear registration plate deteriorated but not likely to be misread (6.3.1d)
- Advice** Under-Trays fitted obscuring some underside components.

**MOT #8** 2017-05-05 16:20**MOT test number** 427904347167**Result** ✓ Passed**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Nearside Rear Nail in tyre**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**MOT #7** 2017-04-29 10:34**MOT test number** 753193866176**Result** ✗ Failed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Fail** Windscreen has damage to the swept area in excess of a 40mm circle outside zone 'A' (8.3.1d)**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Nearside Rear Nail in tyre**MOT #6** 2016-04-30 10:22**MOT test number** 151852509622**Result** ✓ Passed**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)

**MOT #5**

2016-04-29 12:54

MOT test number

896048963227

Result

✗ Failed

- Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)
- Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)
- Fail** Offside Front Tie bar/rod has excessive play in a pin/bush (2.4.G.2)
- Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)
- Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)
- Fail** Offside Stop lamp not working (1.2.1b)
- Fail** Nearside Front Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (4.1.D.1a)

MOT #4

2015-04-25 13:00

MOT test number

755255415135

Result

✓ Passed

- Advice** Offside Stop lamp has light sources not illuminating, but not more than 50% (1.2.1b)
- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Notice** Under-trays fitted obscuring some underside components
- Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Notice** Non obligatory mirror damaged

MOT #3

2014-04-28 16:24

MOT test number

768858614100

Result

✓ Passed



MOT #2	2014-04-19 11:39
MOT test number	949719004106
Result	✗ Failed
Advice	Offside Front Tyre worn close to the legal limit (4.1.E.1)
Fail	Offside Rear Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (4.1.D.1a)

MOT #1	2013-04-30 11:41
MOT test number	827150723119
Result	✓ Passed
Notice	Engine covers fitted obscuring some components in the engine bay
Advice	Nearside Front Obligatory mirror damaged, but not seriously affecting the rear view (8.1.2a)
Notice	Under-trays fitted obscuring some underside components
Advice	Tyre worn close to the legal limit (4.1.E.1)



Tax & MOT check

X

Untaxed

Tax expired:
1 February 2024

✓

MOT

Expires:
6 February 2025

Tax status	Expired at 1 February 2024
Days left	88 days too late
MOT expiry date	6 February 2025
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	G
Single payment (12 months)	£ 240,00,-
Single six month payment	£ 132,00,-
Total payable by 12 monthly instalments	£ 252,00,-




Damage history

Check the damage history for this AUDI. See if, where and when this AUDI had damage and the car repair costs. We also check if this AUDI was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

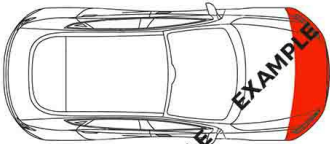

Damage 2

Date	
Category	
Type	



Extra AUDI salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this AUDI in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this AUDI? How many owners did this AUDI have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this AUDI had different number plates.

Number of plates	1
Current registration	XXXXXX
Plate since	2024-03-28
Current registration	XXXXXX
Plate since	2024-03-28

More info >



Finance check

Check if this AUDI is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this AUDI has been settled.

If not, and you buy this AUDI then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this AUDI is financed.

Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	21
First mileage registration	2010-04-30
Last registration	2024-02-07
Complete history	See info



Registration #1	2010-04-30	26 mi
Registration #2	2013-04-30	23.908 mi
Registration #3	2014-04-19	29.672 mi
Registration #4	2014-04-28	29.836 mi
Registration #5	2015-04-25	37.876 mi
Registration #6	2016-04-29	48.085 mi
Registration #7	2016-04-30	48.093 mi
Registration #8	2017-04-29	60.055 mi
Registration #9	2017-05-05	60.423 mi
Registration #10	2018-05-05	71.116 mi
Registration #11	2019-04-27	82.407 mi
Registration #12	2020-04-27	93.698 mi
Registration #13	2021-04-27	104.989 mi
Registration #14	2022-04-27	116.280 mi
Registration #15	2023-04-27	127.571 mi
Registration #16	2024-02-07	138.862 mi
Registration #17	2024-02-07	138.862 mi
Registration #18	2024-02-07	138.862 mi
Registration #19	2024-02-07	138.862 mi
Registration #20	2024-02-07	138.862 mi
Registration #21	2024-02-07	138.862 mi

More info >



Car features

The AUDI factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete AUDI factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★☆

Video [see crash video](#)



Dimensions & weight

Width	1765 mm
Height	1423 mm
Length	4292 mm
Wheel base	2578 mm
Kerb weight	1225 kg
Max. allowed weight	1785 kg

Additional information

Fuel tank capacity	55 l
Fuel delivery	Multi-Point Injection
Number of doors	5
Number of seats	5

Number of axles	2
Engine number	BSE 940424