





report date: 2024-03-29

### General information

Make	PEUGEOT
Model	307 HDI SW ZENITH
Colour	Orange
Year of manufacture	2006
Top speed	126 mph
0 - 60 mph	10.1 seconds
Gearbox	6 speed Manual

## Engine & fuel consumption

Power	136 BHP
Max. torque	320 Nm at 2.000 rpm
Engine capacity	1.997 сс
Cylinders	4
Fuel type	Diesel
Consumption city	35.7 mpg
Consumption extra urban	56.5 mpg
Consumption combined	47.1 mpg
CO2 emission	159 g/km
CO2 label	G



CarCheck.co.uk page 1/16



## Internet history

_	_	_		_	-
드	n	C	ľν	7	1

ciitiy 1	
Date	2021-10-14
Pictures	0
Listing price	View report

source: autotrader.co.uk

CarCheck.co.uk page 2/16



MOT history

MOT expiry date	2024-11-30
MOT pass rate	67 %
MOT passed	14
Failed MOT tests	7
Total advice items	37
Total items failed	24

MOT #21	2023-12-01 10:25
MOT test number	331514618466
Result	✓ Passed
Next expiry date	2024-11-30
Advice Front Suspension arm pin or bush worn but not resulting in excessive movement (i))	ent both (5.3.4 (a)
Minor Offside Registration plate lamp inoperative in the case of multiple lamps or light (i))	nt sources (4.7.1 (b)
Advice Underside of vehicle undersealed	
Advice Offside Front Lower Suspension component ball joint has slight play (5.3.4 (a)	(i))
Advice Tyre worn close to legal limit/worn on edge ALL (5.2.3 (e))	
Advice Offside Rear Shock absorbers has light misting of oil (5.3.2 (b))	
Advice Play in steering rack inner joint(s)	
Advice Brake pedal little reserve travel	
Minor Nearside Side repeater lens defective which has no effect on emitted light (4.4	.1 (b) (i))

CarCheck.co.uk page 3/16



**MOT #20** 2023-12-01 10:25

**MOT test number** 412169442663

Result X Failed

**Advice** Tyre worn close to legal limit/worn on edge ALL (5.2.3 (e))

**Advice** Play in steering rack inner joint(s)

Minor Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

**Advice** Underside of vehicle undersealed

**Pass with rectification** Front Position lamp not working both (4.2.1 (a) (ii))

Advice Front Suspension arm pin or bush worn but not resulting in excessive movement both (5.3.4 (a) (i))

**Advice** Brake pedal little reserve travel

**Pass with rectification** Nearside Registration plate lamp does not illuminate simultaneously with the position lamps (4.7.2 (a))

Minor Nearside Side repeater lens defective which has no effect on emitted light (4.4.1 (b) (i))

Advice Offside Front Lower Suspension component ball joint has slight play (5.3.4 (a) (i))

**Advice** Offside Rear Shock absorbers has light misting of oil (5.3.2 (b))

**MOT #19** 2022-08-03 08:42

**MOT test number** 241484660926

**Result** ✓ Passed

**MOT #18** 2021-08-04 10:17

**MOT test number** 251749494786

**Result** ✓ Passed

**Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

CarCheck.co.uk page 4/16



**MOT #17** 2021-08-03 09:48

MOT test number 915176768389

Result X Failed

**Fail** Nearside Rear Service brake excessively binding (1.2.1 (f))

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Fail Parking brake efficiency less than 50% of the required value (1.4.2 (a) (ii))

Fail Offside Front Suspension arm pin or bush excessively worn front bush (5.3.4 (a) (i))

**Fail** Offside Rear Shock absorbers has a serious fluid leak (5.3.2 (b))

**Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

**Fail** Offside Parking brake inoperative on one side (1.4.1 (a))

Fail Offside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))

MOT #16 2020-08-13 08:38

MOT test number 846480093026

CarCheck.co.uk page 5/16



KR06OTJ

report date: 2024-03-29

**MOT #15** 2020-08-10 11:28 **MOT** test number 747307210874 Result × Failed Fail Offside Front Upper Macpherson strut mounting likely to fail (5.3.3 (b) (ii)) Fail Headlamp aim too low (4.1.2 (a)) Nearside Front Brake disc in such a condition that it is seriously weakened (1.1.14 (a) (ii)) Fail Service brake efficiency below requirements (1.2.2 (a) (i)) Fail Nearside Rear Brake disc in such a condition that it is seriously weakened (1.1.14 (a) (ii)) Fail Fail Nearside Front Upper Macpherson strut mounting likely to fail (5.3.3 (b) (ii)) Parking brake efficiency less than 50% of the required value (1.4.2 (a) (ii)) Fail Fail Offside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c)) Fail Offside Front Brake disc in such a condition that it is seriously weakened (1.1.14 (a) (ii)) Fail Offside Rear Brake disc fractured (1.1.14 (a) (ii))

MOT #14	2018-05-17 12:41
MOT test number	858613802669
Result	✓ Passed

MOT #13	2017-05-05 10:55
MOT test number	398212204094

**MOT #12** 2017-05-04 09:47

**MOT test number** 762311896052

**Result** ★ Failed

**Fail** Parking brake: efficiency below requirements (3.7.B.7)

Advice Rear brake disc worn, pitted or scored, but not seriously weakened both sides (3.5.1i)

CarCheck.co.uk page 6/16



**MOT #11** 2016-05-14 13:20

**MOT test number** 621652098191

**Result** ✓ Passed

**MOT #10** 2016-05-14 08:40

**MOT test number** 885021597924

**Result** X Failed

**Fail** Offside Front Front suspension ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt (2.4.G.2)

Fail Front brake disc in such a condition that it is seriously weakened both side (3.5.1i)

MOT #9 2015-05-15 15:32

**MOT test number** 208135635481

Result Passed

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

**Notice** Engine covers fitted obscuring some components in the engine bay

MOT #8 2015-05-15 09:49

**MOT test number** 258135335126

Result X Failed

**Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

**Notice** Engine covers fitted obscuring some components in the engine bay

Fail Offside Front Track rod end ball joint has excessive play (2.2.B.1f)

**MOT #7** 2014-05-09 16:39

**MOT test number** 399009624189

**Result** ✓ Passed

CarCheck.co.uk page 7/16



MOT #6 2013-04-23 15:48

**MOT test number** 379643813107

**MOT #5** 2012-05-12 09:54

**MOT test number** 336393632110

Result 

✓ Passed

**MOT #4** 2011-05-18 14:06

**MOT test number** 947768831197

**Result** ✓ Passed

**Notice** Child seat fitted not allowing full inspection of adult belt

**Advice** Rear Brake pad(s) wearing thin (3.5.1g)

**Advice** Offside Front Drag link end ball joint has slight play (2.2.B.1f)

MOT #3 2011-05-18 13:33

MOT test number 785548931145

**Result** X Failed

Fail Front Headlamp aim too low (1.8)

**Advice** Rear Brake pad(s) wearing thin (3.5.1g)

Notice Child seat fitted not allowing full inspection of adult belt

Fail Nearside Front position lamp(s) not working (1.1.A.3b)

**Advice** Offside Front Drag link end ball joint has slight play (2.2.B.1f)

**MOT #2** 2010-05-17 09:38

**MOT test number** 413227130120

**Result** ✓ Passed

CarCheck.co.uk page 8/16



MOT #1 2009-05-15 12:21

**MOT test number** 590045439157

Result 

\_\_\_\_\_ Passed

**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)

**Advice** Front Brake pad(s) wearing thin (3.5.1g)

CarCheck.co.uk page 9/16



## Tax & MOT check



Tax status	Valid until 1 March
Days left	307
MOT expiry date	30 November 2024
Full MOT history	See MOT history

### Tax calculation

Vehicle class	49
Band	G
Single payment (12 months)	£ 240,00,-
Single six month payment	£ 132,00,-
Total payable by 12 monthly instalments	£ 252,00,-

CarCheck.co.uk page 10/16



#### Damage history

Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report <a href="https://example.com/here">here</a> for the results.

Damage 1	
Date	
Category	
Туре	
Damage 2	
Date	
Category	
Туре	



#### Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 11/16



#### Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

**Trade retail value** 

**Auction value** 

Average private trade value

More info >

CarCheck.co.uk page 12/16



Owner history

e when mistery	
For how long did the current and previous owner(s) have this PEUGEOT? How many owner have? Check it in the premium report and see all owner registrations. Download the full report and see all owner registrations.	
********	
***************************************	
	More info >
Plate changes	
See in this check if this PEUGEOT had different number plates.	
Number of plates	,
Current registration	UK NE
Plate since	
Current registration	RIA SILE
Plate since	
	More info >

CarCheck.co.uk page 13/16



#### Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this PEUGEOT is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	

**Contact info** 


More info >

CarCheck.co.uk page 14/16



# Mileage check

Odometer	In miles
Mileage registrations	23
First mileage registration	2006-05-18
Last registration	2023-12-01
Complete history	See info

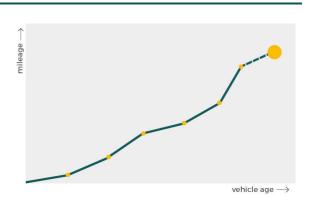

Registration #1	2006-05-18	25 mi
Registration #2	2009-05-15	30.463 mi
Registration #3	2010-05-17	37.538 mi
Registration #4	2011-05-18	44.731 mi
Registration #5	2011-05-18	44.731 mi
Registration #6	2012-05-12	52.525 mi
Registration #7	2013-04-23	61.759 mi
Registration #8	2014-05-09	70.915 mi
Registration #9	2015-05-15	77.428 mi
Registration #10	2015-05-15	77.438 mi
Registration #11	2016-05-14	80.221 mi
<b>9</b>		
Registration #12	2016-05-14	80.221 mi
		80.221 mi
Registration #12	2016-05-14	80.221 mi
Registration #12 Registration #13	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14 Registration #15	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19	2016-05-14	80.221 mi
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20	2016-05-14	80.221 mi

More info >

CarCheck.co.uk page 15/16



## Car features

S0225	Air conditioning
S0295	
50482	
50501	
50566	
50567	
50569	

# Safety ratings

NCAP rating	****
Video	see crash video



# Dimensions & weight

Width	1811 mm
Height	1471 mm
Length	4763 mm
Wheel base	2725 mm
Kerb weight	1568 kg
Max. allowed weight	2183 kg

# Additional information

Fuel tank capacity	66 I	
Fuel delivery	Direct Injection	
Number of doors	5	
Number of seats CarCheck.co.uk	5 page	16/16

**Engine number** 

DYTJ4104012