



RENAULT

PN07JJJ

report date: 2024-03-28

General information

Make	RENAULT
Model	MASTER LM35 LWB L/C P/V 100
Colour	Yellow
Year of manufacture	2007
Top speed	86 mph
Gearbox	6 speed Manual

Engine & fuel consumption

Power	100 BHP
Max. torque	260 Nm at 1.600 rpm
Engine capacity	2.464 cc
Cylinders	4
Fuel type	Diesel
Consumption city	26.4 mpg
Consumption extra urban	36.2 mpg
Consumption combined	32.1 mpg



LABEL UNKNOWN

**MOT history**

MOT expiry date	2020-12-02
MOT pass rate	67 %
MOT passed	12
Failed MOT tests	6
Total advice items	11
Total items failed	13

MOT #18 2020-12-04 17:02**MOT test number** 465723723933**Result** ✗ Failed

- Fail** Offside Front Outer Steering rack gaiter missing or no longer prevents the ingress of dirt (2.1.3 (g) (ii))
- Fail** Nearside Rear Lower Anti-roll bar linkage pin or bush excessively worn (5.3.4 (a) (i))
- Fail** Offside Front Steering rack has excessive free play detected at the steering wheel (steering rack fitted) (2.3 (a) (i))
- Fail** Nearside Front Outer Steering rack gaiter missing or no longer prevents the ingress of dirt (2.1.3 (g) (ii))
- Advice** Offside Front Lower Oil leak, but not excessive (8.4.1 (a) (i))
- Fail** Nearside Front Front passenger door cannot be opened from inside the vehicle (6.2.3 (a))
- Minor** Nearside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

MOT #17 2019-12-03 14:47**MOT test number** 780609427232**Result** ✓ Passed

**MOT #16** 2019-11-29 11:25**MOT test number** 455265478682**Result** ✗ Failed**Advice** Nearside Front Play in inner tie rod**Fail** Parking brake efficiency below requirements (1.4.2 (a) (i))**Advice** Offside Front Play in inner tie rod**Fail** Nearside Rear Brake pivot has restricted free movement (1.1.15 (e))**MOT #15** 2018-12-03 12:48**MOT test number** 465233073209**Result** ✓ Passed**MOT #14** 2017-07-26 15:10**MOT test number** 431322505001**Result** ✓ Passed**MOT #13** 2016-03-07 15:57**MOT test number** 152516693318**Result** ✓ Passed**MOT #12** 2016-03-07 12:54**MOT test number** 524163834750**Result** ✗ Failed**Fail** Nearside Front Lower Shock absorber has an excessively worn bush (2.7.4)**Fail** Offside Front Steering rack gaiter split (2.2.D.2d)**MOT #11** 2015-03-03 08:41**MOT test number** 166652065469**Result** ✓ Passed

**MOT #10** 2015-03-02 17:28**MOT test number** 885771265090**Result** ✗ Failed**Fail** Registration plate lamp not working (1.1.C.1d)**Fail** Supplementary Restraint System warning lamp indicates a fault (5.4.2)**MOT #9** 2014-03-27 10:19**MOT test number** 468706284098**Result** ✓ Passed**Advice** Offside Front Lower Suspension arm has slight play in a ball joint (2.4.G.2)**Notice** O/s/f tyre 2mm centre tread**Notice** O/s/r tyre perishing slightly**Advice** Nearside Front Lower Suspension arm has slight play in a ball joint (2.4.G.2)**Notice** Rear anti-roll bar saddle bushes worn**Notice** N/s/ number plate light lens missing**MOT #8** 2013-03-26 14:33**MOT test number** 879045683002**Result** ✓ Passed**MOT #7** 2013-03-22 11:14**MOT test number** 296571783039**Result** ✗ Failed**Fail** Centre Rear Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)**MOT #6** 2012-03-07 10:47**MOT test number** 725757562064**Result** ✓ Passed

**MOT #5** 2011-03-08 13:31**MOT test number** 175017661431**Result** ✓ Passed**MOT #4** 2011-03-07 09:05**MOT test number** 287536161069**Result** ✗ Failed**Fail** Nearside Rear Leaf spring cracked (2.4.B.1a)**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**MOT #3** 2010-03-25 17:04**MOT test number** 271744280041**Result** ✓ Passed**MOT #2** 2009-03-17 13:06**MOT test number** 893476179082**Result** ✓ Passed**MOT #1** 2008-03-20 08:47**MOT test number** 703870988059**Result** ✓ Passed



Damage history

Check the damage history for this RENAULT. See if, where and when this RENAULT had damage and the car repair costs. We also check if this RENAULT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	



Damage 2

Date	
Category	
Type	

Extra RENAULT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this RENAULT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this RENAULT? How many owners did this RENAULT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this RENAULT had different number plates.

Number of plates	1
Current registration	
Plate since	2024-03-28
Current registration	
Plate since	2024-03-28

More info >



Finance check

Check if this RENAULT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this RENAULT has been settled.

If not, and you buy this RENAULT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this RENAULT is financed.


Finance company	RENAULT FINANCE
Date of agreement	01/01/2024
Agreement type	FINANCE
Agreement term	36 months
Agreement number	123456789
Contact info	0123 456789

More info >



Mileage check

Odometer	In miles
Mileage registrations	19
First mileage registration	2007-03-26
Last registration	2020-12-04
Complete history	See info

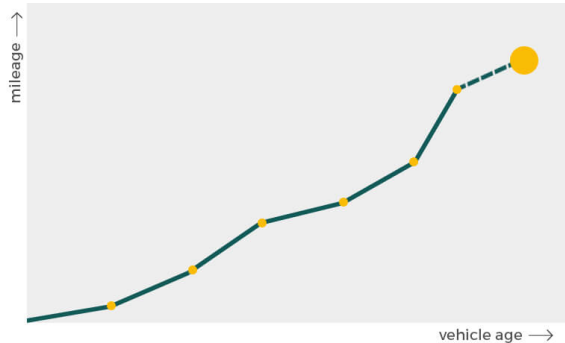

Registration #1	2007-03-26	10 mi
Registration #2	2008-03-20	36.882 mi
Registration #3	2009-03-17	66.149 mi
Registration #4	2010-03-25	101.732 mi
Registration #5	2011-03-07	138.928 mi
Registration #6	2011-03-08	138.928 mi
Registration #7	2012-03-07	181.629 mi
Registration #8	2013-03-22	212.907 mi
Registration #9	2013-03-26	212.950 mi
Registration #10	2014-03-27	226.723 mi
Registration #11	2015-03-28	251.557 mi
Registration #12	2016-03-29	281.391 mi
Registration #13	2017-03-30	311.225 mi
Registration #14	2018-03-31	341.059 mi
Registration #15	2019-03-31	370.893 mi
Registration #16	2020-03-31	400.727 mi
Registration #17	2021-03-31	430.561 mi
Registration #18	2022-03-31	460.395 mi
Registration #19	2023-03-31	490.229 mi

More info >



Car features

The RENAULT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete RENAULT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★★

Video [see crash video](#)



Dimensions & weight

Width	1990 mm
Height	2489 mm
Length	5388 mm
Kerb weight	1937 kg
Max. allowed weight	3500 kg

Additional information

Fuel tank capacity	100 l
Fuel delivery	Direct Injection
Number of doors	4
Number of seats	3
Number of axles	2

Engine number

C078969