



S674VWE

report date: 2024-03-29

General information

Make	NISSAN
Model	ELGRAND
Colour	White
Year of manufacture	1999
Gearbox	-

Engine & fuel consumption

Engine capacity	3.200 cc
Fuel type	Diesel



LABEL UNKNOWN



Internet history

Entry 1

Date	2021-09-23
Pictures	40
Listing price	View report



source: [autotrader.co.uk](https://www.autotrader.co.uk)



MOT history

MOT expiry date	2024-02-24
MOT pass rate	63 %
MOT passed	12
Failed MOT tests	7
Total advice items	68
Total items failed	10

MOT #19	2023-02-25 14:37
MOT test number	633280827102
Result	✓ Passed
Next expiry date	2024-02-24

MOT #18	2023-02-15 15:22
MOT test number	310440189066
Result	✗ Failed

- DANGEROUS** Rear Suspension arm pin or bush likely to become detached (5.3.4 (a) (ii))
- MAJOR** Front Brake pipe excessively damaged front to back pipe (1.1.11 (c))
- MAJOR** Nearside Front Position lamp not working (4.2.1 (a) (ii))

**MOT #17**

2022-09-28 11:48

MOT test number

906366858081

Result**✗ Failed**

MAJOR Nearside Rear Suspension arm attachment bracket/mounting corroded and seriously weakened inner sill (5.3.3 (b) (i))

MAJOR Nearside Front Position lamp not working (4.2.1 (a) (ii))

Advice Brake pipe corroded, covered in grease or other material both rear axle pipes (1.1.11 (c))

MAJOR Nearside Rear Position lamp not working (4.2.1 (a) (ii))

MAJOR Registration plate lamp does not illuminate simultaneously with the position lamps both (4.7.2 (a))

Advice Slight play in o/s steering rack

MAJOR Nearside Rear Suspension component pin or bush excessively worn axle bush (5.3.4 (a) (i))

MAJOR Offside Rear Suspension arm attachment bracket/mounting corroded and seriously weakened inner sill (5.3.3 (b) (i))

MAJOR Offside Front Position lamp not working (4.2.1 (a) (ii))

Advice Tyre slightly damaged/cracking or perishing both rear and o/s front (5.2.3 (d) (ii))

MAJOR Offside Rear Position lamp not working (4.2.1 (a) (ii))

MAJOR Offside Rear fog lamp not working (4.5.1 (a) (ii))

MOT #16

2021-09-17 13:53

MOT test number

766823545826

Result**✓ Passed**

Advice Nearside Rear Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))

Advice Offside Rear Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))

**MOT #15**

2020-11-18 11:05

MOT test number

752169278049

Result

✓ Passed

- Advice** Nearside Rear Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))
- Advice** Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))
- Advice** Nearside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Offside Rear Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))
- Advice** Offside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))

MOT #14

2019-07-04 15:17

MOT test number

439966945489

Result

✓ Passed

- Advice** Brake pipe corroded, covered in grease or other material both rear (1.1.11 (c))
- Advice** Exhaust corroded
- Advice** Anti-roll bar linkage ball joint has slight play both rear (5.3.4 (a) (i))
- Advice** Service brake fluctuating, but not excessively both rear (1.2.1 (e))
- Advice** Nearside front tyre 0mm on inner edge
- Advice** Nearside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))

**MOT #13** 2019-07-04 15:17**MOT test number** 931245353379**Result** ✗ Failed**Advice** Exhaust corroded**Pass with rectification** Windscreen wiper does not clear the windscreen effectively both front (3.4 (b) (ii))**Advice** Anti-roll bar linkage ball joint has slight play both rear (5.3.4 (a) (i))**Advice** Service brake fluctuating, but not excessively both rear (1.2.1 (e))**Advice** Nearside front tyre 0mm on inner edge**Advice** Nearside Front Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))**Advice** Brake pipe corroded, covered in grease or other material both rear (1.1.11 (c))**MOT #12** 2018-06-05 14:54**MOT test number** 348099212398**Result** ✓ Passed**Advice** Brake pipe corroded, covered in grease or other material various rear (1.1.11 (c))**MOT #11** 2018-06-01 13:37**MOT test number** 207859482973**Result** ✗ Failed**Advice** Brake pipe corroded, covered in grease or other material various rear (1.1.11 (c))**MAJOR** Nearside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))**Advice** Offside inner sill holed**MAJOR** Nearside Seat belt anchorage prescribed area strength or continuity significantly reduced inner sill (7.1.1 (a) (i))

**MOT #10** 2017-04-11 13:25**MOT test number** 489619686263**Result** ✓ Passed

- Advice** Brake pipe slightly corroded rear (3.6.B.2c)
- Advice** Anti-roll bar linkage has slight play in a ball joint all (2.4.G.2)

MOT #9 2016-03-04 12:30**MOT test number** 849918651896**Result** ✓ Passed

- Advice** Propshaft centre support assembly worn advise replace
- Advice** Anti-roll bar linkage has slight play in a ball joint both front (2.4.G.2)

MOT #8 2015-03-07 14:16**MOT test number** 415296965096**Result** ✓ Passed

- Advice** Nearside Rear Panhard rod rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Notice** Play in prop-shaft centre bearing
- Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)
- Notice** Nearside front tyre low on outer edge
- Notice** Advise replace propshaft support bearing

**MOT #7**

2015-03-05 14:29

MOT test number

495454565076

Result**✗ Failed**

- Notice** Nearside front tyre low on outer edge
- Notice** Advise replace propshaft support bearing
- Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)
- Notice** All tyres perished, split and cracked advise replace
- Notice** Play in prop-shaft centre bearing
- Fail** Shock absorber has a serious fluid leak (2.7.3)
- Advice** Nearside Rear Panhard rod rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)

MOT #6

2013-12-16 14:03

MOT test number

606810053306

Result**✓ Passed**

- Advice** Nearside Rear Panhard rod rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Advice** Nearside Rear Rear reflector slightly deteriorated but function not impaired (1.5.1c)
- Advice** Rear Shock absorber has a light misting of oil (2.7.3)
- Notice** Under-trays fitted obscuring some underside components
- Advice** Power steering component(s) has slight seepage from a component (2.3.3b)

**MOT #5** 2013-12-16 12:46**MOT test number** 908580653398**Result** ✗ Failed**Advice** Nearside Rear Rear reflector slightly deteriorated but function not impaired (1.5.1c)**Advice** Rear Shock absorber has a light misting of oil (2.7.3)**Notice** Under-trays fitted obscuring some underside components**Fail** Windscreen wiper does not clear the windscreen effectively (8.2.2)**Advice** Power steering component(s) has slight seepage from a component (2.3.3b)**Advice** Nearside Rear Panhard rod rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)**MOT #4** 2013-01-15 11:33**MOT test number** 695285013074**Result** ✓ Passed**Advice** Rear Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**MOT #3** 2013-01-11 10:51**MOT test number** 328611613025**Result** ✗ Failed**Fail** Parking brake: efficiency below requirements (3.7.B.7)**Fail** Front Windscreen washer provides insufficient washer liquid (8.2.3)**Fail** Nearside Steering rack gaiter split (2.2.D.2d)**Fail** Nearside Rear reflector missing (1.5.1a)**Fail** Offside rear brake binding (3.7.B.1)**Fail** Offside Front Anti-roll bar linkage has excessive play in a ball joint (2.4.G.2)**Fail** Offside Steering rack gaiter split (2.2.D.2d)**Advice** Rear Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)



MOT #2	2012-01-13 13:03
MOT test number	197073312085
Result	✓ Passed

MOT #1	2010-04-07 14:00
MOT test number	860147690070
Result	✓ Passed

Notice Spare tyre cut deep enough to expose cords

Advice Nearside Rear Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)



Tax & MOT check

✓
Taxed
Tax due:
1 February 2025

✗
MOT
Expired:
24 February 2024

Tax status	Valid until 1 February
------------	------------------------

Days left	277
-----------	-----

MOT expiry date	24 February 2024
-----------------	------------------

Full MOT history	See MOT history
------------------	---------------------------------



Damage history


Check the damage history for this NISSAN. See if, where and when this NISSAN had damage and the car repair costs. We also check if this NISSAN was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	

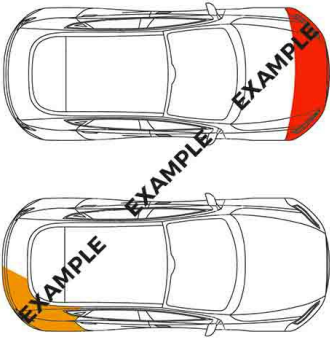

Extra NISSAN salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this NISSAN in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this NISSAN? How many owners did this NISSAN have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this NISSAN had different number plates.

Number of plates	1
Current registration	XXXXXX
Plate since	2019-01-01
Current registration	XXXXXX
Plate since	2019-01-01

More info >



Finance check

Check if this NISSAN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this NISSAN has been settled.

If not, and you buy this NISSAN then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this NISSAN is financed.


Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	21
First mileage registration	2010-04-01
Last registration	2023-02-25
Complete history	See info

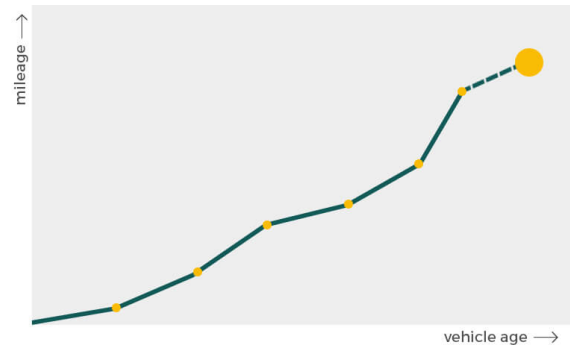

Registration #1	2010-04-01	15 mi
Registration #2	2010-04-07	85.912 mi
Registration #3	2012-01-13	93.470 mi
Registration #4	2013-01-11	96.529 mi
Registration #5	2013-01-15	96.529 mi
Registration #6	2013-12-16	159.893 mi
Registration #7	2013-12-16	159.893 mi
Registration #8	2015-03-05	169.626 mi
Registration #9	2015-03-07	105.423 mi
Registration #10	2016-03-04	176.195 mi
Registration #11	2017-04-11	180.545 mi
Registration #12	2019-05-20	20,377 mi
Registration #13	2019-05-20	20,377 mi
Registration #14	2019-05-20	20,377 mi
Registration #15	2019-05-20	20,377 mi
Registration #16	2019-05-20	20,377 mi
Registration #17	2019-05-20	20,377 mi
Registration #18	2019-05-20	20,377 mi
Registration #19	2019-05-20	20,377 mi
Registration #20	2019-05-20	20,377 mi
Registration #21	2019-05-20	20,377 mi

More info >



Car features

The NISSAN factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete NISSAN factory list for this vehicle [here](#).

More info >

Additional information

Number of seats	8
Engine number	NOT KNOWN