



report date: 2024-03-28

General information

Make	CITROEN
Model	SAXO FORTE
Colour	Silver
Year of manufacture	2002
Top speed	101 mph
0 - 60 mph	12.8 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	60 BHP
Max. torque	88 Nm at 3.800 rpm
Engine capacity	1.124 cc
Cylinders	4
Fuel type	Petrol
Consumption city	32.8 mpg
Consumption extra urban	53.3 mpg
Consumption combined	43.5 mpg
CO2 emission	145 g/km
CO2 label	F








Internet history

Entry 1

Date	2021-10-19
Pictures	9
Listing price	View report

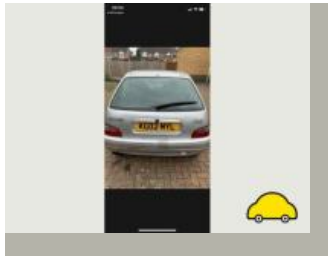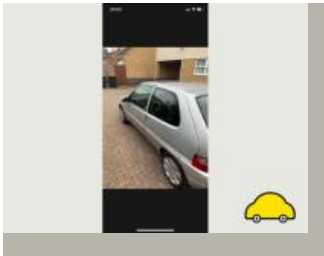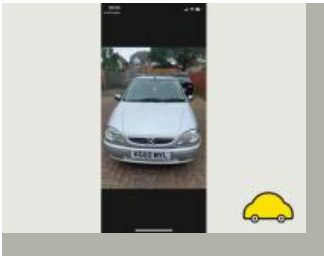

source: autotrader.co.uk

**MOT history**

MOT expiry date	2024-11-27
MOT pass rate	71 %
MOT passed	17
Failed MOT tests	7
Total advice items	13
Total items failed	24

MOT #24	2023-11-28 14:48
MOT test number	549459058445
Result	✓ Passed
Next expiry date	2024-11-27

MOT #23	2021-11-09 16:38
MOT test number	321399108570
Result	✓ Passed

MOT #22	2021-11-08 16:04
MOT test number	425683163615

Result	✗ Failed
---------------	----------

Fail Offside Front Outer Anti-roll bar attachment bracket/mounting fractured (5.3.3 (b) (ii))

Fail Offside Front Brake pad(s) contaminated (1.1.13 (b))

Advice Engine management light illuminated

Fail Exhaust carbon monoxide content after 2nd fast idle exceeds default limits (8.2.1.2 (b))

Advice Front Brake pad(s) wearing thin (1.1.13 (a) (ii))

Fail Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt Insecure (6.1.7 (g) (ii))

Fail Offside Front Brake disc contaminated (1.1.14 (b))

Advice Nearside Rear Inner Wheel arch cover insecure

**MOT #21**

2020-12-09 16:45

MOT test number

767717970852

Result

✓ Passed

- Advice** Front Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Advice** Nearside Rear Wheel bearing slightly noisy (5.1.3 (b) (i))
- Advice** Offside Front Track rod end ball joint has slight play (2.1.3 (b) (i))

MOT #20

2020-12-09 16:45

MOT test number

549666821575

Result

✗ Failed

- Pass with rectification** Nearside Stop lamp(s) not working (4.3.1 (a) (ii))
- Advice** Offside Front Track rod end ball joint has slight play (2.1.3 (b) (i))
- Advice** Front Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Pass with rectification** Nearside Rear Position lamp not working (4.2.1 (a) (ii))
- Pass with rectification** Windscreen washer provides insufficient washer liquid (3.5 (a))
- Advice** Nearside Rear Wheel bearing slightly noisy (5.1.3 (b) (i))

MOT #19

2019-08-14 10:22

MOT test number

433790755025

Result

✓ Passed

- Minor** Nearside Obligatory mirror slightly loose (3.3 (b) (i))

MOT #18

2018-07-21 11:55

MOT test number

632355597612

Result

✓ Passed

**MOT #17** 2017-07-28 14:10**MOT test number** 344123987810**Result** ✓ Passed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**MOT #16** 2017-07-19 14:03**MOT test number** 134718592493**Result** ✗ Failed**Fail** Driver's seat insecure (6.2.A.1)**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Fail** Rear fog lamp not working (1.3.2b)**Fail** Offside Rear Rear wheel bearing rough when rotated (2.6.1)**MOT #15** 2016-08-03 10:28**MOT test number** 849920785778**Result** ✓ Passed**MOT #14** 2015-07-24 13:14**MOT test number** 446105705293**Result** ✓ Passed

**MOT #13** 2015-07-23 14:59**MOT test number** 435384405266**Result** ✗ Failed**Fail** Exhaust emissions Lambda reading after 2nd fast idle outside specified limits (7.3.D.3)**Fail** Rear Exhaust has a major leak of exhaust gases (7.1.2)**Fail** Offside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)**Fail** Exhaust emissions hydrocarbon content after 2nd fast idle excessive (7.3.D.3)**Fail** Nearside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)**Fail** Exhaust emissions carbon monoxide content at idle excessive (7.3.D.4)**MOT #12** 2014-07-22 12:45**MOT test number** 868993704231**Result** ✓ Passed**MOT #11** 2014-07-21 15:19**MOT test number** 356612504257**Result** ✗ Failed**Fail** Exhaust emissions carbon monoxide content at idle excessive (7.3.D.4)**Fail** Exhaust emissions carbon monoxide content after 2nd fast idle excessive (7.3.D.3)**MOT #10** 2013-07-16 12:18**MOT test number** 305847893104**Result** ✓ Passed**MOT #9** 2012-07-16 17:45**MOT test number** 639038892138**Result** ✓ Passed

**MOT #8** 2012-07-16 17:19**MOT test number** 407208492169**Result** ✗ Failed**Fail** Exhaust emissions carbon monoxide content at idle excessive (7.3.D.4)**Fail** Offside Rear Rear wheel bearing has excessive play (2.6.2)**Fail** Exhaust emissions carbon monoxide content after 2nd fast idle excessive (7.3.D.3)**MOT #7** 2011-07-08 12:13**MOT test number** 955619881189**Result** ✓ Passed**MOT #6** 2010-07-01 09:56**MOT test number** 854052380133**Result** ✓ Passed**MOT #5** 2009-05-21 08:47**MOT test number** 241471849143**Result** ✓ Passed**Notice** Both rear + nearside front tyres slightly perished**MOT #4** 2008-05-14 14:37**MOT test number** 201655838107**Result** ✗ Failed**Pass with rectification** Offside Stop lamp not working (1.2.1b)**Pass with rectification** Registration plate lamp not working (1.1.5c)**MOT #3** 2008-05-14 14:37**MOT test number** 551515538174**Result** ✓ Passed



MOT #2	2007-05-30 12:04
MOT test number	571830857123
Result	✓ Passed
MOT #1	2006-04-25 09:30
MOT test number	471956416111
Result	✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 December 2024

✓
MOT
Expires:
27 November 2024

Tax status	Valid until 1 December
Days left	217
MOT expiry date	27 November 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	F
Single payment (12 months)	£ 200,00,-
Single six month payment	£ 110,00,-
Total payable by 12 monthly instalments	£ 210,00,-



Damage history

Check the damage history for this CITROEN. See if, where and when this CITROEN had damage and the car repair costs. We also check if this CITROEN was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra CITROEN salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this CITROEN in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this CITROEN? How many owners did this CITROEN have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this CITROEN had different number plates.

Number of plates	0
Current registration	
Plate since	2024-03-28
Current registration	
Plate since	2024-03-28

More info >



Finance check

Check if this CITROEN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this CITROEN has been settled.

If not, and you buy this CITROEN then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this CITROEN is financed.

Finance company	XXXXXXXX	XXXX
Date of agreement	XXXXXXXX	XXXX
Agreement type	XXXXXXXX	XXXX
Agreement term	XXXXXXXX	XXXX
Agreement number	XXXXXXXX	XXXX
Contact info	XXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	25
First mileage registration	2002-05-10
Last registration	2023-11-28
Complete history	See info



Registration #1	2002-05-10	10 mi
Registration #2	2006-04-25	23.416 mi
Registration #3	2007-05-30	32.533 mi
Registration #4	2008-05-14	33.750 mi
Registration #5	2009-05-21	35.921 mi
Registration #6	2010-07-01	37.976 mi
Registration #7	2011-07-08	40.131 mi
Registration #8	2012-07-16	41.523 mi
Registration #9	2012-07-16	41.524 mi
Registration #10	2013-07-16	42.295 mi
Registration #11	2014-07-21	43.710 mi
Registration #12	2014-07-22	43.714 mi
Registration #13	2015-07-23	44.857 mi
Registration #14	2016-07-23	45.999 mi
Registration #15	2017-07-23	47.141 mi
Registration #16	2018-07-23	48.283 mi
Registration #17	2019-07-23	49.425 mi
Registration #18	2020-07-23	50.567 mi
Registration #19	2021-07-23	51.709 mi
Registration #20	2022-07-23	52.851 mi
Registration #21	2023-07-23	53.993 mi
Registration #22	2024-07-23	55.135 mi
Registration #23	2025-07-23	56.277 mi
Registration #24	2026-07-23	57.419 mi
Registration #25	2027-07-23	58.561 mi



Safety ratings

NCAP rating



Video

[see crash video](#)

Dimensions & weight

Width

1595 mm

Height

1360 mm

Length

3718 mm

Wheel base

2385 mm

Kerb weight

805 kg

Additional information

Fuel tank capacity

45 l

Fuel delivery

Single-Point Injection

Number of doors

5

Number of axles

2

Engine number

FP6J3657884