




report date: 2024-03-29

## General information

Make	VAUXHALL
Model	TIGRA SXI 16V TWINPORT
Colour	Yellow
Year of manufacture	-
Top speed	109 mph
0 - 60 mph	12.7 seconds
Gearbox	5 speed Manual

## Engine & fuel consumption

Power	89 BHP
Max. torque	125 Nm at 4.000 rpm
Cylinders	4
Fuel type	Petrol
Consumption city	34.5 mpg
Consumption extra urban	54.3 mpg
Consumption combined	44.8 mpg

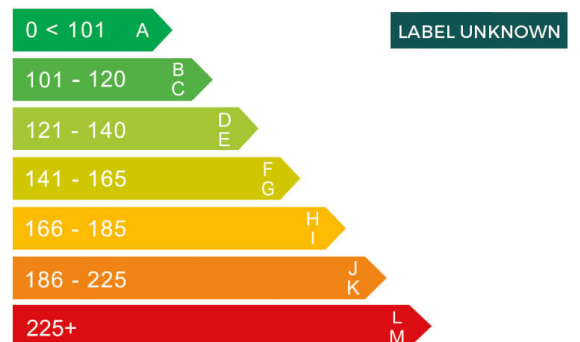

**MOT history**

<b>MOT #15</b>	2020-05-22 15:14
<b>MOT test number</b>	710098312272
<b>Result</b>	✓ Passed
<b>Next expiry date</b>	2021-05-30
<b>Advice</b>	Oil leak, but not excessive (8.4.1 (a) (i))
<b>Advice</b>	Rear rear axel in poor condition
<b>Advice</b>	Brake pipe corroded, covered in grease or other material all (1.1.11 (c))

<b>MOT #14</b>	2019-05-28 08:43
<b>MOT test number</b>	562548217024
<b>Result</b>	✓ Passed
<b>Advice</b>	Nearside Rear Nail in tyre
<b>Advice</b>	Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

<b>MOT #13</b>	2019-05-21 07:47
<b>MOT test number</b>	845301554883
<b>Result</b>	✗ Failed
<b>Fail</b>	Offside Front Tyre has ply or cords exposed (5.2.3 (d) (ii))
<b>Fail</b>	Offside Front Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))
<b>Fail</b>	Offside Rear Service brake excessively binding (1.2.1 (f))
<b>Fail</b>	Nearside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))
<b>Minor</b>	Nearside Rear Tyre obviously under inflated (5.2.3 (h) (i))
<b>Fail</b>	Central Exhaust has a major leak of exhaust gases (6.1.2 (a))
<b>Fail</b>	Nearside Front Coil spring fractured or broken (5.3.1 (b) (i))
<b>Fail</b>	Emissions not tested major leak (8.2.1.2 (d))

**MOT #12**

2018-05-08 15:34

**MOT test number**

178551599138

**Result**

✓ Passed

**Advice**

Central Exhaust has a minor leak of exhaust gases (7.1.2)

**MOT #11**

2018-05-08 07:51

**MOT test number**

717029852690

**Result**

✗ Failed

**Fail**

Front Windscreen wiper does not clear the windscreen effectively (8.2.2)

**Fail**

Offside Rear rear parking brake recording little or no effort (3.7.B.6a)

**Fail**

Parking brake: efficiency below requirements (3.7.B.7)

**Fail**

Nearside Rear rear parking brake recording little or no effort (3.7.B.6a)

**Advice**

Central Exhaust has a minor leak of exhaust gases (7.1.2)

**MOT #10**

2017-05-03 12:10

**MOT test number**

231692997543

**Result**

✓ Passed

**Advice**

Offside Front tyre wearing on inner edge

**MOT #9**

2017-05-03 08:27

**MOT test number**

318769555984

**Result**

✗ Failed

**Advice**

Offside Front tyre wearing on inner edge

**Fail**

Nearside Front Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (4.1.D.1a)

**Fail**

Windscreen wiper does not clear the windscreen effectively (8.2.2)



<b>MOT #8</b>	2016-05-31 13:23
<b>MOT test number</b>	187260119854
<b>Result</b>	✓ Passed
<b>Advice</b>	Fuel filter corroded but not leaking
<b>Advice</b>	Nearside front tyre wearing from inside edge

<b>MOT #7</b>	2016-05-31 09:10
<b>MOT test number</b>	750863265141
<b>Result</b>	✗ Failed
<b>Advice</b>	Fuel filter corroded but not leaking
<b>Fail</b>	Front brake disc in such a condition that it is seriously weakened (3.5.1i)
<b>Fail</b>	Parking brake: efficiency below requirements (3.7.B.7)
<b>Advice</b>	Nearside front tyre wearing from inside edge
<b>Fail</b>	Emissions not tested (7.3.A.1)

<b>MOT #6</b>	2015-04-14 16:34
<b>MOT test number</b>	107224705112
<b>Result</b>	✓ Passed

<b>MOT #5</b>	2015-04-14 09:57
<b>MOT test number</b>	298654405142
<b>Result</b>	✗ Failed
<b>Fail</b>	Offside Rear coil spring broken (2.4.C.1a)
<b>Fail</b>	Offside Rear Brake cable has wires broken and is significantly weakened (3.5.1b)
<b>Fail</b>	Centre Exhaust has a major leak of exhaust gases (7.1.2)
<b>Fail</b>	Nearside Rear Brake cable has wires broken and is significantly weakened (3.5.1b)
<b>Fail</b>	Parking brake: efficiency below requirements (3.7.B.7)

**MOT #4** 2014-06-11 10:19**MOT test number** 415472564130**Result** ✓ Passed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**MOT #3** 2013-05-16 12:54**MOT test number** 225556833478**Result** ✓ Passed**Notice** Breather pipes on rocker top - split / blown.**Notice** Oil leak**MOT #2** 2012-05-22 11:32**MOT test number** 299663142198**Result** ✓ Passed**MOT #1** 2011-05-09 16:19**MOT test number** 446369321196**Result** ✓ Passed



Damage history

Check the damage history for this VAUXHALL. See if, where and when this VAUXHALL had damage and the car repair costs. We also check if this VAUXHALL was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	



Damage 2

Date	
Category	
Type	



Extra VAUXHALL salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this VAUXHALL in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 15,200
Auction value	£ 15,200
Average private trade value	£ 15,200

More info >



Owner history

For how long did the current and previous owner(s) have this VAUXHALL? How many owners did this VAUXHALL have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

XXXXXXXXXX	XXXXXXXXXX
XXXXXXXXXXXXXX	XXXXXXXXXX
XXXXXXXXXX	XXXXXXXXXX
XXXXXX	XXXXXXXXXX
XXXXXXXXXXXXXX	XXXXXXXXXX
XXXXXXXXXX	XXXXXXXXXX

More info >

Plate changes

See in this check if this VAUXHALL had different number plates.

Number of plates	1
Current registration	 <b>XXXXXX</b>
Plate since	2024-03-29
Current registration	 <b>XXXXXX</b>
Plate since	2024-03-29

More info >





Finance check

Check if this VAUXHALL is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this VAUXHALL has been settled.

If not, and you buy this VAUXHALL then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this VAUXHALL is financed.

Finance company	XXXXXXXX XX
Date of agreement	XXXXXXXX XX
Agreement type	XXXXXXXX XX
Agreement term	XXXXXXXX XX
Agreement number	XXXXXXXX XX
Contact info	XXXXXXXX XX

More info >



Mileage check

Odometer	In miles
Mileage registrations	16
First mileage registration	2008-06-27
Last registration	2020-05-22
Complete history	<a href="#">See info</a>



Registration #1	2008-06-27	14 mi
Registration #2	2011-05-09	15.745 mi
Registration #3	2012-05-22	23.634 mi
Registration #4	2013-05-16	29.051 mi
Registration #5	2014-06-11	34.788 mi
Registration #6	2015-04-14	40.429 mi
Registration #7	2015-04-14	40.429 mi
Registration #8	2016-05-31	46.194 mi
Registration #9	2016-05-31	46.194 mi
Registration #10	2016-05-31	46.194 mi
Registration #11	2016-05-31	46.194 mi
Registration #12	2016-05-31	46.194 mi
Registration #13	2016-05-31	46.194 mi
Registration #14	2016-05-31	46.194 mi
Registration #15	2016-05-31	46.194 mi
Registration #16	2016-05-31	46.194 mi

More info >



Safety ratings

NCAP rating	★★★★★
Video	<a href="#">see crash video</a>



Dimensions & weight

Width	1753 mm
Height	1413 mm
Length	4288 mm
Wheel base	2614 mm
Kerb weight	1180 kg
Max. allowed weight	1715 kg

Additional information

Fuel tank capacity	52 l
Fuel delivery	Multi-Point Injection
Number of doors	3
Number of seats	5
Number of axles	2
Engine number	19PU0404