




report date: 2024-03-29

General information

Make	LAND ROVER
Model	RANGE ROVER SDV6 HSE
Colour	Black
Year of manufacture	2012
Top speed	124 mph
0 - 100 km/h	10.3 seconds
0 - 60 mph	8.5 seconds
Gearbox	8 speed automatic

Engine & fuel consumption

Power	188 kW / 256 HP / 255 BHP
Max. torque	520 Nm at 2.000 rpm
Engine capacity	2.993 cc
Cylinders	6
Fuel type	Diesel
Consumption city	28.8 mpg
Consumption extra urban	34.9 mpg
Consumption combined	32.1 mpg
CO2 emission	230 g/km
CO2 label	L

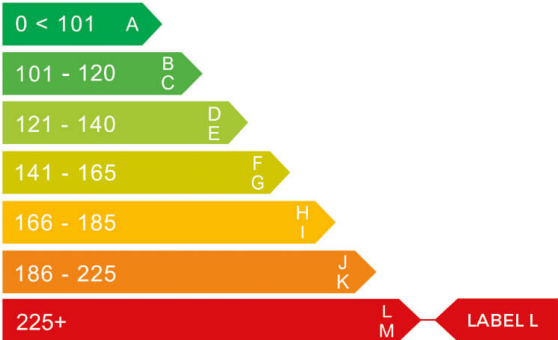



Internet history

Entry 1

Date	2021-02-01
Pictures	1
Listing price	View report



source: [autoonline.co.uk](https://www.autoonline.co.uk)



MOT history

MOT expiry date	2025-03-29
MOT pass rate	79 %
MOT passed	11
Failed MOT tests	3
Total advice items	45
Total items failed	5

MOT #142024-03-20 09:03

MOT test number185605244609

Result✓ Passed

Next expiry date2025-03-29

- Advice

Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))
- Advice

Offside Rear Upper Anti-roll bar linkage ball joint has slight play (5.3.4 (a) (i))
- Advice

Offside Front Inner Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice

Rear Outer Brake pipe corroded, covered in grease or other material nearside & offside (1.1.11 (c))
- Advice

Nearside Front Nail in tyre
- Advice

Nearside Rear Inner Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice

Central Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))
- Advice

Offside hydraulic pipework corroded

**MOT #13**

2023-03-29 08:28

MOT test number

467620715028

Result

✓ Passed

- Advice** Central Rear Brake pipe corroded, covered in grease or other material above axle (1.1.11 (c))
- Advice** Offside hydraulic pipework corroded
- Advice** Rear Outer Brake pipe corroded, covered in grease or other material nearside & offside (1.1.11 (c))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened nearside & offside (1.1.14 (a) (ii))
- Advice** Offside Rear Upper Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Rear Brake pad(s) wearing thin nearside & offside (1.1.13 (a) (ii))

MOT #12

2022-03-21 16:33

MOT test number

616421946425

Result

✓ Passed

- Advice** Offside Rear Upper Suspension arm pin or bush worn but not resulting in excessive movement outer bush (5.3.4 (a) (i))
- Advice** Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Advice** Nearside Rear Upper Suspension arm pin or bush worn but not resulting in excessive movement outer bush (5.3.4 (a) (i))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))
- Advice** Rear Brake pipe corroded, covered in grease or other material o/s and n/s (1.1.11 (c))

**MOT #11**

2022-03-07 12:39

MOT test number

972526365289

Result**✗ Failed**

Advice Offside Rear Upper Suspension arm pin or bush worn but not resulting in excessive movement outer bush (5.3.4 (a) (i))

Fail Emissions not tested (8.2.2.2 (e))

Advice Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))

Fail Engine MIL inoperative or indicates a malfunction (8.2.2.2 (g))

Advice Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement front bush (5.3.4 (a) (i))

Advice Nearside Rear Upper Suspension arm pin or bush worn but not resulting in excessive movement outer bush (5.3.4 (a) (i))

Advice Rear Brake pipe corroded, covered in grease or other material o/s and n/s (1.1.11 (c))

Advice Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Fail Nearside Front Suspension arm pin or bush excessively worn rear bush (5.3.4 (a) (i))

Advice Offside Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush (5.3.4 (a) (i))

MOT #10

2021-03-15 17:05

MOT test number

336558945215

Result**✓ Passed**

Advice Rear Brake disc worn, pitted or scored, but not seriously weakened both ns and os pitted and corroded (1.1.14 (a) (ii))

Advice Rear Wheel bearing has slight play both ns and os (5.1.3 (a) (i))

Advice Rear Brake pipe corroded, covered in grease or other material both ns and os (1.1.11 (c))

**MOT #9** 2021-03-12 15:55**MOT test number** 828567245445**Result** ✗ Failed**Advice** Front Brake pad(s) wearing thin both ns and os (1.1.13 (a) (ii))**Advice** Rear Wheel bearing has slight play both ns and os (5.1.3 (a) (i))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge worn on edges (5.2.3 (e))**Fail** Engine MIL inoperative or indicates a malfunction (8.2.2.2 (g))**Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened both ns and os pitted and corroded (1.1.14 (a) (ii))**Advice** Rear Brake pipe corroded, covered in grease or other material both ns and os (1.1.11 (c))**MOT #8** 2020-03-23 10:29**MOT test number** 577727837108**Result** ✓ Passed**Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush (5.3.4 (a) (i))**Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush (5.3.4 (a) (i))**Advice** Nearside Rear Brake pipe corroded, covered in grease or other material front to rear pipe above chassis slight corrosion (1.1.11 (c))**MOT #7** 2019-03-30 10:41**MOT test number** 840928459470**Result** ✓ Passed**MOT #6** 2018-11-26 12:27**MOT test number** 243957081906**Result** ✓ Passed**Advice** Front Brake pad(s) wearing thin (1.1.13 (a) (ii))

**MOT #5** 2017-11-13 09:40**MOT test number** 188590947722**Result** ✓ Passed**Advice** Undertrays fitted**Advice** Engine covers fitted**MOT #4** 2016-11-22 14:27**MOT test number** 215543171694**Result** ✓ Passed**Advice** Offside Front Lower Suspension arm has slight play in a pin/bush rear bush (2.4.G.2)**Advice** Nearside Front Lower Suspension arm has slight play in a pin/bush rear bush (2.4.G.2)**Advice** Nearside Rear Lower Suspension arm has slight play in a pin/bush front bush (2.4.G.2)**Advice** Brakes noisy**MOT #3** 2015-12-03 10:35**MOT test number** 755552436257**Result** ✓ Passed**Advice** Under trays and engine covers fitted**MOT #2** 2015-03-20 09:30**MOT test number** 136159275061**Result** ✓ Passed**MOT #1** 2015-03-20 09:30**MOT test number** 598449075047**Result** ✗ Failed**Pass with rectification** Rear Fuel pipe leaking (7.2.3)



Tax & MOT check

✓
Taxed

Tax due:
1 April 2025

✓
MOT

Expires:
29 March 2025

Tax status	Valid until 1 April
Days left	338
MOT expiry date	29 March 2025
Full MOT history	See MOT history

Tax calculation

Vehicle class	49
Band	L
Single payment (12 months)	£ 675,00,-
Single six month payment	£ 371,25,-
Total payable by 12 monthly instalments	£ 708,75,-



Damage history

Check the damage history for this LAND ROVER. See if, where and when this LAND ROVER had damage and the car repair costs. We also check if this LAND ROVER was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	



Damage 2

Date	
Category	
Type	



Extra LAND ROVER salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this LAND ROVER in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this LAND ROVER? How many owners did this LAND ROVER have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this LAND ROVER had different number plates.

Number of plates	1
Current registration	XXXXXX
Plate since	2019-01-01
Current registration	XXXXXX
Plate since	2019-01-01

More info >



Finance check

Check if this LAND ROVER is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this LAND ROVER has been settled.

If not, and you buy this LAND ROVER then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this LAND ROVER is financed.

Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	15
First mileage registration	2012-03-20
Last registration	2024-03-20
Complete history	See info



Registration #1	2012-03-20	25 mi
Registration #2	2015-03-20	31.092 mi
Registration #3	2015-12-03	39.681 mi
Registration #4	2016-11-22	50.477 mi
Registration #5	2017-11-13	54.954 mi
Registration #6	2018-11-26	58.973 mi
Registration #7	2019-03-30	59.602 mi
Registration #8	2020-03-23	73.688 mi
Registration #9	2020-03-23	73.688 mi
Registration #10	2020-03-23	73.688 mi
Registration #11	2020-03-23	73.688 mi
Registration #12	2020-03-23	73.688 mi
Registration #13	2020-03-23	73.688 mi
Registration #14	2020-03-23	73.688 mi
Registration #15	2020-03-23	73.688 mi

More info >



Safety ratings

NCAP rating



Video

[see crash video](#)



Dimensions & weight

Width	1932 mm
Height	1784 mm
Length	4783 mm
Wheel base	2745 mm
Kerb weight	1960 kg
Max. allowed weight	2500 kg

Additional information

Fuel tank capacity	84 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	5
Number of axles	2
Engine number	0641796306DT