





report date: 2024-03-28

### General information

Make	AUDI
Model	TT QUATTRO (225BHP)
Colour	Silver
Year of manufacture	2003
Top speed	151 mph
Gearbox	6 speed Manual

## Engine & fuel consumption

Power	225 BHP
Max. torque	280 Nm at 2.200 rpm
Engine capacity	1.781 cc
Cylinders	4
Fuel type	Petrol
Consumption city	23.0 mpg
Consumption extra urban	38.7 mpg
Consumption combined	30.7 mpg
CO2 emission	226 g/km
CO2 label	L



CarCheck.co.uk page 1/18



report date: 2024-03-28

Internet history

Entry 1

Date 2021-06-13

Pictures 20

Listing price <u>View report</u>









source: autotrader.co.uk

CarCheck.co.uk page 2/18



report date: 2024-03-28

## MOT history

MOT expiry date	2024-05-10
MOT pass rate	70 %
MOT passed	21
Failed MOT tests	9
Total advice items	66
Total items failed	24

MOT #30		2023-05-11 14:33
MOT test	number	953239225057
Result		✓ Passed
Next expi	ry date	2024-05-10
Advice	Offside Rear Brake pipe corroded, covered in grease or other material (	1.1.11 (c))
Advice (ii))	Offside Front Brake disc worn, pitted or scored, but not seriously weake	ened inner face (1.1.14 (a)

MOT #29	2023-05-11 10:00
MOT test number	935838548847
Result	<b>×</b> Failed
Fail Offside Rear Seat belt anchorage loose lower anchorage detached (7.1.1 (b	)))
Fail Nearside Rear Undertray likely to become detached (6.2.1 (a) (ii))	
Fail Nearside Headlamp light intensity severely reduced (4.1.4 (a))	
Advice Offside Rear Brake pipe corroded, covered in grease or other material (	1.1.11 (c))
Advice Offside Front Brake disc worn, pitted or scored, but not seriously weake (ii))	ned inner face (1.1.14 (a)
Fail Nearside Side repeater incorrect colour (4.4.3 (a))	
<b>Fail</b> Nearside Front Inner Drive shaft joint constant velocity boot split or insecuringress of dirt (6.1.7 (g) (ii))	e, no longer prevents the

CarCheck.co.uk page 3/18



report date: 2024-03-28

MOT #28 2022-06-21 15:09

**MOT test number** 497094438905

Result \rightarrow Passed

**Minor** Offside Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))

**Minor** Nearside Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))

Advice Offside Rear Brake pipe corroded, covered in grease or other material slightly corroded (1.1.11 (c))

**MOT #27** 2022-06-20 09:46

MOT test number 355325559585

**Result** X Failed

**Advice** Offside Front Lower Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))

Fail Nearside Front Coil spring fractured or broken (5.3.1 (b) (i))

**Fail** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt split (6.1.7 (g) (ii))

Advice Offside Rear Brake pipe corroded, covered in grease or other material slightly corroded (1.1.11 (c))

Fail Nearside Front Lower Suspension arm pin or bush excessively worn (5.3.4 (a) (i))

**Fail** Nearside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt split (6.1.7 (g) (ii))

**Advice** Items removed from driver's view prior to test

Fail Nearside Rear Coil spring fractured or broken (5.3.1 (b) (i))

**Fail** Offside Front Position lamp not working (4.2.1 (a) (ii))

MOT #26 2021-06-22 14:47

**MOT test number** 751914489084

CarCheck.co.uk page 4/18

**Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush (5.3.4 (a) (i))

**Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement rear bush (5.3.4 (a) (i))



report date: 2024-03-28

MOT #25

MOT test number

896609988863

Result

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

MOT #24

MOT test number

Result

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Pass with rectification

Offside Front Position lamp not working (4.2.1 (a) (ii))

MOT #23

MOT test number

Result

Advice Nearside Front Child Seat fitted not allowing full inspection of adult belt

**MOT #22** 2018-08-10 08:00 **MOT** test number 562742103141 Result ✓ Passed **Advice** Nearside Side repeater slightly discoloured (4.4.3 (a)) **Advice** Front Sub-frame corroded but not seriously weakened (5.3.3 (b) (i)) **Advice** Engine cover and undertrays fitted **Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i)) **Advice** Offside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i)) **Advice** Exhaust corroded Advice Rear Sub-frame corroded but not seriously weakened (5.3.3 (b) (i)) **Advice** Nearside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))

CarCheck.co.uk page 5/18



report date: 2024-03-28

2018-08-09 10:39 **MOT #21** 953803916569 **MOT** test number Result × Failed **Advice** Offside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i)) **Advice** Engine cover and undertrays fitted Fail Nearside Front Position lamp not working (4.2.1 (a)) **Advice** Rear Sub-frame corroded but not seriously weakened (5.3.3 (b) (i)) **Advice** Nearside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i)) **Advice** Exhaust corroded **Advice** Nearside Side repeater slightly discoloured (4.4.3 (a)) **Advice** Front Sub-frame corroded but not seriously weakened (5.3.3 (b) (i)) **Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i))

MOT #20		2017-09-01 15:01
MOT test	number	230996748581
Result		✓ Passed
Advice	Offside Front Brake hose has slight corrosion to ferrules (3.6.B.4e)	
Advice	Nearside Rear coil spring corroded (2.4.C.1b)	
Advice	Exhaust corroded	

CarCheck.co.uk page 6/18



report date: 2024-03-28

**MOT #19** 2017-09-01 10:37

**MOT test number** 971868784639

**Result** X Failed

**Advice** Nearside Rear coil spring corroded (2.4.C.1b)

**Fail** Nearside Front Anti-roll bar linkage ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt (2.4.G.2)

**Fail** Nearside Front Front position lamp(s) not working (1.1.A.3b)

**Advice** Exhaust corroded

Fail Offside Windscreen wiper does not clear the windscreen effectively (8.2.2)

**Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)

**Advice** Offside Front Brake hose has slight corrosion to ferrules (3.6.B.4e)

**MOT #18** 2016-09-06 14:28

**MOT test number** 657171096893

Result \( \sqrt{Passed} \)

**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

Advice Nearside Front Lower Suspension arm rubber bush deteriorated but not resulting in excessive

movement (2.4.G.2)

**MOT #17** 2015-08-14 12:27

MOT test number 505716525253

**MOT #16** 2014-08-21 15:48

MOT test number 375553334457

**Result** 
✓ Passed

CarCheck.co.uk page 7/18



Result

MM03FDD

report date: 2024-03-28

Passed

MOT #15 2014-08-18 15:18 596960634266 **MOT** test number Result × Failed Fail Rear fog lamp tell tale not working (1.3.1b) Fail Nearside Headlamp cleaning device obviously defective (1.7.2) Notice Nearside rear tyre worn inside edge **Advice** Nearside Rear coil spring corroded (2.4.C.1b) Fail Offside Rear fog lamp not working (1.3.2b) **Notice** Under-trays fitted obscuring some underside components Offside Rear coil spring broken (2.4.C.1a) Fail

MOT #14 2013-09-05 12:26

MOT test number 477468643285

Result ✓ Passed

MOT #13 2013-09-04 16:00

**MOT test number** 615367743288

Result X Failed

**Fail** Nearside Front passenger door hinge deteriorated so the door cannot be readily opened or closed (6.2.B.2)

MOT #12 2013-05-20 16:03

**MOT test number** 669970943137

Advice Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

CarCheck.co.uk page 8/18



report date: 2024-03-28

MOT test number

925850043136

Result

Advice (2.5.C.1a)

Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Advice
Offside Outer Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt (2.5.C.1a)

Offside Outer Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt (2.5.C.1a)

MOT test number

Result

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Advice Brake pad(s) wearing thin (3.5.1g)

Result Passed

Advice Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

MOT test number
719753052186

Result

Advice Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Fail Nearside Registration plate lamp not working (1.1.C.1d)

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

Advice Brake pad(s) wearing thin (3.5.1g)

MOT #8

MOT test number

Result

Advice Rear Brake pad(s) wearing thin (3.5.1g)

Advice Front Brake pad(s) wearing thin (3.5.1g)

CarCheck.co.uk page 9/18



report date: 2024-03-28

MOT test number

Result

Advice Front Brake pad(s) wearing thin (3.5.1g)

Advice Rear brake disc slightly pitted (3.5.1h)

Advice Rear Brake pad(s) wearing thin (3.5.1g)

MOT test number

Result

Advice Rear brake disc slightly pitted (3.5.1h)

Advice Rear Brake pad(s) wearing thin (3.5.1g)

Fail Front brake disc excessively pitted (3.5.1h)

Advice Front Brake pad(s) wearing thin (3.5.1g)

MOT #5

MOT test number

Result

Notice Oil leak

Notice N/s/r bumper slightly scuffed

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

CarCheck.co.uk page 10/18



report date: 2024-03-28

MOT #4		2009-04-22 10:12
MOT test number		440042719160
Result		<b>✓</b> Passed
Advice Nearside Front br	rake disc slightly pitted (3.5.1h)	
<b>Notice</b> Both front tyres w	vearin on inside edge	
Advice Offside Front bral	ke disc slightly pitted (3.5.1h)	

Advice Offside Front brake disc slightly pitted (3.5.1	lh)
MOT #3	2008-07-15 14:08
MOT test number	284757598472
Result	✓ Passed
MOT #2	2007-06-05 13:35
MOT test number	741906157136
Result	✓ Passed
MOT #1	2006-05-26 10:18
MOT test number	800116446118
Result	✓ Passed

CarCheck.co.uk page 11/18





report date: 2024-03-28

### Tax & MOT check



Tax status	Valid until 1 July
Days left	64
MOT expiry date	10 May 2024
Full MOT history	See MOT history

### Tax calculation

Vehicle class	48
Band	K
Single payment (12 months)	£ 395,00,-
Single six month payment	£ 217,25,-
Total payable by 12 monthly instalments	£ 414,75,-

CarCheck.co.uk page 12/18




report date: 2024-03-28

### Damage history

Check the damage history for this AUDI. See if, where and when this AUDI had damage and the car repair costs. We also check if this AUDI was scrapped. Download the premium report <a href="here">here</a> for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type

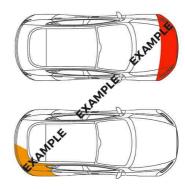

#### Extra AUDI salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 13/18



report date: 2024-03-28

### Vehicle valuation

What is this car worth? See the vehicle value of this AUDI in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

**Trade retail value** 

**Auction value** 

Average private trade value

More info >

CarCheck.co.uk page 14/18



report date: 2024-03-28

Owner	history
OWITCI	ilistoi y

Owner mistory		
For how long did the current and previous owner(s) have this AUDI? How many owners d Check it in the premium report and see all owner registrations. Download the full report		'e?
********		
***************************************		
***************************************		
**********		
***************************************		
	More info	>
Plate changes		
See in this check if this AUDI had different number plates.		
Number of plates		
Current registration	NK NA	
Plate since		
Current registration	OK OK	
Plate since		
	More info	>

CarCheck.co.uk page 15/18



report date: 2024-03-28

### Finance check

Check if this AUDI is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this AUDI has been settled.

If not, and you buy this AUDI then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this AUDI is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Control info	

Contact info

More info >

CarCheck.co.uk page 16/18



report date: 2024-03-28

## Mileage check

Odometer	In miles
Mileage registrations	32
First mileage registration	2003-06-03
Last registration	2023-05-11
Complete history	See info



Registration #1	2003-06-03	16 mi
Registration #2	2006-05-26	59.769 mi
Registration #3	2007-06-05	63.899 mi
Registration #4	2008-07-15	65.934 mi
Registration #5	2009-04-22	70.957 mi
Registration #6	2010-05-21	81.549 mi
Registration #7	2010-05-25	81.551 mi
Registration #8	2010-05-26	81.551 mi
Registration #9	2011-05-27	86.192 mi
Registration #10	2012-06-01	90.070 mi
Registration #11	2012-06-02	90.070 mi
Registration #12	2013-05-20	99.754 mi
Registration #13	2013-05-20	99.754 mi
Registration #14	2013-09-04	99.827 mi
Registration #15	2013-09-05	99.827 mi
Registration #16	2014-08-18	104.423 mi
Registration #17		11.777 mi
Registration #18		11.777 es
Registration #19		11.777 es
Registration #20		11.777 es
Registration #21		11.777 es
Registration #22		11.117 es
Registration #23		11.777 es
Registration #24		11.177 es
Registration #25		11.777 es
Registration #26		0.00 44
CarCheck.co.uk		page 17/18

Registration #27	11.777 66
Registration #28	11.777 es
Registration #29	11.777 es
Registration #30	11.777 es
Registration #31	9.79 es
Registration #32	0.777-46

More info >



report date: 2024-03-28

### Car features

50225	Air conditioning
60295	
0482	
0501	
0566	
0567	
60569	

## Safety ratings

NCAP rating	****
Video	see crash video



## Dimensions & weight

Width	1856 mm
Height	1345 mm
Length	4041 mm
Wheel base	2429 mm
Kerb weight	1395 kg
Max. allowed weight	1850 kg

## Additional information

· · · · · · · · · · · · · · · · · · ·		
Fuel tank capacity	62 I	
Fuel delivery	Multi-Point Injection	
Number of doors	3	
Number of axles CarCheck.co.uk	2	page 18/18