




report date: 2024-03-28

General information

Make	FORD
Model	GALAXY GHIA TDI
Colour	Blue
Year of manufacture	2004
Top speed	111 mph
0 - 60 mph	15.1 seconds
Gearbox	5 speed automatic

Engine & fuel consumption

Power	115 BHP
Max. torque	310 Nm at 1.900 rpm
Engine capacity	1.896 cc
Cylinders	4
Fuel type	Diesel
Consumption city	28.5 mpg
Consumption extra urban	46.3 mpg
Consumption combined	37.7 mpg
CO2 emission	200 g/km
CO2 label	J

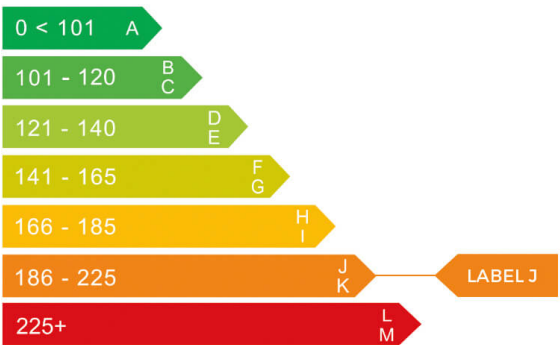

**MOT history**

MOT expiry date	2021-10-12
MOT pass rate	70 %
MOT passed	14
Failed MOT tests	6
Total advice items	39
Total items failed	17

MOT #20	2020-10-13 08:16
MOT test number	196094126208
Result	✓ Passed
Next expiry date	2021-10-12
Advice	Tyre slightly damaged/cracking or perishing both rear (5.2.3 (d) (ii))
Advice	Offside Front tyre worn on the inner edge
Advice	Nearside Rear Service brake binding but not excessively (1.2.1 (f))

MOT #19	2019-04-03 07:40
MOT test number	232793344649
Result	✓ Passed
Advice	Tyre slightly damaged/cracking or perishing both rear tyres (5.2.3 (d) (ii))
Advice	Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))

MOT #18	2018-03-20 10:11
MOT test number	310531106323
Result	✓ Passed
Advice	Offside Front tyre low on tread on inner edge
Advice	Body has slight corrosion under neath vehicle (6.1.B.2)

**MOT #17** 2018-03-20 09:21**MOT test number** 288808541785**Result** ✗ Failed**Fail** Nearside Front Anti-roll bar linkage ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt (2.4.G.2)**Advice** Body has slight corrosion under neath vehicle (6.1.B.2)**Fail** Nearside Rear coil spring broken (2.4.C.1a)**Advice** Offside Front tyre low on tread on inner edge**MOT #16** 2017-03-27 14:46**MOT test number** 966056165206**Result** ✓ Passed**MOT #15** 2017-03-27 12:20**MOT test number** 753175986065**Result** ✗ Failed**Fail** Nearside Front Body or chassis has excessive corrosion, seriously affecting its strength within 30cm of the body mountings (6.1.B.2)**MOT #14** 2016-03-30 16:22**MOT test number** 364123005037**Result** ✓ Passed**Advice** Centre Front Exhaust has a minor leak of exhaust gases (7.1.2)

**MOT #13**

2016-03-29 14:04

MOT test number

137794504462

Result**✗ Failed**

Fail Nearside Front Lower Suspension arm rubber bush deteriorated resulting in excessive movement (2.4.G.2)

Fail Offside Obligatory mirror seriously damaged, affecting the rear view (8.1.2a)

Advice Centre Front Exhaust has a minor leak of exhaust gases (7.1.2)

Fail Offside Front Lower Suspension arm rubber bush deteriorated resulting in excessive movement (2.4.G.2)

Fail Nearside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

MOT #12

2015-03-25 12:59

MOT test number

198294785005

Result**✓ Passed****MOT #11**

2014-03-29 15:14

MOT test number

567708784091

Result**✓ Passed****MOT #10**

2014-03-24 09:12

MOT test number

106013884414

Result**✗ Failed**

Fail Offside Front Anti-roll bar linkage ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt (2.4.G.2)

Fail Offside rear parking brake recording little or no effort (3.7.B.6a)

Fail Parking brake: efficiency below requirements (3.7.B.7)

Fail Nearside rear parking brake recording little or no effort (3.7.B.6a)

Fail Parking brake lever has no reserve travel (3.1.6b)



MOT #9

2013-04-09 09:13

MOT test number

459029693038

Result		✓ Passed
Advice	Nearside Rear Shock absorber has a light misting of oil (2.7.3)	
Advice	Nearside Front Brake hose slightly deteriorated (3.6.B.4d)	
Notice	Nearside inner drive shaft gaitor split	
Advice	Offside Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt (2.5.C.1a)	
Advice	Nearside Rear Tyre worn close to the legal limit (4.1.E.1)	
Advice	Offside Front Brake hose slightly deteriorated (3.6.B.4d)	
Notice	Engine covers fitted obscuring some components in the engine bay	
Advice	Nearside Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt (2.5.C.1a)	
Notice	Both rear suspension coil springs slightly corroded	

**MOT #8** 2013-04-08 12:14**MOT test number** 747848893013**Result** ✗ Failed**Advice** Nearside Rear Shock absorber has a light misting of oil (2.7.3)**Notice** Nearside inner drive shaft gaitor split**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**Fail** Nearside Front Tyre has ply or cords exposed (4.1.D.1b)**Advice** Offside Front Brake hose slightly deteriorated (3.6.B.4d)**Fail** Battery insecure (1.9.1)**Advice** Offside Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt (2.5.C.1a)**Notice** Engine covers fitted obscuring some components in the engine bay**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Notice** Both rear suspension coil springs slightly corroded**Advice** Nearside Front Brake hose slightly deteriorated (3.6.B.4d)**Fail** Offside Front Tyre has ply or cords exposed (4.1.D.1b)**Advice** Nearside Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt (2.5.C.1a)**MOT #7** 2012-03-01 14:12**MOT test number** 417031162092**Result** ✓ Passed**MOT #6** 2011-03-29 15:52**MOT test number** 335588381082**Result** ✓ Passed

**MOT #5** 2011-03-22 15:58**MOT test number** 438621581075**Result** ✗ Failed**Advice** Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)**Notice** N/s/f o/s/f o/s/r tyres worn on edges**Fail** Nearside Outer Front constant velocity joint gaiter split (2.5.C.1a)**Advice** Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)**Fail** Nearside Stop lamp not working (1.2.1b)**Notice** N/s/f drop link has slight play at upper ball joint**MOT #4** 2010-09-01 10:31**MOT test number** 541754640275**Result** ✓ Passed**MOT #3** 2009-08-26 11:25**MOT test number** 951868639218**Result** ✓ Passed**Notice** Air con leak at rear**Advice** Nearside Front Macpherson strut has slight movement at the upper attachment (2.5.A.1c)**Advice** Offside Front Macpherson strut has slight movement at the upper attachment (2.5.A.1c)**MOT #2** 2008-08-27 14:52**MOT test number** 312010448272**Result** ✓ Passed**Notice** O/s and n/s front brake pads becoming low possibly on limit**Notice** Slight play in n/s front lower balljoint



MOT #1	2007-08-09 15:53
MOT test number	892821327206
Result	✓ Passed



Tax & MOT check

✕
Untaxed

Tax expired:
28 January 2021

✕
MOT

Expired:
12 October 2021

Tax status	Expired at 28 January 2021
Days left	1187 days too late
MOT expiry date	12 October 2021
Full MOT history	See MOT history

Tax calculation

Vehicle class	49
Band	J
Single payment (12 months)	£ 365,00,-
Single six month payment	£ 200,75,-
Total payable by 12 monthly instalments	£ 383,25,-



Damage history

Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this FORD? How many owners did this FORD have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****

More info >

Plate changes

See in this check if this FORD had different number plates.

Number of plates	1
Current registration	*****
Plate since	2019-09-29
Current registration	*****
Plate since	2019-09-29

More info >



Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FORD is financed.

Finance company	XXXXXXXX	XXXX
Date of agreement	XXXXXXXX	XXXX
Agreement type	XXXXXXXX	XXXX
Agreement term	XXXXXXXX	XXXX
Agreement number	XXXXXXXX	XXXX
Contact info	XXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	21
First mileage registration	2004-06-18
Last registration	2020-10-13
Complete history	See info



Registration #1	2004-06-18	26 mi
Registration #2	2007-08-09	36.004 mi
Registration #3	2008-08-27	46.205 mi
Registration #4	2009-08-26	52.205 mi
Registration #5	2010-09-01	58.200 mi
Registration #6	2011-03-22	62.695 mi
Registration #7	2011-03-29	62.702 mi
Registration #8	2012-03-01	80.138 mi
Registration #9	2013-04-08	102.102 mi
Registration #10	2013-04-09	102.106 mi
Registration #11	2014-03-24	118.504 mi
Registration #12	2015-03-20	131.377 mi
Registration #13	2016-03-20	145.377 mi
Registration #14	2017-03-20	159.377 mi
Registration #15	2018-03-20	173.377 mi
Registration #16	2019-03-20	187.377 mi
Registration #17	2020-03-20	201.377 mi
Registration #18	2021-03-20	215.377 mi
Registration #19	2022-03-20	229.377 mi
Registration #20	2023-03-20	243.377 mi
Registration #21	2024-03-20	257.377 mi

More info >



Car features

The FORD factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FORD factory list for this vehicle [here](#).

More info >

Dimensions & weight

Width	2142 mm
Height	1759 mm
Length	4642 mm
Wheel base	2835 mm
Kerb weight	1699 kg
Max. allowed weight	2510 kg

Additional information

Fuel tank capacity	70 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	7
Number of axles	2
Engine number	4R03345