



RENAULT




report date: 2024-03-29

General information

Make	RENAULT
Model	KANGOO I-MUSIC DCI
Colour	Blue
Year of manufacture	2010
Top speed	106 mph
0 - 60 mph	13.0 seconds
Gearbox	6 speed Manual

Engine & fuel consumption

Power	106 BHP
Max. torque	240 Nm at 2.000 rpm
Engine capacity	1.461 cc
Cylinders	4
Fuel type	Diesel
Consumption city	44.1 mpg
Consumption extra urban	56.5 mpg
Consumption combined	51.4 mpg
CO2 emission	146 g/km
CO2 label	F

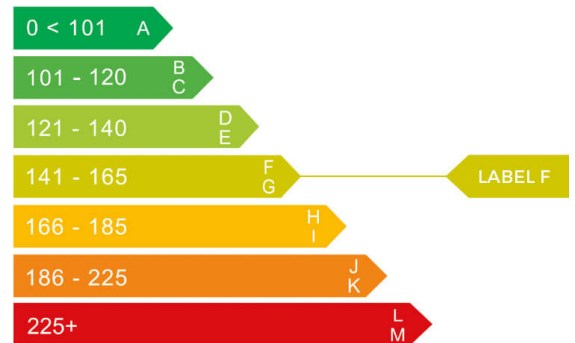



Internet history

Entry 1

Date	2021-09-08
Pictures	22
Listing price	View report



source: [autotrader.co.uk](https://www.autotrader.co.uk)



MOT history

MOT expiry date	2024-06-11
MOT pass rate	58 %
MOT passed	11
Failed MOT tests	8
Total advice items	62
Total items failed	41

MOT #19	2023-06-08 15:23
MOT test number	805419469961
Result	✓ Passed
Next expiry date	2024-06-11

MOT #18	2023-05-24 15:56
MOT test number	238226512548

Result	✗ Failed
--------	----------

- Fail** Nearside Stop lamp(s) not working (4.3.1 (a) (ii))
- Fail** Nearside Headlamp lens seriously defective (4.1.1 (b) (ii))
- Fail** Offside Front Coil spring fractured or broken (5.3.1 (b) (i))
- Fail** Offside Front Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
- Fail** Offside Front Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Fail** Offside Stop lamp(s) not working (4.3.1 (a) (ii))
- Fail** Offside Headlamp lens seriously defective (4.1.1 (b) (ii))
- Fail** Offside Front Lower Suspension arm pin or bush excessively worn front bush (5.3.4 (a) (i))

**MOT #17** 2022-06-10 15:39**MOT test number** 143737327018**Result** ✓ Passed**Advice** Passenger seat(s) missing at time of test folded down**Advice** Brake pipe corroded, covered in grease or other material covered in dirt (1.1.11 (c))**MOT #16** 2022-06-09 15:23**MOT test number** 665718759581**Result** ✗ Failed**Advice** Brake pipe corroded, covered in grease or other material covered in dirt (1.1.11 (c))**Advice** Passenger seat(s) missing at time of test folded down**Pass with rectification** Windscreen washer provides insufficient washer liquid (3.5 (a))**Fail** Offside Front Suspension arm ball joint excessively worn (5.3.4 (a) (i))**Fail** Rear fog lamp not working (4.5.1 (a) (ii))**MOT #15** 2021-06-12 08:09**MOT test number** 215689802096**Result** ✓ Passed**Minor** Nearside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))**Advice** Front Brake pipe corroded, covered in grease or other material underside of vehicle brake pipes corroded (1.1.11 (c))**Advice** Offside Rear fog lamp lens damaged**Advice** Nearside Rear Tyre slightly damaged/cracking or perishing perishing (5.2.3 (d) (ii))**MOT #14** 2020-06-17 12:35**MOT test number** 230611222458**Result** ✓ Passed

**MOT #13**

2020-06-16 08:17

MOT test number

419678359301

Result

✗ Failed

- Fail** Nearside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))
- Fail** Offside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Fail** Offside Rear Tyre has ply or cords exposed (5.2.3 (d) (ii))
- Fail** Offside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))
- Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))

MOT #12

2019-07-04 14:24

MOT test number

142756793952

Result

✓ Passed

- Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

MOT #11

2018-07-03 10:09

MOT test number

121594195362

Result

✓ Passed

- Advice** Nearside Rear Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))
- Advice** Fuel cap door, plastic panel insecure
- Advice** Nearside Rear Tyre wearing on the edges
- Advice** Various Brake Pipes slightly corroded
- Advice** Brake Pedal Anti -Slip slightly damaged
- Advice** Secondary Horn speaker insecure

**MOT #10**

2018-07-02 09:23

MOT test number

455556225362

Result**✗ Failed****Fail** Exhaust shield missing where fitted as original equipment creating a risk of fire (6.1.3 (e))**Advice** Secondary Horn speaker insecure**Fail** Nearside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))**Fail** Nearside Front Windscreen wiper does not clear the windscreen effectively Wiper adjustment incorrect, overlapping the windscreen (3.4 (b) (ii))**Advice** Various Brake Pipes slightly corroded**Fail** Electrical wiring insecure and connectors likely to become disconnected Insecure near brake pedal area (4.11 (a) (ii))**Fail** Nearside Rear Coil spring fractured or broken (5.3.1 (b) (i))**Advice** Fuel cap door, plastic panel insecure**Advice** Nearside Rear Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))**Fail** Offside Front Windscreen wiper does not clear the windscreen effectively Blade insecure (3.4 (b) (ii))**Advice** Nearside Rear Tyre wearing on the edges**Fail** Offside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))**Fail** Parking brake lever has excessive movement indicating incorrect adjustment (1.1.6 (c))**Fail** Offside Front Headlamp insecure (4.1.1 (c))**Advice** Brake Pedal Anti -Slip slightly damaged**Fail** Nearside Rear Brake pipe excessively corroded Over the axle (1.1.11 (c))

**MOT #9**

2017-07-14 13:11

MOT test number

703534695943

Result

✓ Passed

- Advice** Nearside Front Wiper rubber blade slightly split but still clearing screen effectively
- Advice** Offside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Advice** 2x Front Brake Discs corroded
- Advice** Offside Rear Shock absorber has a light misting of oil (2.7.3)
- Advice** Underbody Engine cover fitted
- Advice** Nearside Front Shock absorber has a light misting of oil (2.7.3)

MOT #8

2017-07-14 10:04

MOT test number

226495203243

Result

✗ Failed

- Advice** Offside Rear Shock absorber has a light misting of oil (2.7.3)
- Advice** Underbody Engine cover fitted
- Fail** Nearside Brake pipe excessively corroded Front to rear (3.6.B.2c)
- Fail** Fuel cap/sealing device mounting flange/sealing method defective Fuel Cap cannot be inspected due to the fuel cap door being jammed shut (7.2.4c)
- Advice** Nearside Front Shock absorber has a light misting of oil (2.7.3)
- Advice** Nearside Front Wiper rubber blade slightly split but still clearing screen effectively
- Fail** Offside Brake pipe excessively corroded Front to rear (3.6.B.2c)
- Advice** 2x Front brake discs corroded
- Fail** Nearside Front Track rod end ball joint has excessive play (2.2.B.1f)
- Advice** Offside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Fail** Offside Front Headlamp insecure (1.7.3)



MOT #7

2016-07-08 16:26

MOT test number

184186442341

Result

✓ Passed

- Advice

Offside Front tyre wearing on the edges
- Advice

Offside Rear brake disc worn, pitted or scored, but not seriously weakened slightly worn (3.5.1i)
- Advice

Brake disc worn, pitted or scored, but not seriously weakened 2x front slightly worn (3.5.1i)
- Advice

Brake pedal Anti-slip Provision is slightly damaged
- Advice

Nearside Rear tyre wearing on the edges
- Advice

Parking brake lever has little reserve travel (3.1.6b)
- Advice

Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Advice

Engine Cover fitted

**MOT #6**

2016-07-08 09:31

MOT test number

989303231752

Result**✗ Failed**

- Advice** Brake disc worn, pitted or scored, but not seriously weakened 2x front slightly worn (3.5.1i)
- Fail** Nearside Rear Stop lamp not working (1.2.1b)
- Advice** Brake pedal Anti-slip Provision is slightly damaged
- Advice** Offside Rear brake disc worn, pitted or scored, but not seriously weakened slightly worn (3.5.1i)
- Advice** Nearside Rear tyre wearing on the edges
- Fail** Brake pad(s) less than 1.5 mm thick 2x Rear inner sides worn (3.5.1g)
- Advice** Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Advice** Parking brake lever has little reserve travel (3.1.6b)
- Fail** Nearside Rear brake disc in such a condition that it is seriously weakened (3.5.1i)
- Advice** Engine Cover fitted
- Fail** Brake pad(s) less than 1.5 mm thick 2x front inner sides worn (3.5.1g)
- Advice** Offside Front tyre wearing on the edges
- Fail** Offside Front Suspension arm rubber bush deteriorated resulting in excessive movement (2.4.G.2)

MOT #5

2015-07-13 15:36

MOT test number

825584995173

Result**✓ Passed**

- Notice** Brake anti-slip provision slightly damaged
- Advice** Parking brake lever has little reserve travel (3.1.6b)
- Notice** Engine covers fitted obscuring some components in the engine bay
- Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

**MOT #4** 2015-07-13 15:36**MOT test number** 285434095116**Result** ✗ Failed**Advice** Parking brake lever has little reserve travel (3.1.6b)**Notice** Engine covers fitted obscuring some components in the engine bay**Pass with rectification** Nearside Front Headlamp aim too low (1.8)**Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Notice** Brake anti-slip provision slightly damaged**MOT #3** 2014-07-08 10:38**MOT test number** 125269284140**Result** ✓ Passed**Advice** Rear Tyre worn close to the legal limit (4.1.E.1)**MOT #2** 2013-07-11 15:34**MOT test number** 805422993149**Result** ✓ Passed



MOT #1	2013-07-11 11:01
MOT test number	817752093109
Result	✗ Failed
Fail	Nearside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)
Advice	Front Brake pad(s) wearing thin (3.5.1g)
Notice	Under-trays fitted obscuring some underside components
Fail	Offside rear brake binding (3.7.B.1)
Fail	Offside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)
Notice	Engine covers fitted obscuring some components in the engine bay
Fail	Nearside rear brake binding (3.7.B.1)



Tax & MOT check

✓
Taxed
Tax due:
1 January 2025

✓
MOT
Expires:
11 June 2024

Tax status	Valid until 1 January
Days left	246
MOT expiry date	11 June 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	49
Band	F
Single payment (12 months)	£ 200,00,-
Single six month payment	£ 110,00,-
Total payable by 12 monthly instalments	£ 210,00,-



Damage history

Check the damage history for this RENAULT. See if, where and when this RENAULT had damage and the car repair costs. We also check if this RENAULT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra RENAULT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this RENAULT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 10,000
Auction value	£ 10,000
Average private trade value	£ 10,000

More info >



Owner history

For how long did the current and previous owner(s) have this RENAULT? How many owners did this RENAULT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this RENAULT had different number plates.

Number of plates	1
Current registration	DA10TJX
Plate since	2019-03-29
Current registration	DA10TJX
Plate since	2019-03-29

More info >



Finance check

Check if this RENAULT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this RENAULT has been settled.

If not, and you buy this RENAULT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this RENAULT is financed.


Finance company	REDACTED	REDACTED
Date of agreement	REDACTED	REDACTED
Agreement type	REDACTED	REDACTED
Agreement term	REDACTED	REDACTED
Agreement number	REDACTED	REDACTED
Contact info	REDACTED	REDACTED

More info >



Mileage check

Odometer	In miles
Mileage registrations	20
First mileage registration	2010-07-15
Last registration	2023-06-08
Complete history	See info

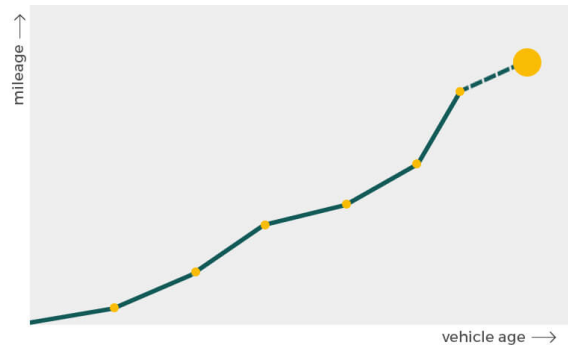

Registration #1	2010-07-15	27 mi
Registration #2	2013-07-11	23.665 mi
Registration #3	2013-07-11	23.669 mi
Registration #4	2014-07-08	34.620 mi
Registration #5	2015-07-13	44.766 mi
Registration #6	2016-07-08	55.685 mi
Registration #7	2016-07-08	55.688 mi
Registration #8	2017-07-14	63.233 mi
Registration #9	2017-07-14	63.237 mi
Registration #10	2018-07-02	70.225 mi
Registration #11	2019-06-20	75.277 mi
Registration #12	2019-06-20	75.277 mi
Registration #13	2019-06-20	75.277 mi
Registration #14	2019-06-20	75.277 mi
Registration #15	2019-06-20	75.277 mi
Registration #16	2019-06-20	75.277 mi
Registration #17	2019-06-20	75.277 mi
Registration #18	2019-06-20	75.277 mi
Registration #19	2019-06-20	75.277 mi
Registration #20	2019-06-20	75.277 mi

More info >



Car features

The RENAULT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete RENAULT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating

Video [see crash video](#)



Dimensions & weight

Width	2133 mm
Height	1898 mm
Length	4213 mm
Wheel base	2697 mm
Kerb weight	1430 kg
Max. allowed weight	1944 kg

Additional information

Fuel tank capacity	60 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	5

Number of axles	2
Engine number	D021922