



report date: 2024-03-28

General information

Make	VOLKSWAGEN
Model	FOX URBAN FOX
Colour	Black
Year of manufacture	2007
Top speed	92 mph
0 - 60 mph	17.5 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	55 BHP
Max. torque	108 Nm at 3.000 rpm
Engine capacity	1.198 cc
Cylinders	3
Fuel type	Petrol
Consumption city	36.2 mpg
Consumption extra urban	55.4 mpg
Consumption combined	46.3 mpg
CO2 emission	139 g/km
CO2 label	E






Internet history

Entry 1

Date	2021-11-18
Pictures	1
Listing price	View report

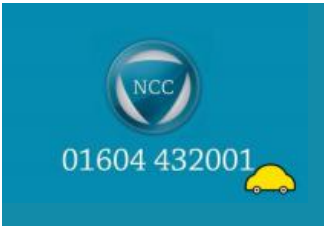

source: cargurus.co.uk



MOT history

MOT expiry date	2025-01-09
MOT pass rate	78 %
MOT passed	14
Failed MOT tests	4
Total advice items	41
Total items failed	21

MOT #18	2024-01-10 13:00
MOT test number	997360105086
Result	✓ Passed
Next expiry date	2025-01-09
Advice	Front Brake disc worn, pitted or scored, but not seriously weakened Both (1.1.14 (a) (ii))
Advice	Vehicle structure is corroded but structural rigidity is not significantly reduced (6.1.1 (c) (i))
Advice	Front Macpherson strut corroded but not seriously weakened Both (5.3.3 (b) (i))
Advice	Rear Tyre slightly damaged/cracking or perishing Both (5.2.3 (d) (ii))
Advice	Rear Coil spring corroded Both (5.3.1 (b) (i))
Advice	Front Vehicle structure or chassis corroded within 30cm of a mounting, but not seriously affecting overall security Subframe mounting areas (6.2.2 (d) (i))

**MOT #17**

2024-01-09 14:20

MOT test number

979447904166

Result**✗ Failed**

- Fail** Offside Front Coil spring fractured or broken (5.3.1 (b) (i))
- Advice** Vehicle structure is corroded but structural rigidity is not significantly reduced (6.1.1 (c) (i))
- Fail** Electronic power steering warning lamp indicates a system malfunction (2.6 (a))
- Advice** Front Brake disc worn, pitted or scored, but not seriously weakened Both (1.1.14 (a) (ii))
- Advice** Front Macpherson strut corroded but not seriously weakened Both (5.3.3 (b) (i))
- Fail** Exhaust emissions likely to be affected by an exhaust leak (8.2.1.1 (b))
- Fail** Headlamp has a product on the lens so that the light output is severely reduced Both (4.1.4 (b))
- Advice** Rear Coil spring corroded Both (5.3.1 (b) (i))
- Advice** Rear Tyre slightly damaged/cracking or perishing Both (5.2.3 (d) (ii))
- Advice** Front Vehicle structure or chassis corroded within 30cm of a mounting, but not seriously affecting overall security Subframe mounting areas (6.2.2 (d) (i))
- Fail** Exhaust has a major leak of exhaust gases (6.1.2 (a))
- Fail** Emissions unable to be completed (8.2.1.2 (d))

MOT #16

2022-03-23 10:33

MOT test number

299018611043

Result**✓ Passed**

- Advice** Advise nsr shockabsorber shroud loose
- Advice** Advise surface cracks in rear tyres

**MOT #15**

2022-03-04 13:14

MOT test number

659256455896

Result**✗ Failed**

- Fail** Offside Rear Service brake excessively binding (1.2.1 (f))
- Fail** Nearside Front Brake hose ferrule excessively corroded (1.1.12 (f) (i))
- Advice** Tyre worn close to legal limit/worn on edge both rears (5.2.3 (e))
- Fail** Nearside Rear Wheel bearing rough when rotated (5.1.3 (b) (i))
- Minor** Headlamp lens slightly defective both deteriorated (4.1.1 (b) (i))
- Fail** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))
- Advice** Power steering pipe/hose slightly corroded (2.1.5 (g) (i))
- Advice** Suspension arm corroded but not seriously weakened rear axle beam (5.3.3 (b) (i))
- Fail** Nearside Front Wheel bearing rough when rotated (5.1.3 (b) (i))
- Fail** Offside Front Brake hose ferrule excessively corroded (1.1.12 (f) (i))
- Minor** Fuel pipe chafing offside rear coil spring fouling fuel pipe (6.1.3 (c) (i))
- Fail** Nearside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))
- Advice** Front Brake disc worn, but not excessively (1.1.14 (a) (i))
- Advice** Brakes imbalanced requirements only just met. It would appear that the braking system requires adjustment or repair. rear foot brake (1.2.1 (b) (i))

MOT #14

2021-03-05 18:05

MOT test number

485746992084

Result**✓ Passed**

**MOT #13**

2021-02-24 15:44

MOT test number

945180772845

Result**✗ Failed**

Fail Nearside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))

Fail Offside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))

Fail Offside Front Position lamp not working (4.2.1 (a) (ii))

Advice Rear Registration plate deteriorated but not likely to be misread (0.1 (b))

Fail Offside Front Tyre has ply or cords exposed (5.2.3 (d) (ii))

Fail Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))

Fail Nearside Front Coil spring fractured or broken (5.3.1 (b) (i))

Fail Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))

MOT #12

2020-01-30 17:32

MOT test number

734222770891

Result**✓ Passed**

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

MOT #11

2020-01-30 17:32

MOT test number

482509800600

Result**✗ Failed**

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Pass with rectification Engine MIL inoperative or indicates a malfunction (8.2.1.2 (h))

**MOT #10** 2019-01-22 09:32**MOT test number** 443709002793**Result** ✓ Passed**Minor** Nearside Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))**Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))**MOT #9** 2018-01-31 09:58**MOT test number** 132760753307**Result** ✓ Passed**Advice** Front Brake pad(s) wearing thin (3.5.1g)**Advice** Rear registration plate deteriorated but not likely to be misread (6.3.1d)**Advice** Parking brake lever has little reserve travel (3.1.6b)**MOT #8** 2017-01-24 08:58**MOT test number** 632648380046**Result** ✓ Passed**MOT #7** 2016-02-01 16:33**MOT test number** 848436763883**Result** ✓ Passed**MOT #6** 2015-09-11 09:11**MOT test number** 515255090202**Result** ✓ Passed**Advice** Undertrays fitted not allowing full underside inspection**Advice** Exhaust corroded at rear

**MOT #5** 2014-09-30 15:03**MOT test number** 419413774299**Result** ✓ Passed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Notice** Nsr tyre cracked on inner and outer wall**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**Notice** Child seat fitted not allowing full inspection of adult belt**Notice** Osr rear tyre cracked on inner wall and outer wall**MOT #4** 2013-09-25 14:45**MOT test number** 736898163281**Result** ✓ Passed**Notice** Under-trays fitted obscuring some underside components**MOT #3** 2012-09-08 10:47**MOT test number** 619102152227**Result** ✓ Passed**Notice** Both rear tyres perished**Advice** Brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Notice** Front wishbone bushes splitting**MOT #2** 2011-09-03 10:51**MOT test number** 765636941267**Result** ✓ Passed**Notice** REAR TYRES PERISHED



MOT #1	2010-09-03 11:24
MOT test number	631246640260
Result	✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 January 2025

✓
MOT
Expires:
9 January 2025

Tax status	Valid until 1 January
Days left	247
MOT expiry date	9 January 2025
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	E
Single payment (12 months)	£ 180,00,-
Single six month payment	£ 99,00,-
Total payable by 12 monthly instalments	£ 189,00,-



Damage history

Check the damage history for this VOLKSWAGEN. See if, where and when this VOLKSWAGEN had damage and the car repair costs. We also check if this VOLKSWAGEN was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	



Damage 2

Date	
Category	
Type	



Extra VOLKSWAGEN salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this VOLKSWAGEN in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this VOLKSWAGEN? How many owners did this VOLKSWAGEN have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this VOLKSWAGEN had different number plates.

Number of plates	1
Current registration	 NU57PVW
Plate since	2019-06-29
Current registration	 NU57PVW
Plate since	2019-06-29

More info >



Finance check

Check if this VOLKSWAGEN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this VOLKSWAGEN has been settled.

If not, and you buy this VOLKSWAGEN then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this VOLKSWAGEN is financed.

Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	19
First mileage registration	2007-09-14
Last registration	2024-01-10
Complete history	See info



Registration #1	2007-09-14	6 mi
Registration #2	2010-09-03	22.360 mi
Registration #3	2011-09-03	30.553 mi
Registration #4	2012-09-08	39.317 mi
Registration #5	2013-09-25	46.419 mi
Registration #6	2014-09-30	54.136 mi
Registration #7	2015-09-11	59.041 mi
Registration #8	2016-02-01	59.895 mi
Registration #9	2017-01-24	67.322 mi
Registration #10	2018-01-31	75.178 mi
Registration #11	2019-01-01	75.178 mi
Registration #12	2020-01-01	75.178 mi
Registration #13	2021-01-01	75.178 mi
Registration #14	2022-01-01	75.178 mi
Registration #15	2023-01-01	75.178 mi
Registration #16	2024-01-10	75.178 mi
Registration #17	2024-01-10	75.178 mi
Registration #18	2024-01-10	75.178 mi
Registration #19	2024-01-10	75.178 mi

More info >



Car features

The VOLKSWAGEN factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete VOLKSWAGEN factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating

Video [see crash video](#)



Dimensions & weight

Width	1660 mm
Height	1544 mm
Length	3828 mm
Wheel base	2465 mm
Kerb weight	1069 kg
Max. allowed weight	1480 kg

Additional information

Fuel tank capacity	50 l
Fuel delivery	Multi-Point Injection
Number of doors	3

Number of seats	4
Number of axles	2
Engine number	BMD 375475