




report date: 2024-03-28

General information

Make	KIA
Model	SEDONA TS
Colour	Black
Year of manufacture	2007
Top speed	122 mph
0 - 60 mph	15.5 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	182 BHP
Max. torque	343 Nm at 4.500 rpm
Engine capacity	2.902 cc
Cylinders	4
Fuel type	Diesel
Consumption city	27.7 mpg
Consumption extra urban	44.1 mpg
Consumption combined	36.2 mpg
CO2 emission	206 g/km
CO2 label	K

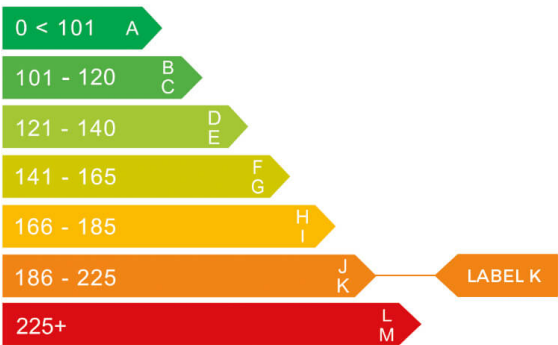



Internet history

Entry 1

Date	2021-09-19
Pictures	0
Listing price	<a href="#">View report</a>

source: [autotrader.co.uk](#)



MOT history

MOT expiry date	2024-12-11
MOT pass rate	53 %
MOT passed	9
Failed MOT tests	8
Total advice items	29
Total items failed	9

MOT #17	2023-12-12 17:21
MOT test number	421452361198
Result	✓ Passed
Next expiry date	2024-12-11
Minor	Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
Advice	Nearside Rear Coil spring corroded (5.3.1 (b) (i))
Advice	Offside Rear Service brake binding but not excessively (1.2.1 (f))
Advice	Offside Front Service brake binding but not excessively (1.2.1 (f))

**MOT #16**

2023-12-11 15:36

**MOT test number**

650835941023

**Result**

✗ Failed

- MAJOR** Offside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Advice** Offside Front Service brake binding but not excessively (1.2.1 (f))
- MAJOR** Front Windscreen washer provides insufficient washer liquid Both Sides (3.5 (a))
- MAJOR** Nearside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i))
- Advice** Offside Rear Service brake binding but not excessively (1.2.1 (f))
- MAJOR** Nearside Track rod end ball joint dust cover insecure so that it no longer prevents the ingress of dirt (2.1.3 (g) (ii))

**MOT #15**

2023-11-13 10:14

**MOT test number**

767962180730

**Result**

✗ Failed

- Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- MAJOR** Nearside Headlamp not working on main beam (4.1.1 (a) (ii))
- DANGEROUS** Nearside Rear Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- MAJOR** Windscreen washer not working (3.5 (a))

**MOT #14**

2022-11-17 10:36

**MOT test number**

388745595110

**Result**

✓ Passed

- Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i))

**MOT #13** 2021-11-19 11:47**MOT test number** 536118971146**Result** ✓ Passed**MOT #12** 2021-11-19 11:47**MOT test number** 313810465836**Result** ✗ Failed

**Pass with rectification** Fluid leak harmful to the environment or a risk to other road users water leak at rear, clip replaced (8.4.1 (a) (i))

**MOT #11** 2021-09-01 12:58**MOT test number** 392664740313**Result** ✓ Passed**MOT #10** 2021-08-27 07:29**MOT test number** 850631013087**Result** ✗ Failed

**MAJOR** Nearside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

**DANGEROUS** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))

**MAJOR** Offside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

**DANGEROUS** Offside Front Tyre has ply or cords exposed (5.2.3 (d) (ii))

**MOT #9** 2016-07-12 11:55**MOT test number** 920412040590**Result** ✓ Passed

**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)

**Advice** Nearside Front Lower Front suspension ball joint dust cover damaged, but preventing the ingress of dirt (2.4.G.2)

**MOT #8** 2016-07-12 10:33**MOT test number** 865534523762**Result** ✗ Failed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Fail** Offside Front Headlamp not working on dipped beam (1.7.5a)**Advice** Nearside Front Lower Front suspension ball joint dust cover damaged, but preventing the ingress of dirt (2.4.G.2)**MOT #7** 2015-07-08 12:54**MOT test number** 739839785151**Result** ✓ Passed**MOT #6** 2012-11-07 13:42**MOT test number** 396292512340**Result** ✓ Passed**MOT #5** 2012-10-10 13:11**MOT test number** 995634882206**Result** ✗ Failed**Fail** Offside Rear Stop lamp not working (1.2.1b)**Pass with rectification** Headlamp aim too low (1.8)**Fail** Front Windscreen wiper does not clear the windscreen effectively (8.2.2)**MOT #4** 2011-10-14 12:00**MOT test number** 775117981275**Result** ✓ Passed

**MOT #3** 2011-10-14 12:00**MOT test number** 439787581200**Result** ✗ Failed**Pass with rectification** Bonnet retaining device ineffective (8.4.2)**Pass with rectification** Offside Stop lamp not working (1.2.1b)**MOT #2** 2010-10-23 09:33**MOT test number** 583126590252**Result** ✓ Passed**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)**MOT #1** 2010-10-23 09:33**MOT test number** 302246390498**Result** ✗ Failed**Pass with rectification** Offside Front position lamp(s) not working (1.1.A.3b)**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Pass with rectification** Nearside Rear Stop lamp not working (1.2.1b)**Advice** Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)



Tax & MOT check

✓  
**Taxed**  
**Tax due:**  
1 May 2024

✓  
**MOT**  
**Expires:**  
11 December 2024

<b>Tax status</b>	Valid until 1 May
<b>Days left</b>	3
<b>MOT expiry date</b>	11 December 2024
<b>Full MOT history</b>	<a href="#">See MOT history</a>

Tax calculation

<b>Vehicle class</b>	49
<b>Band</b>	K
<b>Single payment (12 months)</b>	£ 395,00,-
<b>Single six month payment</b>	£ 217,25,-
<b>Total payable by 12 monthly instalments</b>	£ 414,75,-






Damage history

Check the damage history for this KIA. See if, where and when this KIA had damage and the car repair costs. We also check if this KIA was scrapped. Download the premium report [here](#) for the results.


Damage 1

Date	
Category	
Type	

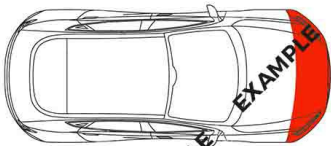

Damage 2

Date	
Category	
Type	

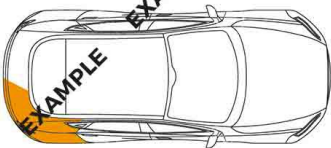

Extra KIA salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this KIA in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this KIA? How many owners did this KIA have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date

More info >

Plate changes

See in this check if this KIA had different number plates.

Number of plates	1
Current registration	YJ57RVL
Plate since	2019-03-28
Current registration	YJ57RVL
Plate since	2019-03-28

More info >



Finance check

Check if this KIA is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this KIA has been settled.

If not, and you buy this KIA then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this KIA is financed.


Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	17
First mileage registration	2007-11-02
Last registration	2023-12-12
Complete history	<a href="#">See info</a>

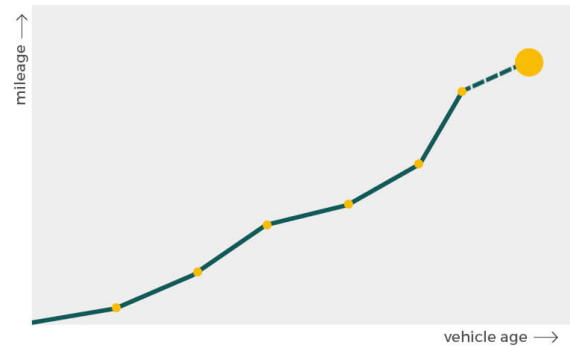

Registration #1	2007-11-02	14 mi
Registration #2	2010-10-23	33.077 mi
Registration #3	2011-10-14	42.001 mi
Registration #4	2012-10-10	50.764 mi
Registration #5	2012-11-07	51.390 mi
Registration #6	2015-07-08	54.877 mi
Registration #7	2016-07-12	58.690 mi
Registration #8	2016-07-12	58.690 mi
Registration #9	2021-08-27	59.944 mi
Registration #10	2023-12-12	59.944 mi
Registration #11	2023-12-12	59.944 mi
Registration #12	2023-12-12	59.944 mi
Registration #13	2023-12-12	59.944 mi
Registration #14	2023-12-12	59.944 mi
Registration #15	2023-12-12	59.944 mi
Registration #16	2023-12-12	59.944 mi
Registration #17	2023-12-12	59.944 mi

More info >



Car features

The KIA factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete KIA factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★☆

Video [see crash video](#)



Dimensions & weight

Width	1985 mm
Height	1815 mm
Length	4810 mm
Wheel base	2890 mm
Kerb weight	2168 kg
Max. allowed weight	2900 kg

Additional information

Fuel tank capacity	80 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	7

<b>Number of axles</b>	2
<b>Engine number</b>	J3763880