





report date: 2024-03-28

General information

Make	VOLKSWAGEN
Model	LT 35P/VLWBH/R108BHPTDI
Colour	Red
Year of manufacture	2005
Top speed	84 mph
Gearbox	5 speed Manual

Engine & fuel consumption

Power	108 BHP
Max. torque	250 Nm at 1.900 rpm
Engine capacity	2.461 cc
Cylinders	5
Fuel type	Diesel



CarCheck.co.uk page 1/14



MOT history

MOT expiry date	2021-03-19
MOT pass rate	63 %
MOT passed	12
Failed MOT tests	7
Total advice items	55
Total items failed	23

MOT #19		2020-03-18 16:35
MOT test	number	451662742812
Result		✓ Passed
Next expi	ry date	2021-03-19
Advice	Offside Front Wheel bearing has slight play (5.1.3 (a) (i))	
Advice	Coolant leak	
Advice	Oil leak, but not excessive (8.4.1 (a) (i))	
Advice	Slight play all front anti-roll bar bushes	
Advice	Nearside front tyre starting to perish and tread getting low : 3mm	
Advice	Nearside Front Wheel bearing has slight play (5.1.3 (a) (i))	

CarCheck.co.uk page 2/14



report date: 2024-03-28

MOT #18 2020-03-18 11:34

MOT test number 314807009431

Result × Failed

Advice Nearside front tyre starting to perish and tread getting low: 3mm

Fail Offside Front Outline marker lamp not working (4.2.1 (a) (ii))

Advice Oil leak, but not excessive (8.4.1 (a) (i))

Advice Nearside Front Wheel bearing has slight play (5.1.3 (a) (i))

Fail Nearside Rear Tyre has a bulge, caused by separation or partial failure of its structure Inner wall (5.2.3 (d) (ii))

Advice Slight play all front anti-roll bar bushes

Fail Parking brake efficiency below requirements (1.4.2 (a) (i))

Fail Offside Outline marker lamp not working Centre (4.2.1 (a) (ii))

Advice Coolant leak

Pass with rectification Offside Headlamp aim too high (4.1.2 (a))

Fail Brake load sensing valve seized and ABS not fitted or inoperative (1.1.17 (c) (ii))

Advice Offside Front Wheel bearing has slight play (5.1.3 (a) (i))

MOT #17 2019-03-19 11:56

MOT test number 402516097028

Result

Passed

Advice SLIGHT PLAY IN BOTH FRONT WHEEL BEARINGS

MOT #16 2019-03-19 11:56

MOT test number 591809719087

Result X Failed

Advice SLIGHT PLAY IN BOTH FRONT WHEEL BEARINGS

Pass with rectification Nearside Headlamp aim too high (4.1.2 (a))

CarCheck.co.uk page 3/14



report date: 2024-03-28

MOT #15

MOT test number

Result

Advice Parking brake lever ratchet mechanism is slightly worn (3.1.5)

 MOT #14
 2017-03-17 10:50

 MOT test number
 589584775783

 Result
 ✓ Passed

MOT test number

Result

Pass with rectification

Offside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)

Pass with rectification

Nearside Front Windscreen wiper does not clear the windscreen effectively (8.2.2)

MOT #12

MOT test number

463036685892

Result

Advice WARNING LIGHT FLASHING ON DASH

Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)

CarCheck.co.uk page 4/14



report date: 2024-03-28

MOT #11 2016-03-04 12:14

MOT test number 630074993838

Result X Failed

Fail Nearside Rear Registration plate lamp not working (1.1.C.1d)

Fail Nearside Rear Tyre(s) incorrect because a tyre fitted to a non-steerable driven axle is of a different type of structure from that fitted to another non-steerable driven axle (4.1.A.2d)

Fail Nearside Rear Stop lamp not working (1.2.1b)

Advice WARNING LIGHT FLASHING ON DASH

Fail Offside Rear Registration plate lamp not working (1.1.C.1d)

Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #10 2015-02-26 09:02

MOT test number 405897255065

Result \(\sqrt{Passed} \)

Notice Tail pipe corroded and in poor condition

Advice Offside Front Anti-roll bar has slight play in a pin/bush (2.4.G.2)

Notice Offside front tyre worn on inner edge and tread on legal limit of 1.6mm

Advice Offside Front wheel bearing has slight play (2.5.A.3c)

Notice Nearside rear tyre has slight damage to outer sidewall

Notice Front registration plate damaged

Advice Offside rear parking (secondary) brake grabbing slightly (3.7.B.6b)

Notice Oil leak

Advice Front Exhaust has a minor leak of exhaust gases (7.1.2)

Notice Nearside front tyre worn on inner, damage to outer sidewall and tread getting low : 3mm

CarCheck.co.uk page 5/14



report date: 2024-03-28

MOT #9 2015-02-25 12:02

MOT test number 518966655089

Result X Failed

Fail Nearside Rear Electrical wiring inadequately supported (1.9.2a)

Notice Tail pipe corroded and in poor condition

Advice Offside Front Anti-roll bar has slight play in a pin/bush (2.4.G.2)

Notice Offside front tyre worn on inner edge and tread on legal limit of 1.6mm

Advice Offside Front wheel bearing has slight play (2.5.A.3c)

Notice Nearside rear tyre has slight damage to outer sidewall

Fail Offside Registration plate lamp not working (1.1.C.1d)

Fail Brake load sensing valve seized (3.6.E.3)

Notice Front registration plate damaged

Advice Offside rear parking (secondary) brake grabbing slightly (3.7.B.6b)

Notice Oil leak

Advice Front Exhaust has a minor leak of exhaust gases (7.1.2)

Notice Nearside front tyre worn on inner, damage to outer sidewall and tread getting low: 3mm

Fail Nearside Registration plate lamp not working (1.1.C.1d)

Pass with rectification Offside Headlamp aim too high (1.8)

MOT #8 2014-03-04 15:05

MOT test number 107943164412

Result \(\sqrt{Passed} \)

Advice Nearside Parking brake: parking brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7)

Advice Offside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)

Advice Offside Front Brake pipe slightly corroded (3.6.B.2c)

CarCheck.co.uk page 6/14



report date: 2024-03-28

MOT #7 2014-02-26 16:04

MOT test number 476017554025

Result X Failed

Fail Front Brake cable has wires broken and is significantly weakened (3.5.1b)

Fail Parking brake: efficiency below requirements (3.7.B.7)

Advice Offside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)

Fail Windscreen washer provides insufficient washer liquid (8.2.3)

Fail Nearside Steering rack gaiter split (2.2.D.2d)

Advice Offside Front Brake pipe slightly corroded (3.6.B.2c)

Advice Rear Service brake: service brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7)

MOT #6 2013-02-26 15:35

MOT test number 437997153019

Result \(\sqrt{Passed} \)

Advice Offside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)

Advice Nearside Front suspension has slight play in a lower suspension ball joint (2.5.B.1a)

Advice Parking brake: parking brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7)

MOT #5 2012-03-20 14:09

MOT test number 908720882095

Result ✓ Passed

Advice Offside Front Suspension arm has slight play in a ball joint (2.4.G.2)

CarCheck.co.uk page 7/14



report date: 2024-03-28

MOT #4

MOT test number

Result

Advice Brake pad(s) wearing thin (3.5.1g)

Notice Front inbalance at maximum allowance of 25%

MOT #3

MOT test number

Result

Advice Brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

 MOT #2
 2008-11-07 14:49

 MOT test number
 822982818327

 Result
 ✓ Passed

MOT #1 2008-11-05 11:32
MOT test number 193900618317

Result × Failed

Advice Brakes imbalanced requirements only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.5b)

Notice Handbrake requires attention

Advice Brake load sensing valve linkage stiff (3.6.E.3)

Fail Parking brake: efficiency below requirements (3.7.B.7)

CarCheck.co.uk page 8/14



Tax & MOT check





Tax status Expired at 30 November 2020

Days left 1246 days too late

MOT expiry date 19 March 2021

Full MOT history See MOT history

CarCheck.co.uk page 9/14




Damage history

Check the damage history for this VOLKSWAGEN. See if, where and when this VOLKSWAGEN had damage and the car repair costs. We also check if this VOLKSWAGEN was scrapped. Download the premium report here for the results.

Damage 1

Date	
Category	
Туре	
Damage 2	
Date	
Category	

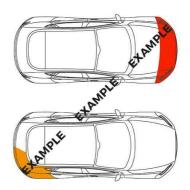

Extra VOLKSWAGEN salvage check



Type

If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 10/14



Owner history

For how long did the current and previous owner(s) have this VOLKSWAGEN? How many VOLKSWAGEN have? Check it in the premium report and see all owner registrations. Dow here.	

,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	

Plate changes	More info >
See in this check if this VOLKSWAGEN had different number plates.	
Number of plates	,
Current registration	OK SIE
Plate since	
Current registration	OK SIE
Plate since	
	More info >

CarCheck.co.uk page 11/14



Finance check

Check if this VOLKSWAGEN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this VOLKSWAGEN has been settled.

If not, and you buy this VOLKSWAGEN then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this VOLKSWAGEN is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

Contact info

More info >

CarCheck.co.uk page 12/14



report date: 2024-03-28

Mileage check

Odometer	In miles
Mileage registrations	20
First mileage registration	2005-10-05
Last registration	2020-03-18
Complete history	See info



Registration #1	2005-10-05	10 mi
Registration #2	2008-11-05	24.930 mi
Registration #3	2008-11-07	24.935 mi
Registration #4	2010-01-21	33.851 mi
Registration #5	2011-01-19	45.564 mi
Registration #6	2012-03-20	71.375 mi
Registration #7	2013-02-26	102.822 mi
Registration #8	2014-02-26	140.042 mi
Registration #9	2014-03-04	140.044 mi
Registration #10	2015-02-25	151.051 mi
Registration #11		9.70 es
Registration #12		71.777 es
Registration #13		9.70 es
Registration #14		71.777 es
Registration #15		9.70 es
Registration #16		71.777 es
Registration #17		9.70 es
Registration #18		11.777 es
Registration #19		11.777 es
Registration #20		11.777 au

More info >

CarCheck.co.uk page 13/14



Car features

\$0295 \$0482 \$0501 \$0566	
60501	
0566	
0567	
60569	

Additional information

Fuel tank capacity	75 I
Fuel delivery	Direct Injection
Number of doors	4
Number of seats	3
Engine number	AVR 051377

CarCheck.co.uk page 14/14