





report date: 2024-03-29

General information

Make	LAND ROVER
Model	DEFENDER P/U
Colour	Green
Year of manufacture	2008
Gearbox	6 speed Manual

Engine & fuel consumption

Power	121 BHP
Max. torque	360 Nm at 2.000 rpm
Engine capacity	2.402 cc
Cylinders	4
Fuel type	Diesel
Consumption city	21.2 mpg
Consumption extra urban	32.8 mpg
Consumption combined	27.4 mpg



CarCheck.co.uk page 1/15



Internet history

Entry 1

Date 2022-01-17

Pictures 59

Listing price <u>View report</u>









source: autotrader.co.uk

CarCheck.co.uk page 2/15



AU58XYT

report date: 2024-03-29

MOT history

MOT expiry date	2024-03-07
MOT pass rate	60 %
MOT passed	12
Failed MOT tests	8
Total advice items	22
Total items failed	33

MOT #20	2023-03-08 08:17
MOT test number	604976854746
Result	✓ Passed
Next expiry date	2024-03-07

MOT #19	2022-01-06 08:48
MOT test number	507735782486
Result	✓ Passed
Advice Offside Rear Bump stop is missing	

MOT #18	2020-12-09 19:10
MOT test number	885978368121
Result	✓ Passed
Minor Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))	

CarCheck.co.uk page 3/15



MOT #17 2020-12-07 10:21

MOT test number 564611824249

Result X Failed

Minor Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))

Fail Nearside Front Lower Suspension arm pin or bush excessively worn (5.3.4 (a) (i))

Fail Offside Front Axle swivel joint so worn or insecure in a stub axle that directional stability is impaired (5.1.2 (b) (ii))

Fail Offside Steering linkage ball joint has excessive play (2.1.3 (b) (i))

Fail Offside Rear Direction indicator incorrect colour (4.4.3 (a))

Fail Offside Front Brake pipe excessively corroded Cross (1.1.11 (c))

MOT #16 2019-12-11 16:59

MOT test number 225237240513

Result
✓ Passed

Advice Offside Rear Bump stop is missing

MOT #15 2019-12-10 11:34

MOT test number 479301296166

Result × Failed

Fail Front Suspension rod pin or bush excessively worn (5.3.4 (a) (i))

Fail Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))

Advice Offside Rear Bump stop is missing

Fail Front Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))

MOT #14 2018-11-21 11:33

MOT test number 663702530138

Result \(\sqrt{Passed}\)

Advice Offside Rear Bump stop is missing

CarCheck.co.uk page 4/15



AU58XYT

report date: 2024-03-29

MOT #13 2018-11-20 08:11 **MOT** test number 630456175890 Result **X** Failed Fail Shock absorbers has an excessively worn bush Both rear (5.3.2 (c)) Fail Parking brake lever has excessive movement indicating incorrect adjustment (1.1.6 (c)) Stop lamp(s) all not working (4.3.1 (a) (iii)) Fail Offside Rear Brake pipe excessively corroded Axle (1.1.11 (c)) Fail **Advice** Offside Rear Bump stop is missing

MOT #12

MOT test number

891077284370

Result

Advice Offside Rear Bump stop is missing

MOT #11 2016-11-30 14:12

MOT test number 285028386099

Result ✓ Passed

MOT #10

MOT test number

546113126070

Result

X Failed

Fail Offside Rear fog lamp not working (1.3.2b)

Fail Drag link end ball joint has excessive play Steering box arm joint (2.2.B.1f)

Fail Headlamp switch faulty (1.7.1)

Fail Rear Brake pad(s) less than 1.5 mm thick (3.5.1g)

Advice Nearside Rear wheel bearing has slight play (2.6.2)

Fail Nearside Front position lamp(s) not working (1.1.A.3b)

CarCheck.co.uk page 5/15



Fail

Steering system excessively tight (2.2.D.1)

AU58XYT

report date: 2024-03-29

MOT #9 2015-12-11 14:11 **MOT test number** 974433627133 Result ✓ Passed MOT #8 2015-12-09 10:17 **MOT** test number 291687330342 Result × Failed Fail Brake pipe excessively corroded Front to rear (3.6.B.2c) Fail Nearside Front Track rod end ball joint has excessive play (2.2.B.1f) Fail Brake fluid warning lamp illuminated (3.6.G.2) Offside rear mud flap is adrift **Advice** Fail Offside Headlamp insecure (1.7.3) Fail Shock absorber has an excessively worn bush Both rear lower bushes (2.7.4)

MOT #7	2014-08-11 17:58
MOT test number	935553824200
Result	✓ Passed
Notice Off side rear brake pipe corroding	
Notice Poor reservetravel on handbrake	

CarCheck.co.uk page 6/15



AU58XYT

report date: 2024-03-29

MOT #6 2014-07-21 18:12 948372104299 **MOT** test number Result × Failed Fail Offside Front Track rod end ball joint has excessive play (2.2.B.1f) Notice Corrosion starting on off mside rear brake pipe Fail Registration plate lamp not working (1.1.C.1d) Offside Front Lower Shock absorber has an excessively worn bush (2.7.4) Fail Fail Nearside Stop lamp not working (1.2.1b) Notice Poor reserve travel on hand brake Fail Nearside Rear Lower Shock absorber has an excessively worn bush (2.7.4)

MOT test number

Result

Notice Corrosion starting on rear brake pipes

Notice Slight movement in rear lower shogk absorber bushes

Advice Front registration plate deteriorated but not likely to be misread (6.3.1d)

MOT test number
999935753252

Result
Notice Corrosion starting on rear brake pipes
Advice Front registration plate deteriorated but not likely to be misread (6.3.1d)

Notice Slight movement in rear lower shogk absorber bushes

Pass with rectification Offside Headlamp aim too high (1.8)

CarCheck.co.uk page 7/15



Pass with rectification

Result

AU58XYT
report date: 2024-03-29

X Failed

MOT #3 2012-09-13 17:57

MOT test number 739687452296

Result ✓ Passed

Notice Corrosion starting on rear metal brake pipe

MOT #2 2012-09-13 17:57

MOT test number 257507252261

Pass with rectification Offside Rear Shock absorber has an excessively worn bush (2.7.4)

Pass with rectification Nearside Rear Shock absorber has an excessively worn bush (2.7.4)

Nearside Headlamp aim too high (1.8)

Notice Corrosion starting on rear metal brake pipe

Pass with rectification Offside Headlamp aim too high (1.8)

MOT #1 2011-09-01 14:10

MOT test number 509774641249

CarCheck.co.uk page 8/15



Tax & MOT check



X MOTExpired:
7 March 2024

Tax status Expired at 20 August 2021

Days left 983 days too late

MOT expiry date 7 March 2024

Full MOT history See MOT history

CarCheck.co.uk page 9/15



Damage history

Check the damage history for this LAND ROVER. See if, where and when this LAND ROVER had damage and the car repair costs. We also check if this LAND ROVER was scrapped. Download the premium report here for the results.

Damage 1

Date
Category

Туре

Damage 2

Date

Category

Type



Extra LAND ROVER salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 10/15



Vehicle valuation

What is this car worth? See the vehicle value of this LAND ROVER in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 11/15



Owner history

Owner history	
For how long did the current and previous owner(s) have this LAND ROVER? How many or ROVER have? Check it in the premium report and see all owner registrations. Download to	
THE PARTY OF THE P	

	More info >
Plate changes	
See in this check if this LAND ROVER had different number plates.	
Number of plates	,
Current registration	UK NIE.
Plate since	
Current registration	UK NE
Plate since	
	More info >

CarCheck.co.uk page 12/15



Finance check

Check if this LAND ROVER is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this LAND ROVER has been settled.

If not, and you buy this LAND ROVER then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this LAND ROVER is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

Contact info


More info >

CarCheck.co.uk page 13/15



Mileage check

Odometer	In miles
Mileage registrations	20
First mileage registration	2008-09-16
Last registration	2023-03-08
Complete history	See info

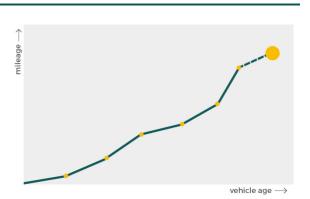

Registration #1	2008-09-16	27 mi
Registration #2	2011-09-01	36.811 mi
Registration #3	2012-09-13	45.566 mi
Registration #4	2013-09-12	51.949 mi
Registration #5	2014-07-21	56.858 mi
Registration #6	2014-08-11	57.433 mi
Registration #7	2015-12-09	65.564 mi
Registration #8	2015-12-11	65.565 mi
Registration #9	2016-11-29	71.423 mi
Registration #10	2016-11-30	71.423 mi
Registration #11		11.777 es
Registration #12		11.777 es
Registration #13		11.777 es
Registration #14		77,777 46
Registration #15		9.777 es
Registration #16		11.777 es
Registration #17		9.777 es
Registration #18		0.00 44
Registration #19		11.777 es
Registration #20		11.777 es

More info >

CarCheck.co.uk page 14/15



Dimensions & weight

Width	1790 mm
Height	1968 mm
Length	3649 mm
Kerb weight	1705 kg
Max. allowed weight	2400 kg

Additional information

Fuel tank capacity	60 I
Fuel delivery	Direct Injection
Number of doors	2
Number of seats	3
Number of axles	2
Engine number	80510035842244D

CarCheck.co.uk page 15/15