




report date: 2024-03-29

General information

Make	VOLKSWAGEN
Model	PASSAT GTI EDITION30 T 230
Colour	Silver
Year of manufacture	2009
Top speed	150 mph
0 - 60 mph	6.8 seconds
Gearbox	6 speed Manual

Engine & fuel consumption

Power	227 BHP
Max. torque	300 Nm at 2.200 rpm
Engine capacity	1.984 cc
Cylinders	4
Fuel type	Petrol
Consumption city	25.0 mpg
Consumption extra urban	44.1 mpg
Consumption combined	34.4 mpg
CO2 emission	194 g/km
CO2 label	J

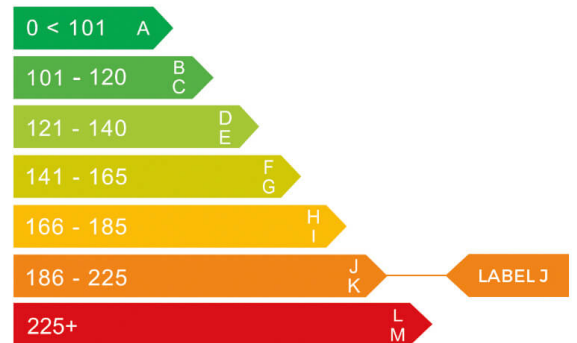




Internet history

Entry 1

Date	2021-02-06
Pictures	5
Listing price	View report

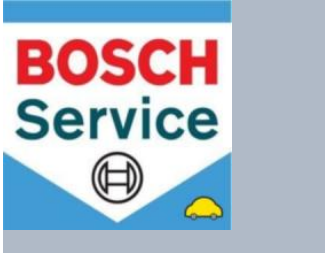

source: autoonline.co.uk



MOT history

MOT expiry date	2024-12-09
MOT pass rate	63 %
MOT passed	12
Failed MOT tests	7
Total advice items	47
Total items failed	17

MOT #19 2023-11-30 13:33

MOT test number 836584033288

Result ✓ Passed

Next expiry date 2024-12-09

- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))

MOT #18 2023-11-30 09:07

MOT test number 963886858867

Result ✗ Failed

- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Nearside Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Fail** Offside Rear Fuel cap/sealing device ineffective (6.1.3 (b) (i))
- Advice** Rear Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Offside Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Minor** Offside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))

**MOT #17**

2022-11-23 13:54

MOT test number

755261594578

Result

✓ Passed

Minor

Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Advice

Offside Front Tyre slightly damaged outer sidewall (5.2.3 (d) (ii))

MOT #16

2022-11-23 09:56

MOT test number

418004039241

Result

✗ Failed

Fail

Offside Front Side repeater light intensity significantly reduced (4.4.3 (a))

Advice

Offside Front Tyre slightly damaged outer sidewall (5.2.3 (d) (ii))

Minor

Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

MOT #15

2021-12-10 13:50

MOT test number

893741275112

Result

✓ Passed

Advice

Full under covers fitted obscuring some components

MOT #14

2021-12-03 13:38

MOT test number

317297389858

Result

✗ Failed

Minor

Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Fail

Nearside Direction indicator adversely affected by the operation of another lamp when indicating left both warning lights flashing together (4.4.3 (b))

Advice

Full under covers fitted obscuring some components

**MOT #13**

2020-11-26 17:45

MOT test number

488914293341

Result

✓ Passed

Advice Nearside Front Tyre worn close to legal limit/worn on edge on inner edge 1mm to bald (5.2.3 (e))**Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened both rear discs and pads wearing low (1.1.14 (a) (ii))**Advice** Offside Front Steering linkage ball joint has slight play rack end inner ball joint slight play (2.1.3 (b) (i))**Advice** Offside Front Tyre worn close to legal limit/worn on edge worn on inner edge 2mm (5.2.3 (e))**MOT #12**

2020-11-12 11:08

MOT test number

596584520307

Result

✗ Failed

Advice Offside Front Steering linkage ball joint has slight play rack end inner ball joint slight play (2.1.3 (b) (i))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge on inner edge 1mm to bald (5.2.3 (e))**Fail** Offside Rear Coil spring fractured or broken (5.3.1 (b) (i))**Advice** Front Brake disc worn, pitted or scored, but not seriously weakened both front discs (1.1.14 (a) (ii))**Fail** Central Rear Exhaust has a major leak of exhaust gases silencer before axle corroded and holed/cracked (6.1.2 (a))**Fail** Offside Front Coil spring fractured or broken and top mount collapsed (5.3.1 (b) (i))**Fail** Offside Front Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt outer gaitor (6.1.7 (g) (ii))**Advice** Offside Front Tyre worn close to legal limit/worn on edge worn on inner edge 2mm (5.2.3 (e))**Fail** Offside Front Service brake excessively binding (1.2.1 (f))**Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened both rear discs and pads wearing low (1.1.14 (a) (ii))



MOT #11 2019-11-01 10:51

MOT test number 842061117725

Result ✓ Passed

- Advice** Rear Brake pad(s) wearing thin both sides (1.1.13 (a) (ii))
- Advice** Front Service brake fluctuating, but not excessively both sides (1.2.1 (e))
- Advice** Exhaust heat shield insecure
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened both sides (1.1.14 (a) (ii))
- Advice** Offside Front Play in steering rack inner joint(s)
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Rear Exhaust has a minor leak of exhaust gases (6.1.2 (a))

**MOT #10**

2019-10-29 14:02

MOT test number

172275679912

Result**✗ Failed**

- Fail** Offside Front Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened both sides (1.1.14 (a) (ii))
- Fail** Offside Rear Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))
- Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Advice** Rear Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Fail** Nearside Front Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))
- Fail** Nearside Rear Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))
- Advice** Rear Brake pad(s) wearing thin both sides (1.1.13 (a) (ii))
- Fail** Offside Front Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))
- Fail** Offside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Advice** Nearside Front Outer Tyre has a cut but not deep enough to reach the ply or cords (5.2.3 (d) (i))
- Advice** Exhaust heat shield insecure
- Advice** Offside Front Outer Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))
- Advice** Front Service brake fluctuating, but not excessively both sides (1.2.1 (e))
- Advice** Offside Front Play in steering rack inner joint(s)

MOT #9

2018-09-15 09:23

MOT test number

604834941173

Result**✓ Passed**

**MOT #8** 2018-09-14 13:06**MOT test number** 543190973186**Result** ✗ Failed**Fail** Front Brakes imbalanced across an axle (1.2.1 (b) (i))**MOT #7** 2017-06-01 08:16**MOT test number** 250723600168**Result** ✓ Passed**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**MOT #6** 2017-06-01 08:16**MOT test number** 696706658575**Result** ✗ Failed**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**Pass with rectification** Front registration plate faded (6.3.1d)**MOT #5** 2016-05-26 08:29**MOT test number** 501692369164**Result** ✓ Passed**Advice** Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)**Advice** Front registration plate deteriorated but not likely to be misread (6.3.1d)**Advice** Nearside Rear Tyre worn close to the legal limit wearing edge (4.1.E.1)**MOT #4** 2015-05-12 09:50**MOT test number** 506142035129**Result** ✓ Passed



MOT #3	2014-05-26 11:42
MOT test number	799066144170
Result	✓ Passed
MOT #2	2013-05-22 11:27
MOT test number	838602743182
Result	✓ Passed
MOT #1	2012-05-31 11:41
MOT test number	807542152187
Result	✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 December 2024

✓
MOT
Expires:
9 December 2024

Tax status	Valid until 1 December
Days left	215
MOT expiry date	9 December 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	J
Single payment (12 months)	£ 365,00,-
Single six month payment	£ 200,75,-
Total payable by 12 monthly instalments	£ 383,25,-



Damage history

Check the damage history for this VOLKSWAGEN. See if, where and when this VOLKSWAGEN had damage and the car repair costs. We also check if this VOLKSWAGEN was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra VOLKSWAGEN salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this VOLKSWAGEN in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this VOLKSWAGEN? How many owners did this VOLKSWAGEN have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****

More info >

Plate changes

See in this check if this VOLKSWAGEN had different number plates.

Number of plates	1
Current registration	*****
Plate since	2024-03-29
Current registration	*****
Plate since	2024-03-29

More info >



Finance check

Check if this VOLKSWAGEN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this VOLKSWAGEN has been settled.

If not, and you buy this VOLKSWAGEN then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this VOLKSWAGEN is financed.

Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	21
First mileage registration	2009-05-25
Last registration	2023-11-30
Complete history	See info



Registration #1	2009-05-25	7 mi
Registration #2	2012-05-31	17.703 mi
Registration #3	2013-05-22	26.996 mi
Registration #4	2014-05-26	36.410 mi
Registration #5	2015-05-12	45.878 mi
Registration #6	2016-05-26	53.910 mi
Registration #7	2017-06-01	62.476 mi
Registration #8	2017-06-01	62.476 mi
Registration #9	2018-09-14	79.957 mi
Registration #10	2018-09-15	79.957 mi
Registration #11	2019-10-29	98.823 mi
Registration #12	2020-05-29	115.277 mi
Registration #13	2020-05-29	115.277 mi
Registration #14	2020-05-29	115.277 mi
Registration #15	2020-05-29	115.277 mi
Registration #16	2020-05-29	115.277 mi
Registration #17	2020-05-29	115.277 mi
Registration #18	2020-05-29	115.277 mi
Registration #19	2020-05-29	115.277 mi
Registration #20	2020-05-29	115.277 mi
Registration #21	2020-05-29	115.277 mi

More info >



Car features

The VOLKSWAGEN factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete VOLKSWAGEN factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating	★★★★★
Adult	97%
Children	84%
Pedestrian	61%
Safety systems	71%
Overall rating	85%
Video	see crash video



Dimensions & weight

Width	1759 mm
Height	1469 mm
Length	4216 mm
Wheel base	2578 mm
Max. allowed weight	1900 kg

Additional information

Fuel tank capacity	55 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	5

Number of axles

2

Engine number

W6129009