



PEUGEOT



report date: 2024-03-29

General information

Make	PEUGEOT
Model	EXPERT L1 H1 HDI SWB P/V
Colour	White
Year of manufacture	2007
Gearbox	5 speed Manual

Engine & fuel consumption

Power	89 BHP
Max. torque	180 Nm at 1.750 rpm
Engine capacity	1.560 cc
Cylinders	4
Fuel type	Diesel
Consumption city	33.6 mpg
Consumption extra urban	42.8 mpg
Consumption combined	42.8 mpg



LABEL UNKNOWN



Internet history

Entry 1

Date	2021-10-25
Pictures	11
Listing price	View report



source: cargurus.co.uk



MOT history

MOT expiry date	2024-10-16
MOT pass rate	64 %
MOT passed	14
Failed MOT tests	8
Total advice items	64
Total items failed	29

MOT #22	2023-10-17 11:49
MOT test number	788462113873
Result	✓ Passed
Next expiry date	2024-10-16
Minor	Offside Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))
Advice	Oil leak, but not excessive (8.4.1 (a) (i))
Minor	Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))

MOT #21	2022-08-15 11:14
MOT test number	302823729860
Result	✓ Passed
Advice	Rear Exhaust has a minor leak of exhaust gases (6.1.2 (a))
Minor	Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
Advice	Oil leak, but not excessive (8.4.1 (a) (i))
Advice	Front Brake pad(s) wearing thin (1.1.13 (a) (ii))
Advice	Offside Front Service brake fluctuating, but not excessively (1.2.1 (e))
Advice	Rear Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))
Minor	Nearside Lower Obligatory mirror slightly damaged (3.3 (b) (i))
Advice	Nearside Front Service brake fluctuating, but not excessively (1.2.1 (e))

**MOT #20** 2021-08-18 18:12**MOT test number** 470932564457**Result** ✓ Passed**Advice** Power steering pipe/hose has slight seepage (2.1.5 (a))**MOT #19** 2021-08-11 15:25**MOT test number** 467477052097**Result** ✗ Failed**Fail** Nearside Front Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))**Advice** Power steering pipe/hose has slight seepage (2.1.5 (a))**Fail** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))**MOT #18** 2020-10-26 16:42**MOT test number** 785466581091**Result** ✓ Passed**Advice** Oil leak, but not excessive engine (8.4.1 (a) (i))**Advice** Power steering component has slight seepage from a component (2.1.5 (a))**Minor** Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

**MOT #17**

2019-10-23 09:48

MOT test number

454923126882

Result

✓ Passed

- Advice** Nearside Lower Non obligatory mirror damaged mirror glass missing
- Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Power steering component has slight seepage from a component rack (2.1.5 (a))
- Advice** Rear Tyre worn close to legal limit/worn on edge both (5.2.3 (e))
- Advice** Rear Coil spring corroded both (5.3.1 (b) (i))

MOT #16

2019-10-22 15:19

MOT test number

625216832858

Result

✗ Failed

- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Rear Tyre worn close to legal limit/worn on edge both (5.2.3 (e))
- Fail** Nearside Front Brake hose excessively damaged (1.1.12 (b) (ii))
- Advice** Nearside Lower Non obligatory mirror damaged mirror glass missing
- Fail** Nearside Front Position lamp not working (4.2.1 (a) (ii))
- Advice** Power steering component has slight seepage from a component rack (2.1.5 (a))
- Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Rear Coil spring corroded both (5.3.1 (b) (i))
- Fail** Front Windscreen washer provides insufficient washer liquid (3.5 (a))

**MOT #15** 2018-09-21 11:48**MOT test number** 717653465169**Result** ✓ Passed

- Minor** Power steering fluid level below minimum (2.1.5 (b) (i))
- Minor** Nearside Obligatory mirror slightly damaged lower glass missing (3.3 (b) (i))
- Advice** Offside Direction indicator slightly discoloured (4.4.3 (a))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Minor** Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Front Brake pad(s) wearing thin 5mm inner (1.1.13 (a) (ii))
- Advice** Brake hydraulic reservoir close to minimum mark (1.1.10 (d) (i))
- Advice** Power steering component has slight seepage from a component rack (2.1.5 (a))

MOT #14 2017-09-23 12:14**MOT test number** 680815033802**Result** ✓ Passed**MOT #13** 2017-09-23 06:37**MOT test number** 296807867555**Result** ✗ Failed

- Pass with rectification** Front Windscreen wiper does not clear the windscreen effectively (8.2.2)
- Fail** Nearside Front front parking (secondary) brake grabbing severely (3.7.B.6b)
- Fail** Offside Rear Direction indicator not working (1.4.A.2c)
- Fail** Offside Front Outer Front constant velocity joint is insecure (2.5.C.1b)



MOT #12	2016-10-18 15:22
MOT test number	731827074913
Result	✓ Passed
Advice	Engine covered in fluid

MOT #11	2016-10-18 15:22
MOT test number	931382064019
Result	✗ Failed
Pass with rectification	Centre Stop lamp not working (1.2.1b)
Pass with rectification	Nearside Registration plate lamp not working (1.1.C.1d)
Advice	Engine covered in fluid

MOT #10	2015-10-23 10:55
MOT test number	918365266084
Result	✓ Passed

MOT #9	2015-10-22 14:44
MOT test number	708078519094
Result	✗ Failed
Fail	Brake pedal has insufficient reserve movement (3.3.A.5)
Fail	Offside Registration plate lamp not working (1.1.C.1d)
Fail	Offside Front Front position lamp(s) not working (1.1.A.3b)
Fail	Parking brake lever has no reserve travel (3.1.6b)
Fail	Nearside Front Front position lamp(s) not working (1.1.A.3b)



MOT #8 2014-10-31 09:13

MOT test number 659044404305

Result ✓ Passed

- Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)
- Advice** Offside Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)
- Advice** Nearside Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

MOT #7 2013-09-25 14:25

MOT test number 717338763298

Result ✓ Passed

- Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)
- Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)

**MOT #6**

2013-09-18 09:35

MOT test number

379501263206

Result**✗ Failed**

- Fail** Offside Rear Direction indicator incorrect colour (1.4.A.2f)
- Fail** Nearside Headlamp not working on dipped beam (1.7.5a)
- Fail** Rear Exhaust system not adequately supported (7.1.1)
- Fail** Power steering fluid level below minimum (2.3.1)
- Advice** Nearside Front Anti-roll bar rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Fail** Centre Stop lamp not working (1.2.1b)
- Notice** Coolant on min
- Fail** Nearside Rear Direction indicator incorrect colour (1.4.A.2f)
- Fail** Front Exhaust has a major leak of exhaust gases (7.1.2)
- Fail** Power steering component(s) leaking from a failed seal (2.3.3b)
- Advice** Front Exhaust has a minor leak of exhaust gases (7.1.2)
- Fail** Offside Stop lamp not working (1.2.1b)
- Notice** Oil leak
- Advice** Offside Front Anti-roll bar rubber bush deteriorated but not resulting in excessive movement (2.4.G.2)
- Fail** Nearside Windscreen wiper does not clear the windscreen effectively (8.2.2)
- Notice** Engine oil near min

**MOT #5** 2012-10-30 16:03**MOT test number** 875994102393**Result** ✓ Passed

- Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)
- Advice** Nearside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)
- Advice** Offside Rear Direction indicator slightly discoloured (1.4.A.2f)

MOT #4 2012-10-30 16:03**MOT test number** 257934702320**Result** ✗ Failed

- Advice** Nearside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Pass with rectification** Nearside Headlamp aim too high (1.8)
- Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)
- Advice** Offside Rear Direction indicator slightly discoloured (1.4.A.2f)
- Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #3 2011-10-26 16:11**MOT test number** 339459891225**Result** ✓ Passed

**MOT #2**

2011-10-26 12:47

MOT test number

865099091223

Result**✗ Failed****Fail**

Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)

Notice

Spare trye flat and damaged

Advice

Offside Front Tyre worn close to the legal limit (4.1.E.1)

Fail

Centre Stop lamp not working (1.2.1b)

Advice

Nearside Front Tyre worn close to the legal limit (4.1.E.1)

Advice

Front Brake pad(s) wearing thin (3.5.1g)

MOT #1

2010-10-29 17:16

MOT test number

724292800338

Result**✓ Passed**



Tax & MOT check

✕
Untaxed

Tax expired:
31 January 2024

✓
MOT

Expires:
16 October 2024

Tax status	Expired at 31 January 2024
Days left	88 days too late
MOT expiry date	16 October 2024
Full MOT history	See MOT history



Damage history


Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	

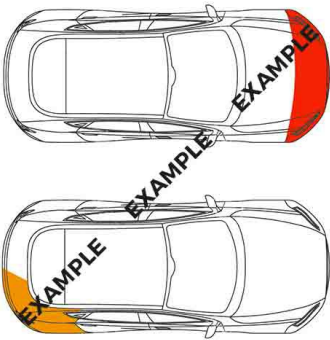

Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this PEUGEOT? How many owners did this PEUGEOT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this PEUGEOT had different number plates.

Number of plates	1
Current registration	 XXXXXX
Plate since	2024-03-29
Current registration	 XXXXXX
Plate since	2024-03-29

More info >



Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this PEUGEOT is financed.


Finance company	XXXXXXXXXX	XXXXXX
Date of agreement	XXXXXXXXXX	XXXXXX
Agreement type	XXXXXXXXXX	XXXXXX
Agreement term	XXXXXXXXXX	XXXXXX
Agreement number	XXXXXXXXXX	XXXXXX
Contact info	XXXXXXXXXX	XXXXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	22
First mileage registration	2007-09-28
Last registration	2023-10-17
Complete history	See info

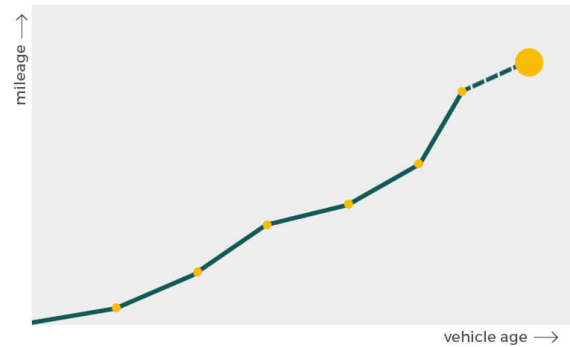

Registration #1	2007-09-28	27 mi
Registration #2	2010-10-29	35.703 mi
Registration #3	2011-10-26	47.167 mi
Registration #4	2012-10-30	62.641 mi
Registration #5	2013-09-18	76.840 mi
Registration #6	2013-09-25	76.849 mi
Registration #7	2014-10-31	93.105 mi
Registration #8	2015-10-22	105.650 mi
Registration #9	2015-10-23	105.655 mi
Registration #10	2016-10-18	118.291 mi
Registration #11	2016-10-18	118.291 mi
Registration #12	2016-10-18	118.291 mi
Registration #13	2016-10-18	118.291 mi
Registration #14	2016-10-18	118.291 mi
Registration #15	2016-10-18	118.291 mi
Registration #16	2016-10-18	118.291 mi
Registration #17	2016-10-18	118.291 mi
Registration #18	2016-10-18	118.291 mi
Registration #19	2016-10-18	118.291 mi
Registration #20	2016-10-18	118.291 mi
Registration #21	2016-10-18	118.291 mi
Registration #22	2016-10-18	118.291 mi

More info >



Car features

The PEUGEOT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete PEUGEOT factory list for this vehicle [here](#).

More info >

Dimensions & weight

Width	1986 mm
Height	1980 mm
Length	4805 mm
Wheel base	3000 mm
Kerb weight	1673 kg
Max. allowed weight	2661 kg

Additional information

Fuel tank capacity	80 l
Fuel delivery	Direct Injection
Number of seats	3
Number of axles	2
Engine number	JB500031171