



report date: 2024-03-28

General information

Make	FORD
Model	KA ZETEC
Colour	Blue
Year of manufacture	2010
Top speed	99 mph
0 - 60 mph	13.1 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	68 BHP
Max. torque	102 Nm at 3.000 rpm
Engine capacity	1.242 cc
Cylinders	4
Fuel type	Petrol
Consumption city	44.8 mpg
Consumption extra urban	64.2 mpg
Consumption combined	55.4 mpg
CO2 emission	119 g/km
CO2 label	C





Internet history

Entry 2

Date	2021-09-01
Pictures	0
Listing price	View report

source: autotrader.co.uk

Entry 1

Date	2021-05-23
Pictures	0
Listing price	View report

source: autotrader.co.uk



MOT history

MOT expiry date	2024-09-22
MOT pass rate	60 %
MOT passed	12
Failed MOT tests	8
Total advice items	66
Total items failed	17

MOT #202023-09-19 09:34

MOT test number242054203354

ResultPassed

Next expiry date2024-09-22

- AdviceFront Coil spring corroded BOTH (5.3.1 (b) (i))
- MinorOffside Obligatory mirror slightly damaged (3.3 (b) (i))
- AdviceOffside Front Upper Macpherson strut pin or bush worn but not resulting in excessive movement
TOP MOUNT (5.3.4 (a) (i))
- AdviceRear Brake hose has slight corrosion to ferrule Nearside & Offside (1.1.12 (f) (i))
- AdviceOil leak, but not excessive (8.4.1 (a) (i))
- AdviceFront Registration plate deteriorated but not likely to be misread (0.1 (b))
- AdviceNearside Front Upper Macpherson strut pin or bush worn but not resulting in excessive movement
TOP MOUNT (5.3.4 (a) (i))
- AdviceNearside Front Shock absorbers has light misting of oil (5.3.2 (b))
- AdviceUnder body corrosion
- AdviceExhaust has a minor leak of exhaust gases (6.1.2 (a))
- AdviceNearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))

**MOT #19**

2023-09-16 15:25

MOT test number

764456575908

Result**✗ Failed**

- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Nearside Front Upper Macpherson strut pin or bush worn but not resulting in excessive movement TOP MOUNT (5.3.4 (a) (i))
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Fail** Nearside Stop lamp(s) not working (4.3.1 (a) (ii))
- Advice** Under body corrosion
- Advice** Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Front Coil spring corroded BOTH (5.3.1 (b) (i))
- Minor** Offside Obligatory mirror slightly damaged (3.3 (b) (i))
- Advice** Offside Front Upper Macpherson strut pin or bush worn but not resulting in excessive movement TOP MOUNT (5.3.4 (a) (i))
- Fail** Engine MIL inoperative or indicates a malfunction (8.2.1.2 (h))
- Fail** Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Advice** Rear Brake hose has slight corrosion to ferrule Nearside & Offside (1.1.12 (f) (i))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))

**MOT #18**

2022-09-23 12:21

MOT test number

175069285751

Result

✓ Passed

- Advice** Nearside Front Macpherson strut pin or bush worn but not resulting in excessive movement top mount (5.3.4 (a) (i))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Nearside Rear Service brake binding but not excessively (1.2.1 (f))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** General under body corrosion
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))

MOT #17

2022-09-23 12:21

MOT test number

497802770813

Result

✗ Failed

- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Nearside Front Macpherson strut pin or bush worn but not resulting in excessive movement top mount (5.3.4 (a) (i))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Advice** General under body corrosion
- Advice** Front Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Exhaust has a minor leak of exhaust gases (6.1.2 (a))
- Advice** Nearside Rear Service brake binding but not excessively (1.2.1 (f))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))
- Pass with rectification** Engine MIL inoperative or indicates a malfunction (8.2.1.2 (h))
- Pass with rectification** Windscreen washer provides insufficient washer liquid (3.5 (a))

**MOT #16**

2021-09-15 10:30

MOT test number

461496569787

Result

✓ Passed

Advice Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))**Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))**MOT #15**

2021-09-10 14:39

MOT test number

712894705096

Result

✗ Failed

Advice Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))**Fail** Nearside Front Direction indicator not working (4.4.1 (a) (ii))**Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))**Fail** Offside Front Suspension arm pin or bush excessively worn (5.3.4 (a) (i))**MOT #14**

2021-01-08 16:34

MOT test number

882940362196

Result

✓ Passed

Advice Front Brake pad(s) wearing thin (1.1.13 (a) (ii))**Advice** Nearside Washer jet in poor condition requires replacing

**MOT #13**

2021-01-08 16:34

MOT test number

110893269629

Result**✗ Failed****Advice** Nearside Washer jet in poor condition requires replacing**Pass with rectification** Driver's view of the road through the swept area of the windscreen materially affected by an obstruction Phone holder in screen centre removed again (3.1 (a) (ii))**Advice** Front Brake pad(s) wearing thin (1.1.13 (a) (ii))**MOT #12**

2021-01-07 16:56

MOT test number

932088235134

Result**✗ Failed****Fail** Rear fog lamp not working (4.5.1 (a) (ii))**Pass with rectification** Offside Headlamp aim too high (4.1.2 (a))**Advice** Front Brake pad(s) wearing thin (1.1.13 (a) (ii))**Fail** Offside Front Road wheel badly distorted (5.2.2 (c) (i))**Fail** Windscreen washer jets misaligned and not providing sufficient fluid to the windscreen (3.5 (a))**MOT #11**

2020-01-06 15:55

MOT test number

700880252868

Result**✓ Passed****Advice** Rear Child Seat fitted not allowing full inspection of adult belt**Advice** Exhaust has a minor leak of exhaust gases rear (6.1.2 (a))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))

**MOT #10**

2020-01-06 12:27

MOT test number

577718731336

Result**✗ Failed****Fail** Offside Front Tyre has ply or cords exposed (5.2.3 (d) (ii))**Pass with rectification** Nearside Rear Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))**Advice** Rear Child Seat fitted not allowing full inspection of adult belt**Advice** Exhaust has a minor leak of exhaust gases rear (6.1.2 (a))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Pass with rectification** Nearside Front Position lamp not working (4.2.1 (a) (ii))**MOT #9**

2019-01-08 16:31

MOT test number

335351362955

Result**✓ Passed****Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))**MOT #8**

2019-01-08 16:31

MOT test number

747542942370

Result**✗ Failed****Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))**Pass with rectification** Offside Rear Direction indicator incorrect colour (4.4.3 (a))**MOT #7**

2018-02-26 16:36

MOT test number

840904563364

Result**✓ Passed**

**MOT #6** 2018-02-26 16:36**MOT test number** 785214110553**Result** ✗ Failed**Pass with rectification** Nearside Stop lamp has less than 50% of the light sources illuminating (1.2.1b)**MOT #5** 2017-01-10 10:03**MOT test number** 952713333455**Result** ✓ Passed**MOT #4** 2016-02-22 10:29**MOT test number** 558905008956**Result** ✓ Passed**MOT #3** 2015-02-18 10:22**MOT test number** 119349245057**Result** ✓ Passed**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**MOT #2** 2014-03-19 11:14**MOT test number** 285668974083**Result** ✓ Passed**Advice** Rear Exhaust has a minor leak of exhaust gases (7.1.2)**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Notice** Screw in n/s/r tyre**Advice** Front Brake pad(s) wearing thin (3.5.1g)**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)**Notice** Adjust washer jets



MOT #1	2013-04-16 13:51
MOT test number	146806503144
Result	✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 October 2024

✓
MOT
Expires:
22 September 2024

Tax status	Valid until 1 October
Days left	155
MOT expiry date	22 September 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	C
Single payment (12 months)	£ 35,00,-
Single six month payment	Not applicable
Total payable by 12 monthly instalments	£ 36,75,-



Damage history


Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	

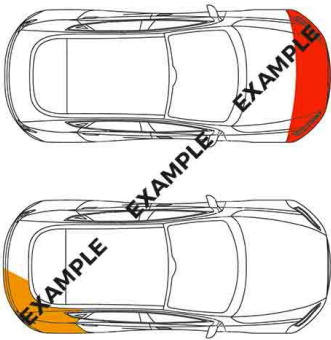

Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this FORD? How many owners did this FORD have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To

More info >

Plate changes

See in this check if this FORD had different number plates.

Number of plates	1
Current registration	XXXXXX
Plate since	2024-03-28
Current registration	XXXXXX
Plate since	2024-03-28

More info >



Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FORD is financed.


Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	23
First mileage registration	2010-04-13
Last registration	2023-09-19
Complete history	See info

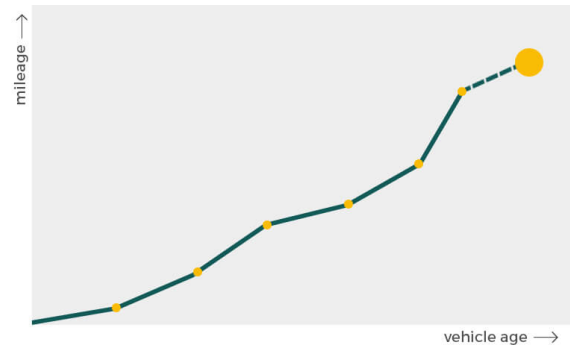

Registration #1	2010-04-13	17 mi
Registration #2	2013-04-16	12.251 mi
Registration #3	2014-03-19	19.793 mi
Registration #4	2015-02-18	28.820 mi
Registration #5	2016-02-22	39.722 mi
Registration #6	2017-01-10	46.954 mi
Registration #7	2018-02-26	53.525 mi
Registration #8	2018-02-26	53.525 mi
Registration #9	2019-01-08	55.574 mi
Registration #10	2019-01-08	55.574 mi
Registration #11	2020-01-06	65.549 mi
Registration #12	2020-01-06	65.551 mi
Registration #13	2020-01-06	65.551 mi
Registration #14	2020-01-06	65.551 mi
Registration #15	2020-01-06	65.551 mi
Registration #16	2020-01-06	65.551 mi
Registration #17	2020-01-06	65.551 mi
Registration #18	2020-01-06	65.551 mi
Registration #19	2020-01-06	65.551 mi
Registration #20	2020-01-06	65.551 mi
Registration #21	2020-01-06	65.551 mi
Registration #22	2020-01-06	65.551 mi
Registration #23	2020-01-06	65.551 mi

More info >



Car features

The FORD factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FORD factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating



Video [see crash video](#)



Dimensions & weight

Width	1702 mm
Height	1505 mm
Length	3620 mm
Wheel base	2300 mm
Kerb weight	940 kg
Max. allowed weight	1320 kg

Additional information

Fuel tank capacity	35 l
Fuel delivery	Multi-Point Injection
Number of doors	3
Number of seats	4

Number of axles	2
Engine number	5775203