



VE07POV

report date: 2024-03-29

General information

Make	FORD
Model	TRANSIT 350 LWB EF HR DRW P/V 100
Colour	Orange
Year of manufacture	2007
Gearbox	5 speed Manual

Engine & fuel consumption

Power	98 BHP
Max. torque	285 Nm at 1.600 rpm
Engine capacity	2.402 cc
Cylinders	4
Fuel type	Diesel



LABEL UNKNOWN



MOT history

MOT expiry date	2021-10-25
MOT pass rate	63 %
MOT passed	12
Failed MOT tests	7
Total advice items	82
Total items failed	44

MOT #19	2020-10-26 14:44
MOT test number	384062956502
Result	✓ Passed
Next expiry date	2021-10-25
Advice	Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))
Advice	Nearside Brake pipe corroded, covered in grease or other material front to rear (1.1.11 (c))

**MOT #18**

2020-10-13 13:57

MOT test number

895089468740

Result**✗ Failed**

- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))
- Fail** Nearside Rear Suspension spring mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))
- Fail** Engine MIL inoperative or indicates a malfunction (8.2.2.2 (g))
- Fail** Nearside Front Suspension spring mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))
- Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Fail** Anti-lock braking system warning lamp indicates an ABS fault (1.6 (b))
- Fail** Offside Front Suspension spring mounting prescribed area excessively corroded significantly reducing structural strength outer sill (5.3.6 (a) (i))
- Fail** Offside Rear Brake pipe excessively corroded (1.1.11 (c))
- Fail** Nearside Front Position lamp missing (4.2.1 (a) (ii))
- Minor** Offside Headlamp lens slightly defective (4.1.1 (b) (i))
- Fail** Offside Rear Suspension spring mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))
- Fail** Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))
- Fail** Nearside Front Brake pipe excessively corroded (1.1.11 (c))
- Fail** Offside Track rod end ball joint worn to the extent there is a serious risk of detachment (2.1.3 (b) (ii))
- Fail** Electronic stability control warning lamp indicates a fault (7.12 (e))
- Fail** Offside Front Suspension spring mounting prescribed area excessively corroded significantly reducing structural strength inner sill (5.3.6 (a) (i))
- Fail** Power steering malfunctioning (2.1.5 (a))
- Fail** Nearside Stop lamp(s) missing (4.3.1 (a) (ii))
- Advice** Nearside Brake pipe corroded, covered in grease or other material front to rear (1.1.11 (c))

**MOT #17** 2019-10-11 11:17**MOT test number** 646577863075**Result** ✓ Passed**MOT #16** 2019-10-08 11:31**MOT test number** 684351406487**Result** ✗ Failed

- Fail** Offside Front Brake pipe excessively corroded (1.1.11 (c))
- Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))

MOT #15 2018-10-11 12:30**MOT test number** 793227310460**Result** ✓ Passed**MOT #14** 2018-10-08 13:39**MOT test number** 639242628367**Result** ✗ Failed

- Fail** Front Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))
- Fail** Offside Front Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))
- Fail** Electronic stability control warning lamp indicates a fault (7.12 (e))
- Fail** Offside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Fail** Engine MIL inoperative or indicates a malfunction (8.2.1.2 (h))
- Fail** Nearside Front Position lamp not working (4.2.1 (a))
- Fail** Anti-lock braking system warning lamp indicates an ABS fault (1.6 (b))



MOT #13

2017-09-12 17:37

MOT test number

640343049694

Result		✓ Passed
Advice	Underside of vehicle showing age related surface corrosion	
Advice	Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)	
Advice	Front Brake pad(s) wearing thin (3.5.1g)	
Advice	Offside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)	
Advice	Offside Front Inner tyre tread worn low	
Advice	Central exhaust silencer outer skin corroded	
Advice	Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)	
Advice	Nearside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)	
Advice	Rear Brake pad(s) wearing thin (3.5.1g)	
Advice	Brake pad warning light illuminated and offside front brake pad warning wire broken	



MOT #12

2017-09-12 17:37

MOT test number

198182915042

Result

✗ Failed

- Advice

Offside Front Inner tyre tread worn low
- Advice

Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice

Brake pad warning light illuminated and offside front brake pad warning wire broken
- Advice

Central exhaust silencer outer skin corroded
- Advice

Front Brake pad(s) wearing thin (3.5.1g)
- Pass with rectification

Nearside Registration plate lamp not working (1.1.C.1d)
- Pass with rectification

Offside Stop lamp not working (1.2.1b)
- Advice

Offside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice

Underside of vehicle showing age related surface corrosion
- Pass with rectification

Windscreen washer provides insufficient washer liquid (8.2.3)
- Advice

Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice

Rear Brake pad(s) wearing thin (3.5.1g)
- Advice

Nearside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Pass with rectification

Nearside Stop lamp not working (1.2.1b)



MOT #11	2016-10-03 17:07
MOT test number	803111703556
Result	✓ Passed
Advice	Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Advice	Offside Rear Tyre worn close to the legal limit 3mm tread remaining (4.1.E.1)
Advice	Brake pad warning light illuminated
Advice	Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Advice	Nearside Rear Tyre worn close to the legal limit 2mm tread remaining (4.1.E.1)
Advice	Offside Front brake pad warning wire broken
Advice	Offside Front Lower Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)

MOT #10	2015-10-08 17:24
MOT test number	546422026115
Result	✓ Passed
Advice	Nearside number plate lense cover missing
Advice	Offside Front Tyre worn close to the legal limit on inner tread (4.1.E.1)
Advice	Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Advice	Nearside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Advice	Vehicle emissions test aborted vehicle wont rev to a sufficient standard to produce a test result
Advice	Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
Advice	Front Brake pad(s) wearing thin (3.5.1g)

**MOT #9** 2015-10-08 17:24**MOT test number** 533492558213**Result** ✗ Failed

- Advice** Offside Front Tyre worn close to the legal limit on inner tread (4.1.E.1)
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Nearside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Pass with rectification** Nearside Registration plate lamp not working (1.1.C.1d)
- Advice** Vehicle emissions test aborted vehicle wont rev to a sufficient standard to produce a test result
- Pass with rectification** Offside Headlamp aim too high (1.8)
- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Pass with rectification** Offside Front position lamp(s) not working (1.1.A.3b)
- Advice** Nearside number plate lense cover missing
- Pass with rectification** Nearside Headlamp aim beam image obviously incorrect (1.8.A.1b)

MOT #8 2014-09-18 18:18**MOT test number** 708361164271**Result** ✓ Passed

- Notice** Suspect front brake pads worn low the brake caliper design prevents a full inspection
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Notice** Nearside and offside rear brake discs worn
- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Rear Brake pad(s) wearing thin (3.5.1g)

**MOT #7**

2014-04-03 18:40

MOT test number

198833094483

Result

✓ Passed

- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Rear Brakes imbalanced requirements only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.5b)
- Notice** Nearside number plate lense cover missing
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Rear Brake pad(s) wearing thin (3.5.1g)
- Notice** Nearside and offside sills dented

MOT #6

2014-04-03 18:40

MOT test number

675743694034

Result

✗ Failed

- Pass with rectification** Offside Headlamp aim too low (1.8)
- Notice** Nearside number plate lense cover missing
- Advice** Nearside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Rear Brakes imbalanced requirements only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.5b)
- Pass with rectification** Nearside Headlamp aim too low (1.8)
- Pass with rectification** Nearside Registration plate lamp not working (1.1.C.1d)
- Advice** Offside Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Notice** Nearside and offside sills dented
- Advice** Rear Brake pad(s) wearing thin (3.5.1g)



MOT #5	2013-03-07 13:38
MOT test number	728436063010
Result	✓ Passed
Notice	Brake pad warning wire broke on off side rear/ illuminated on dashboard
Notice	Slight hub seal leak offside rear wheel
Advice	Front Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)
Notice	Slight oil leak
Advice	Offside Front Driver's door hinge deteriorated but the door can still be readily opened and closed (6.2.B.2)
Advice	Fuel hose slightly chafed (7.2.2)
MOT #4	2012-04-05 16:52
MOT test number	246776892061
Result	✓ Passed

**MOT #3**

2012-04-05 13:54

MOT test number

225996592089

Result**✗ Failed**

- Notice** Wiper blades starting to smear
- Fail** Nearside Rear Brake pad(s) less than 1.5 mm thick (3.5.1g)
- Advice** Offside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Fail** Nearside Front Brake pad(s) less than 1.5 mm thick (3.5.1g)
- Notice** Oil leak
- Notice** Brake pad warning light illuminated
- Notice** Nail in offside rear tyre
- Fail** Offside Rear Brake pad(s) less than 1.5 mm thick (3.5.1g)
- Notice** Slight wheel bind on rear wheels
- Advice** Nearside Rear brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Fail** Nearside Front brake caliper securing device loose (3.5.1j)
- Notice** Spare tyre bracket loose
- Fail** Offside Front Brake pad(s) less than 1.5 mm thick (3.5.1g)
- Notice** Nail in nearside front tyre

MOT #2

2011-05-11 10:18

MOT test number

965291331122

Result**✓ Passed**

- Advice** Windscreen has damage to an area less than a 10mm circle within zone 'A' (8.3.1a)



MOT #1	2010-05-20 10:50
MOT test number	172240940108
Result	✓ Passed
<div>Notice</div> Brake pad warning light on n/s/r	



Tax & MOT check

X
Untaxed

Tax expired:
1 December 2020

X
MOT

Expired:
25 October 2021

Tax status	Expired at 1 December 2020
Days left	1245 days too late
MOT expiry date	25 October 2021
Full MOT history	See MOT history



Damage history

Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this FORD? How many owners did this FORD have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To
Owner	From	To

More info >

Plate changes

See in this check if this FORD had different number plates.

Number of plates	1
Current registration	VE07POV
Plate since	2019-03-29
Current registration	VE07POV
Plate since	2019-03-29

More info >



Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FORD is financed.


Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



report date: 2024-03-29

Odometer	In miles
Mileage registrations	19
First mileage registration	2007-06-25
Last registration	2020-10-26
Complete history	See info

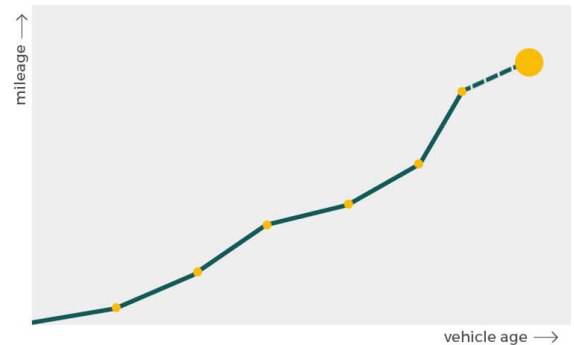

Registration #1	2007-06-25	10 mi
Registration #2	2010-05-20	40.859 mi
Registration #3	2011-05-11	56.719 mi
Registration #4	2012-04-05	69.197 mi
Registration #5	2012-04-05	69.198 mi
Registration #6	2013-03-07	81.666 mi
Registration #7	2014-04-03	91.880 mi
Registration #8	2014-09-18	97.245 mi
Registration #9	2015-10-08	107.080 mi
Registration #10	2015-10-08	107.080 mi
Registration #11	2015-10-08	107.080 mi
Registration #12	2015-10-08	107.080 mi
Registration #13	2015-10-08	107.080 mi
Registration #14	2015-10-08	107.080 mi
Registration #15	2015-10-08	107.080 mi
Registration #16	2015-10-08	107.080 mi
Registration #17	2015-10-08	107.080 mi
Registration #18	2015-10-08	107.080 mi
Registration #19	2015-10-08	107.080 mi

More info >



Car features

The FORD factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FORD factory list for this vehicle [here](#).

More info >

Dimensions & weight

Width	2492 mm
Height	2025 mm
Length	6385 mm
Max. allowed weight	3500 kg

Additional information

Fuel tank capacity	80 l
Fuel delivery	Direct Injection
Number of doors	4
Number of seats	7
Engine number	6A17202