





report date: 2024-03-29

General information

Make	AUDI
Model	A4 T S LINE
Colour	Silver
Year of manufacture	2007
Top speed	136 mph
0 - 60 mph	9.3 seconds
Gearbox	1 speed CVT

Engine & fuel consumption

Power	163 BHP
Max. torque	225 Nm at 1.950 rpm
Engine capacity	1.781 cc
Cylinders	4
Fuel type	Petrol
Consumption city	24.1 mpg
Consumption extra urban	41.5 mpg
Consumption combined	32.8 mpg
CO2 emission	204 g/km
CO2 label	K



CarCheck.co.uk page 1/17



report date: 2024-03-29


Internet history

Entry 1

Date 2021-05-28

Pictures 20

Listing price <u>View report</u>

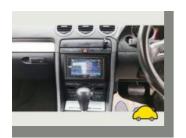







source: autotrader.co.uk

CarCheck.co.uk page 2/17



report date: 2024-03-29

MOT history

MOT expiry date	2024-09-09
MOT pass rate	60 %
MOT passed	15
Failed MOT tests	10
Total advice items	63
Total items failed	30

MOT #25		2023-08-31 16:09
MOT test numb	per	281612795072
Result		✓ Passed
Next expiry da	te	2024-09-09
Advice Und	er floor covers fitted. Unable to make full assessment of components	
Advice Rea	r Registration plate insecure but not likely to fall off (0.1 (a))	
Minor Near	side Registration plate lamp inoperative in the case of multiple lamps o	or light sources (4.7.1
Advice Und	er engine cover fitted. Unable to make full assessment of components	
Advice Oute	er sill covers fitted. Unable to make full assessment of sills	

MOT #24		2023-08-31 08:23
MOT test	number	334858625495
Result		🗙 Failed
Advice	Outer sill covers fitted. Unable to make full assessment of sills	
Advice	Rear Registration plate insecure but not likely to fall off (0.1 (a))	
Advice	Under floor covers fitted. Unable to make full assessment of components	
	ffside Front Outer Drive shaft joint constant velocity boot split or insecure, no dirt new grease and clip needed $(6.1.7 (g) (ii))$	longer prevents the
Advice	Under engine cover fitted. Unable to make full assessment of components	
Minor (b) (i))	Nearside Registration plate lamp inoperative in the case of multiple lamps or	light sources (4.7.1

CarCheck.co.uk page 3/17



report date: 2024-03-29

MOT #23 2022-08-31 15:25 **MOT** test number 812748313807 ✓ Passed Result **Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) **Advice** Outer sill covers fitted. Unable to make full assessment of sills Advice Under engine cover fitted. Unable to make full assessment of components Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Advice Oil leak, but not excessive (8.4.1 (a) (i)) Under floor covers fitted. Unable to make full assessment of components Advice

MOT #22 2022-08-31 08:16 **MOT** test number 362771538558 Result × Failed **Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) **Advice** Under floor covers fitted. Unable to make full assessment of components Fail Nearside Windscreen washer not working (3.5 (a)) Advice Oil leak, but not excessive (8.4.1 (a) (i)) Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Advice Under engine cover fitted. Unable to make full assessment of components Advice Oil leak, but not excessive (8.4.1 (a) (i)) Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt insecure (6.1.7 (g) (ii)) **Advice** Outer sill covers fitted. Unable to make full assessment of sills

MOT #21	2021-09-10 16:04
MOT test number	647488123865
Result	✓ Passed

CarCheck.co.uk page 4/17



report date: 2024-03-29

MOT #20 2021-09-01 06:46

MOT test number 701476113141

Result

× Failed

Fail Offside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt front arm (5.3.4 (b) (ii))

Fail Offside Front Lower Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt outer gaiter insecure (6.1.7 (g) (ii))

MOT #19 2021-02-26 17:40

MOT test number 754453669528

Result
✓ Passed

Minor Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Advice Rear Brake disc worn, but not excessively (1.1.14 (a) (i))

Advice Under-trays fitted not allowing full inspection.

MOT #18 2021-02-26 12:18

MOT test number 259043180862

Result ★ Failed

Fail Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Advice Under-trays fitted not allowing full inspection.

Advice Rear Brake disc worn, but not excessively (1.1.14 (a) (i))

Fail Offside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Minor Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Fail Rear fog lamp not working (4.5.1 (a) (ii))

CarCheck.co.uk page 5/17



report date: 2024-03-29

MOT #17 2021-02-15 11:10

MOT test number 413494432831

Result X Failed

Fail Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt front one (5.3.4 (b) (ii))

Fail Offside Rear fog lamp not working (4.5.1 (a) (ii))

Fail Offside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt front one (5.3.4 (b) (ii))

Fail Nearside Front Lower Suspension arm ball joint excessively worn front one (5.3.4 (a) (i))

Fail Offside Front Lower Suspension arm ball joint excessively worn front one (5.3.4 (a) (i))

MOT #16 2019-07-04 14:40

MOT test number 641764191416

Advice Nearside Front Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

Advice Offside Front Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

MOT #15 2019-06-29 09:12

MOT test number 108877325539

Result ★ Failed

Fail Nearside Front Headlamp aim too high (4.1.2 (a))

Fail Offside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Fail Nearside Rear Registration plate lamp does not illuminate simultaneously with the position lamps (4.7.2 (a))

Advice Nearside Front Lower ball joint dust cover split

Fail Offside Front Headlamp aim too high (4.1.2 (a))

Fail Offside Front Lower Suspension arm pin or bush excessively worn (5.3.4 (a) (i))

CarCheck.co.uk page 6/17



report date: 2024-03-29

MOT #14 2018-07-17 16:22

MOT test number 911166804109

MOT #13 2018-07-16 12:59

MOT test number 774198840244

Result X Failed

Fail Offside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Minor Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Advice Oil leak, but not excessive cam cover onto manifold (8.4.1 (a) (i))

Fail Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Advice Both outer CV gaitors inner clips loose and leaking grease

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Advice Offside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (i))

MOT #12 2018-03-28 10:30

MOT test number 368204815553

Result

Passed

Advice Offside Front Upper Suspension arm rubber bush deteriorated but not resulting in excessive movement rear arm (2.4.G.2)

Advice Offside Front Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt

Advice Nearside Front Front constant velocity joint gaiter deteriorated, but preventing the ingress of dirt

(2.5.C.1a)

(2.5.C.1a)

CarCheck.co.uk page 7/17



report date: 2024-03-29

MOT test number

128482026852

Result

Advice Nearside Rear Valve stem slightly damaged (4.1.D.1e)

Advice Offside Rear Tyre worn close to the legal limit 3mm (4.1.E.1)

Advice Offside Rear Valve stem slightly damaged (4.1.D.1e)

Rear coil spring corroded both (2.4.C.1b)

MOT #10 2017-03-28 09:17 **MOT** test number 762594181865 Result × Failed **Advice** Offside Front Tyre worn close to the legal limit 2mm (4.1.E.1) Advice Offside Rear Valve stem slightly damaged (4.1.D.1e) **Advice** Offside Rear Tyre worn close to the legal limit 3mm (4.1.E.1) Offside Front Front constant velocity joint gaiter damaged to the extent that it no longer prevents the Fail ingress of dirt etc outer (2.5.C.1a) Fail Nearside Front suspension ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt front arm (2.4.G.2) Rear coil spring corroded both (2.4.C.1b) **Advice** Fail Front Windscreen wiper does not clear the windscreen effectively both (8.2.2) **Advice** Nearside Front Tyre worn close to the legal limit 2mm (4.1.E.1) **Advice** Nearside Rear Valve stem slightly damaged (4.1.D.1e) Fail Nearside Front Front constant velocity joint gaiter damaged to the extent that it no longer prevents the ingress of dirt etc outer (2.5.C.1a) Fail Offside Front suspension ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt front arm (2.4.G.2) Advice Rear Brake pad(s) wearing thin 3mm (3.5.1g)

CarCheck.co.uk page 8/17



report date: 2024-03-29

MOT #9	2016-03-30 10:40

MOT test number 491220880547

MOT #8 2015-03-16 16:47

MOT test number 735615075009

Result

Passed

MOT #7 2014-03-25 15:53

MOT test number 675304284005

Result ✓ Passed

MOT #6 2014-03-25 12:22

MOT test number 275534784063

Result X Failed

Fail Rear fog lamp not working (1.3.2b)

Fail Offside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

Fail Nearside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

MOT #5 2013-03-19 17:35

MOT test number 938628273033

Notice Nail in nearside rear tyre

Advice Offside Front Upper Suspension arm rubber bush deteriorated but not resulting in excessive

movement (2.4.G.2)

Advice Nearside Front Upper Suspension arm rubber bush deteriorated but not resulting in excessive

movement (2.4.G.2)

CarCheck.co.uk page 9/17



report date: 2024-03-29

MOT #4 2013-03-19 12:37 336548673036 **MOT test number** Result × Failed **Advice** Nearside Front Brake pad(s) wearing thin (3.5.1g) **Advice** Offside Front Upper Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2) Notice Wipers starting to streak Fail Offside Registration plate lamp not working (1.1.C.1d) **Advice** Nearside Front Upper Suspension arm rubber bush deteriorated but not resulting in excessive movement (2.4.G.2) **Notice** Nail in nearside rear tyre Fail Centre Stop lamp not working (1.2.1b)

MOT #3	2012-03-21 12:46
MOT test number	356241382006
Result	✓ Passed
MOT #2	2011-03-23 14:02
MOT test number	255252481037
Result	✓ Passed
MOT #1	2010-03-12 11:27

MOT #1		2010-03-12 11:27
MOT test	number	584381570021
Result		✓ Passed
Advice	Nearside Rear Tyre worn close to the legal limit (4.1.E.1)	
Advice	Offside Rear Tyre worn close to the legal limit (4.1.E.1)	
Advice	Nearside Front Tyre worn close to the legal limit (4.1.E.1)	
Advice	Offside Front Tyre worn close to the legal limit (4.1.E.1)	

CarCheck.co.uk page 10/17



report date: 2024-03-29

Tax & MOT check



Tax status	Valid until 1 September
Days left	125
MOT expiry date	9 September 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	K
Single payment (12 months)	£ 395,00,-
Single six month payment	£ 217,25,-
Total payable by 12 monthly instalments	£ 414,75,-

CarCheck.co.uk page 11/17



report date: 2024-03-29

Damage history

Check the damage history for this AUDI. See if, where and when this AUDI had damage and the car repair costs. We also check if this AUDI was scrapped. Download the premium report here for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



Extra AUDI salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 12/17



report date: 2024-03-29

Vehicle valuation

What is this car worth? See the vehicle value of this AUDI in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 13/17



report date: 2024-03-29

Owner history

*	
For how long did the current and previous owner(s) have this AUDI? How many owners of Check it in the premium report and see all owner registrations. Download the full report	

	More info >
Plate changes	
See in this check if this AUDI had different number plates.	
Number of plates	
Current registration	OK SIE
Plate since	
Current registration	UK NE
Plate since	
	More info

CarCheck.co.uk page 14/17



report date: 2024-03-29

Finance check

Check if this AUDI is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this AUDI has been settled.

If not, and you buy this AUDI then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this AUDI is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

More info >


CarCheck.co.uk page 15/17



report date: 2024-03-29

Mileage check

Odometer	In miles
Mileage registrations	27
First mileage registration	2007-03-01
Last registration	2023-08-31
Complete history	See info

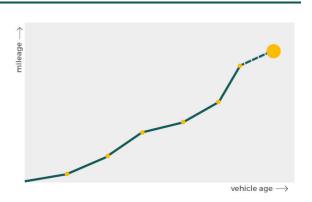

Registration #2 2010-03-12 23.406 mi Registration #3 2011-03-23 28.289 mi Registration #4 2012-03-21 31.721 mi Registration #4 2013-03-19 35.784 mi Registration #6 2013-03-19 35.784 mi Registration #6 2013-03-19 35.784 mi Registration #7 2014-03-25 39.892 mi Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 88.893 mi Registration #15 88.893 mi Registration #16 88.893 mi Registration #17 88.893 mi Registration #18 88.893 mi Registration #19 88.893 mi Registration #20 88.893 mi Registratio			
Registration #3 2011-03-23 28.289 mi Registration #4 2012-03-21 31.721 mi Registration #5 2013-03-19 35.784 mi Registration #6 2013-03-19 35.784 mi Registration #6 2013-03-19 35.784 mi Registration #7 2014-03-25 39.892 mi Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-28 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #19 Registration #20 Registration #20 Registration #22 Registration #23 Registration #24 Registration #25 Registration #25 Registration #25 Registration #26	Registration #1	2007-03-01	24 mi
Registration #4 2012-03-21 31.721 mi Registration #5 2013-03-19 35.784 mi Registration #6 2013-03-19 35.784 mi Registration #7 2014-03-25 39.892 mi Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #20 Registration #20 Registration #20 Registration #24 Registration #25 Registration #26	Registration #2	2010-03-12	23.406 mi
Registration #5 2013-03-19 35.784 mi Registration #6 2013-03-19 35.784 mi Registration #7 2014-03-25 39.892 mi Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #25 Registration #25 Registration #25 Registration #26	Registration #3	2011-03-23	28.289 mi
Registration #6 2013-03-19 35.784 mi Registration #7 2014-03-25 39.892 mi Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-03 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #15 Registration #17 Registration #18 Registration #19 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #25 Registration #26	Registration #4	2012-03-21	31.721 mi
Registration #7 2014-03-25 39.892 mi Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #22 Registration #25 Registration #25 Registration #25 Registration #25 Registration #25 Registration #25 Registration #26	Registration #5	2013-03-19	35.784 mi
Registration #8 2014-03-25 39.892 mi Registration #9 2015-03-16 43.006 mi Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #25 Registration #26	Registration #6	2013-03-19	35.784 mi
Registration #9	Registration #7	2014-03-25	39.892 mi
Registration #10 2016-03-30 48.281 mi Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #8	2014-03-25	39.892 mi
Registration #11 2017-03-28 51.348 mi Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #9	2015-03-16	43.006 mi
Registration #12 2017-03-30 51.349 mi Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #10	2016-03-30	48.281 mi
Registration #13 2018-03-28 53.944 mi Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #11	2017-03-28	51.348 mi
Registration #14 2018-07-16 54.894 mi Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #12	2017-03-30	51.349 mi
Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #22 Registration #28 Registration #29 Registration #20 Registration #21 Registration #22 Registration #25 Registration #26	Registration #13	2018-03-28	53.944 mi
Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #22 Registration #25 Registration #23 Registration #24 Registration #25 Registration #25 Registration #26	Registration #14	2018-07-16	54.894 mi
Registration #16 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #25 Registration #26	Registration #15		11.777 es
Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #16		11.777 ea
Registration #19 Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #17		11.777 ms
Registration #20 Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #18		11.777 es
Registration #21 Registration #22 Registration #23 Registration #24 Registration #25 Registration #25 Registration #26	Registration #19		11.777 mi
Registration #22 Registration #23 Registration #24 Registration #25 Registration #26	Registration #20		71.777 ms
Registration #23 Registration #24 Registration #25 Registration #26	Registration #21		11,777 mi
Registration #24 Registration #25 Registration #26	Registration #22		71,777 es
Registration #25 Registration #26	Registration #23		11.777 mi
Registration #26	Registration #24		0.77 44
-	Registration #25		77,777 66
CarCheck.co.uk page 16/17	Registration #26		77,777 66
	CarCheck.co.uk		page 16/17

More info >



report date: 2024-03-29

Car features

S0225	Air conditionin
S0295	
50482	
50501	
60566	
60567	
50569	

Safety ratings

NCAP rating	****
Video	see crash video



Dimensions & weight

Width	1777 mm
Height	1391 mm
Length	4573 mm
Wheel base	2650 mm
Max. allowed weight	2060 kg

Additional information

Fuel delivery	Multi-Point Injection
Number of doors	2
Number of seats	4
Number of axles	2
Engine number Carcheck.co.uk	BFB 143326 page 17/17