





report date: 2024-03-28

General information

Make	FIAT
Model	IDEA 16V ACTIVE
Colour	Grey
Year of manufacture	-
Top speed	112 mph
0 - 60 mph	12.0 seconds
Gearbox	6 speed Manual

Engine & fuel consumption

Power	95 BHP
Max. torque 128 Nm at 4.500 rpm	
Cylinders	4
Fuel type	Petrol
Consumption city	34.4 mpg
Consumption extra urban	51.4 mpg
Consumption combined	43.5 mpg



CarCheck.co.uk page 1/15



Internet history

Entry 1	1
---------	---

Date	2021-07-21
Pictures	0
Listing price	View report

source: autotrader.co.uk

CarCheck.co.uk page 2/15



report date: 2024-03-28

MOT history

MOT #22 2022-06-07 12:55

MOT test number 177891530829

Result ✓ Passed

Next expiry date 2023-06-11

Advice Front Brake pad(s) wearing thin both sides (1.1.13 (a) (ii))

Advice Rear Brake pipe corroded, covered in grease or other material both sides (1.1.11 (c))

Advice Oil leak, but not excessive (8.4.1 (a) (i))

Advice Front Inner Brake disc worn, pitted or scored, but not seriously weakened both sides (1.1.14 (a)

(ii))

MOT #21 2022-06-04 09:02

MOT test number 210482757035

Result X Failed

Advice Front Brake pad(s) wearing thin both sides (1.1.13 (a) (ii))

Advice Rear Brake pipe corroded, covered in grease or other material both sides (1.1.11 (c))

Fail Nearside Front Outer Integral body structure corroded to the extent that the rigidity of the assembly is significantly reduced sill (6.1.1 (c) (i))

Advice Oil leak, but not excessive (8.4.1 (a) (i))

Advice Front Inner Brake disc worn, pitted or scored, but not seriously weakened both sides (1.1.14 (a) (ii))

Fail Offside Front Outer Integral body structure corroded to the extent that the rigidity of the assembly is significantly reduced sill (6.1.1 (c) (i))

CarCheck.co.uk page 3/15



report date: 2024-03-28

MOT #20 2021-06-07 10:56

MOT test number 685794773956

MOT LEST	number	003794773930
Result		✓ Passed
Advice	Rear Registration plate deteriorated but not likely to be misread (0.1 (b))	
Advice	Offside Side repeater slightly discoloured (4.4.3 (a))	
Advice	Nearside Rear Exhaust mounting defective (6.1.2 (a))	
Advice	Front Registration plate deteriorated but not likely to be misread (0.1 (b))	
Advice	Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))	
Advice	Nearside Side repeater slightly discoloured (4.4.3 (a))	
Advice	Oil leak, but not excessive (8.4.1 (a) (i))	
Advice	Nearside Non obligatory mirror damaged casing missing	
Advice	Offside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c))	
Advice	Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c	:))
Advice	Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)))

CarCheck.co.uk page 4/15



report date: 2024-03-28

MOT #19		2021-06-07 09:29
MOT test	number	402355365698
Result		× Failed
Advice	Nearside Side repeater slightly discoloured (4.4.3 (a))	
Advice	Nearside Non obligatory mirror damaged casing missing	
Advice	Oil leak, but not excessive (8.4.1 (a) (i))	
Advice	Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) ((ii))
Advice	Nearside Rear Brake pipe corroded, covered in grease or other material (1.1.11	(c))
Fail O	ffside Rear Valve stem seriously damaged (5.2.3 (j))	
Advice	Rear Registration plate deteriorated but not likely to be misread (0.1 (b))	
Advice	Offside Side repeater slightly discoloured (4.4.3 (a))	
Advice	Nearside Rear Exhaust mounting defective (6.1.2 (a))	
Advice	Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))	
Advice	Offside Rear Brake pipe corroded, covered in grease or other material (1.1.11 (c	2))
Advice	Front Registration plate deteriorated but not likely to be misread (0.1 (b))	

MOT #18		2020-06-12 15:22
MOT test	number	150615108726
Result		✓ Passed
Advice	Front Brake disc worn, pitted or scored, but not seriously weakened both (1.	1.14 (a) (ii))
Advice	Oil leak, but not excessive (8.4.1 (a) (i))	
Advice	Nearside Outer mirror housing broken	
Advice	Offside Rear Brake drum worn, pitted or scored, but not seriously weakened	(1.1.14 (a) (ii))
Advice	Rear Coil spring mounting corroded but not seriously weakened axle (5.3.1 ((b) (i))

CarCheck.co.uk page 5/15



report date: 2024-03-28

MOT #17 2020-06-12 15:22 396014390715 **MOT** test number Result × Failed **Advice** Front Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii)) Advice Rear Coil spring mounting corroded but not seriously weakened axle (5.3.1 (b) (i)) Pass with rectification Offside Stop lamp(s) not working (4.3.1 (a) (ii)) Advice Offside Rear Brake drum worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)) Advice Oil leak, but not excessive (8.4.1 (a) (i)) Advice Nearside Outer mirror housing broken

MOT #16

MOT test number

Result

Advice Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))

MOT test number

Result

Advice Nearside Rear Coil spring corroded (5.3.1 (b) (i))

Advice Rear n/s and o/s shock casing corroded

Advice Offside Rear Coil spring corroded (5.3.1 (b) (i))

Advice Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))

CarCheck.co.uk page 6/15



report date: 2024-03-28

MOT #14 2018-07-06 08:50 285253462078 **MOT** test number Result × Failed **Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Advice Nearside Rear Coil spring corroded (5.3.1 (b) (i)) Pass with rectification Windscreen washer provides insufficient washer liquid (3.5 (a)) Advice Rear n/s and o/s shock casing corroded **Advice** Offside Rear Coil spring corroded (5.3.1 (b) (i))

MOT #13

MOT test number

757110992670

Result

Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT test number

882587475161

Result

Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)

Fail Offside Front Lower Suspension arm has excessive play in a ball joint (2.4.G.2)

Fail Offside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

Fail Exhaust system not adequately supported (7.1.1)

 MOT #11
 2016-07-22 12:50

 MOT test number
 577308790293

 Result
 ✓ Passed

CarCheck.co.uk page 7/15



MOT #10 2015-07-23 14:47

MOT test number 458404405200

Result ✓ Passed

Advice Coil spring mounting corroded but not seriously weakened (2.4.C.3c)

Advice Offside Front Lower Suspension arm has slight play in a ball joint (2.4.G.2)

MOT #9 2015-07-22 14:36

MOT test number 309103605285

Result X Failed

Pass with rectification Nearside Headlamp aim too high (1.8)

Fail Offside Front Lower Suspension arm ball joint dust cover excessively damaged so that it no longer prevents the ingress of dirt (2.4.G.2)

Advice Offside Front Lower Suspension arm has slight play in a ball joint (2.4.G.2)

Pass with rectification Offside Headlamp aim too high (1.8)

Fail Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)

Advice Coil spring mounting corroded but not seriously weakened (2.4.C.3c)

MOT #8 2014-05-02 17:50

MOT test number 138602624181

Result

Passed

MOT #7 2014-05-02 12:33

MOT test number 288892524132

Result X Failed

Fail Nearside Front Headlamp aim too far to the left (1.8)

Fail Nearside Front suspension has excessive play in a lower suspension ball joint (2.5.B.1a)

Fail Offside Front Headlamp aim too low and too far to the left. (1.8)

Fail Supplementary Restraint System warning lamp indicates a fault (5.4.2)

CarCheck.co.uk page 8/15



MOT test number

Result

CV05ZHE

report date: 2024-03-28

450650219103

✓ Passed

MOT #6	2013-04-30 14:43
MOT test number	647830523178
Result	✓ Passed
MOT #5	2012-05-02 11:30
MOT test number	699803422113
Result	✓ Passed
MOT #4	2011-05-03 15:09
MOT test number	107323921114
Result	✓ Passed
Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)	
MOT "2	2010 02 21 12 50
MOT #3	2010-03-31 13:59
MOT test number	193880090460
Result	✓ Passed
MOT #2	2009-04-20 14:11
MOT #2	2009-04-20 14:11

MOT #1	2008-04-28 12:44
MOT test number	800919418165
Result	✓ Passed

CarCheck.co.uk page 9/15



report date: 2024-03-28

Damage history

Check the damage history for this FIAT. See if, where and when this FIAT had damage and the car repair costs. We also check if this FIAT was scrapped. Download the premium report <u>here</u> for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



Extra FIAT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 10/15



Vehicle valuation

What is this car worth? See the vehicle value of this FIAT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 11/15



report date: 2024-03-28

O	ner	1-1-4	
1 11/4	/nar	nici	$r \cap r \vee$
\cup \vee			

For how long did the current and previous owner(s) have this FIAT? How many owners di Check it in the premium report and see all owner registrations. Download the full report		e?

	More info	>
Plate changes		
See in this check if this FIAT had different number plates.		
Number of plates		
Current registration	NK SIE	
Plate since		
Current registration	UK NIEZ	
Plate since		
	More info	>

CarCheck.co.uk page 12/15



report date: 2024-03-28

Finance check

Check if this FIAT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FIAT has been settled.

If not, and you buy this FIAT then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this FIAT is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Control info	

Contact info


More info >

CarCheck.co.uk page 13/15



Mileage check

Odometer	In miles
Odollietei	III IIIIIES
Mileage registrations	24
First mileage registration	2005-04-29
Last registration	2022-06-07
Complete history	See info

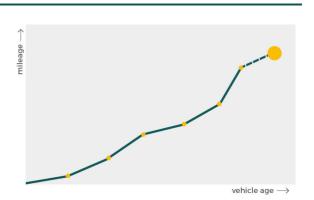

Registration #1	2005-04-29	22 mi
Registration #2	2008-04-28	9.294 mi
Registration #3	2009-04-20	11.211 mi
Registration #4	2010-03-31	15.486 mi
Registration #5	2011-05-03	22.880 mi
Registration #6	2012-05-02	28.732 mi
Registration #7	2013-04-30	35.567 mi
Registration #8	2014-05-02	42.003 mi
Registration #9	2014-05-02	42.003 mi
Registration #10	2015-07-22	47.324 mi
Registration #11	2015-07-23	47.324 mi
Registration #12	2016-07-22	48.694 mi
Registration #13		9.70 es
Registration #14		11.777 es
Registration #15		11.777 esi
Registration #16		11.777 es
Registration #17		11.777 esi
Registration #18		11.777 es
Registration #19		11.777 esi
Registration #20		11.777 es
Registration #21		11.777 es
Registration #22		10.707 au
Registration #23		11.777 ess

More info >



Car features

S0225	Air conditioning
S0295	
50482	
50501	
50566	
60567	
50569	

Safety ratings

NCAP rating	***
Video	see crash video



Dimensions & weight

Width	1784 mm
Height	1475 mm
Length	4182 mm
Wheel base	2600 mm
Kerb weight	1090 kg
Max. allowed weight	2600 kg

Additional information

Fuel tank capacity	58
Fuel delivery	Multi-Point Injection
Number of doors	3
Number of seats CarCheck.co.uk	5 page 15/15