



PEUGEOT



report date: 2024-03-28

General information

Make	PEUGEOT
Model	206 S
Colour	Blue
Year of manufacture	-
Top speed	112 mph
0 - 60 mph	11.6 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	90 BHP
Max. torque	205 Nm at 1.900 rpm
Cylinders	4
Fuel type	Diesel
Consumption city	42.8 mpg
Consumption extra urban	68.9 mpg
Consumption combined	56.5 mpg





LABEL UNKNOWN



Internet history

Entry 1

Date	2021-07-07
Pictures	11
Listing price	View report

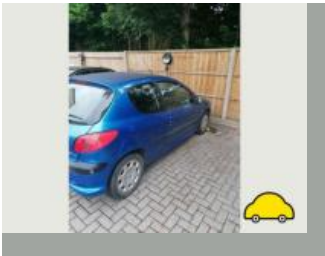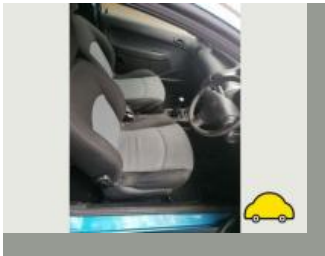

source: autotrader.co.uk

**MOT history****MOT #20**

2021-07-02 10:15

MOT test number

389348875535

Result**✗ Failed**

- Advice** Both front tyres wearing on inner edge
- Fail** Offside Front Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Fail** Exhaust emissions exceed manufacturer's specified limit 1.76 (8.2.2.2 (a))
- Advice** Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))
- Fail** Offside Headlamp aim projected beam image is obviously incorrect cloudy may require polish (4.1.2 (c))
- Advice** Front Inner Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))
- Advice** Nearside Side repeater slightly discoloured (4.4.3 (a))
- Advice** Engine covers and undertrays fitted obscuring components
- Fail** Nearside Front Brake hose excessively damaged (1.1.12 (b) (ii))
- Advice** Nearside Rear condensation inside light
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))
- Fail** Anti-lock braking system warning lamp does not illuminate (1.6 (a))
- Advice** Offside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
- Fail** Nearside Front Position lamp not working (4.2.1 (a) (ii))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** EML on
- Advice** Nearside Front Outer Tyre has a cut but not deep enough to reach the ply or cords (5.2.3 (d) (i))



MOT #19

2020-09-22 16:46

MOT test number

577129311596

Result

✓ Passed

- Advice

Central Lower Engine mounting damaged but not to excess worn (6.1.8 (a) (i))
- Advice

Front Inner Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))
- Advice

Both front tyres wearing on inner edge
- Advice

Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))
- Advice

Offside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
- Advice

Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice

Side repeater slightly discoloured both (4.4.3 (a))

**MOT #18**

2020-09-16 09:57

MOT test number

231432251793

Result**✗ Failed**

- Advice** Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Fail** Exhaust emissions exceed manufacturer's specified limit 1.76 (8.2.2.2 (a))
- Advice** Offside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
- Pass with rectification** Offside Headlamp aim too low (4.1.2 (a))
- Advice** Side repeater slightly discoloured both (4.4.3 (a))
- Fail** Nearside Front Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Advice** Front Inner Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))
- Fail** Anti-lock braking system warning lamp indicates an ABS fault (1.6 (b))
- Advice** Central Lower Engine mounting damaged but not to excess worn (6.1.8 (a) (i))
- Advice** Both front tyres wearing on inner edge
- Pass with rectification** Nearside Headlamp aim too low (4.1.2 (a))
- Fail** Nearside Front Position lamp not working (4.2.1 (a) (ii))
- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))



MOT #172019-09-23 16:38

MOT test number589677517625

Result		✓ Passed
Advice	Front Inner Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))	
Advice	Offside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))	
Advice	Engine covers and undertrays fitted obscuring components	
Advice	Nearside Side repeater slightly discoloured (4.4.3 (a))	
Advice	Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))	
Advice	Rear Brake hose has slight corrosion to ferrule both (1.1.12 (f) (i))	
Advice	Rear Registration plate deteriorated but not likely to be misread (0.1 (b))	

**MOT #16**

2019-09-19 10:07

MOT test number

778579792584

Result**✗ Failed**

- Advice** Rear Registration plate deteriorated but not likely to be misread (0.1 (b))
- Advice** Offside Front Suspension arm ball joint has slight play (5.3.4 (a) (i))
- Fail** Offside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Fail** Nearside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))
- Fail** Anti-lock braking system warning lamp does not illuminate (1.6 (a))
- Advice** Engine covers and undertrays fitted obscuring components
- Advice** Rear Brake hose has slight corrosion to ferrule both (1.1.12 (f) (i))
- Fail** Nearside Headlamp aim projected beam image is obviously incorrect (4.1.2 (c))
- Fail** Offside Front Anti-lock braking system component excessively damaged reluctor (1.6 (e))
- Fail** Offside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))
- Advice** Front Inner Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))
- Advice** Nearside Side repeater slightly discoloured (4.4.3 (a))
- Advice** Clutch noisy when tested

MOT #15

2018-09-28 09:27

MOT test number

349268271280

Result**✓ Passed**

- Advice** Offside Rear Tyre worn close to legal limit/worn on edge 185/65/14 (5.2.3 (e))

MOT #14

2017-10-12 13:37

MOT test number

370352248024

Result**✓ Passed**



MOT #13	2016-10-12 13:35
MOT test number	796110427971
Result	✓ Passed
Advice	Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

MOT #12	2015-10-28 11:59
MOT test number	219301169064
Result	✗ Failed
Advice	Rear tyres worn on inner edges
Fail	Rear fog lamp not working (1.3.2b)
Advice	Offside front tyre slightly perished in tread
Advice	Fuel tank strap corroded
Fail	Horn not working (1.6.2a)
Fail	Windscreen washer provides insufficient washer liquid (8.2.3)
Advice	Offside steering rack slight play
Advice	Front lower arm rear bushes starting to perish

MOT #11	2015-10-28 00:00
MOT test number	612180151746
Result	✓ Passed
Advice	Offside front tyre slightly perished in tread
Advice	Fuel tank strap corroded
Advice	Offside steering rack slight play
Advice	Front lower arm rear bushes starting to perish
Advice	Rear tyres worn on inner edges

**MOT #10** 2014-10-16 13:34**MOT test number** 535899184297**Result** ✓ Passed**Notice** Rear tyres worn inner edge**MOT #9** 2013-10-16 15:24**MOT test number** 395929283206**Result** ✓ Passed**MOT #8** 2012-10-17 10:06**MOT test number** 335141092211**Result** ✓ Passed**Notice** Nearside front tyre wearing on outer edge**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)**Notice** Slight noise front nearside rear wheel bearing on rotation**MOT #7** 2012-10-13 10:16**MOT test number** 265207482293**Result** ✗ Failed**Notice** Nearside front tyre wearing on outer edge**Fail** Nearside Headlamp not working on dipped beam (1.7.5a)**Fail** Offside Track rod end ball joint has excessive play (2.2.B.1f)**Notice** Slight noise front nearside rear wheel bearing on rotation**Fail** Windscreen washer provides insufficient washer liquid (8.2.3)**Fail** Nearside Headlamp aim not tested (1.8.A.1c)**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)

**MOT #6** 2011-10-17 11:46**MOT test number** 147540091276**Result** ✓ Passed**Advice** Offside Front Side repeater slightly discoloured (1.4.A.2f)**Advice** Nearside Front Side repeater slightly discoloured (1.4.A.2f)**MOT #5** 2010-10-18 12:39**MOT test number** 330461690297**Result** ✓ Passed**Advice** Rear Exhaust has part of the system slightly deteriorated (7.1.1a)**Advice** Front Brake pad(s) wearing thin (3.5.1g)**MOT #4** 2009-10-15 11:07**MOT test number** 164428989214**Result** ✓ Passed**MOT #3** 2008-10-24 09:12**MOT test number** 643288598252**Result** ✓ Passed**MOT #2** 2007-10-24 14:42**MOT test number** 354537197293**Result** ✓ Passed**Notice** N/s/f tyre small cut in side wall**Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)**Advice** Front Brake pad(s) wearing thin (3.5.1g)**Notice** Both front tyres on outside



MOT #12007-10-24 09:58

MOT test number934017597212

Result		✗ Failed
Notice	N/s/f tyre small cut in side wall	
Advice	Front Brake pad(s) wearing thin (3.5.1g)	
Notice	Both front tyres on outside	
Fail	Registration plate lamp not working (1.1.C.1d)	
Advice	Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)	



Damage history

Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this PEUGEOT? How many owners did this PEUGEOT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this PEUGEOT had different number plates.

Number of plates	1
Current registration	XXXXXX
Plate since	2020-01-01
Current registration	XXXXXX
Plate since	2020-01-01

More info >



Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this PEUGEOT is financed.

Finance company	XXXXXXXX XX
Date of agreement	XXXXXXXX XX
Agreement type	XXXXXXXX XX
Agreement term	XXXXXXXX XX
Agreement number	XXXXXXXX XX
Contact info	XXXXXXXX XX

More info >



Mileage check

Odometer	In miles
Mileage registrations	22
First mileage registration	2004-10-21
Last registration	2021-07-02
Complete history	See info



Registration #1	2004-10-21	20 mi
Registration #2	2007-10-24	20.319 mi
Registration #3	2007-10-24	20.319 mi
Registration #4	2008-10-24	25.346 mi
Registration #5	2009-10-15	30.332 mi
Registration #6	2010-10-18	34.308 mi
Registration #7	2011-10-17	36.049 mi
Registration #8	2012-10-13	44.949 mi
Registration #9	2012-10-17	45.053 mi
Registration #10	2013-10-16	54.324 mi
Registration #11	2014-10-16	61.620 mi
Registration #12	2015-10-16	71.377 mi
Registration #13	2016-10-16	81.377 mi
Registration #14	2017-10-16	91.377 mi
Registration #15	2018-10-16	101.377 mi
Registration #16	2019-10-16	111.377 mi
Registration #17	2020-10-16	121.377 mi
Registration #18	2021-10-16	131.377 mi
Registration #19	2022-10-16	141.377 mi
Registration #20	2023-10-16	151.377 mi
Registration #21	2024-10-16	161.377 mi
Registration #22	2025-10-16	171.377 mi

More info >



Car features

The PEUGEOT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete PEUGEOT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★★

Video [see crash video](#)



Dimensions & weight

Width	1652 mm
Height	1433 mm
Length	3822 mm
Wheel base	2445 mm
Kerb weight	1145 kg

Additional information

Fuel tank capacity	50 l
Fuel delivery	Direct Injection
Number of doors	3
Engine number	DYNV3031242