





report date: 2024-03-29

General information

| Make | PEUGEOT |
|---------------------|----------------------------|
| Model | 206 ALLURE COUPE CABRIOLET |
| Colour | Black |
| Year of manufacture | 2006 |
| Top speed | 120 mph |
| 0 - 60 mph | 11.3 seconds |
| Gearbox | 5 speed Manual |

Engine & fuel consumption

| Power | 107 BHP |
|-------------------------|---------------------|
| Max. torque | 147 Nm at 4.000 rpm |
| Engine capacity | 1.587 cc |
| Cylinders | 4 |
| Fuel type | Petrol |
| Consumption city | 29.7 mpg |
| Consumption extra urban | 49.6 mpg |
| Consumption combined | 40.4 mpg |
| CO2 emission | 166 g/km |
| CO2 label | Н |



CarCheck.co.uk page 1/15



KX56WGW
report date: 2024-03-29

Internet history

Entry 2

Date 2021-06-10

Pictures 13

Listing price <u>View report</u>









source: autotrader.co.uk

Entry 1

| Date | 2021-06-05 |
|---------------|-------------|
| Pictures | 1 |
| Listing price | View report |



source: autotrader.co.uk

CarCheck.co.uk page 2/15



KX56WGW
report date: 2024-03-29

MOT history

| MOT expiry date | 2025-04-27 |
|--------------------|------------|
| MOT pass rate | 73 % |
| MOT passed | 16 |
| Failed MOT tests | 6 |
| Total advice items | 33 |
| Total items failed | 13 |

| MOT #22 | 2024-04-26 14:29 |
|------------------|------------------|
| MOT test number | 446103453433 |
| Result | ✓ Passed |
| Next expiry date | 2025-04-27 |

| MOT #21 | 2023-04-28 12:50 |
|-----------------|------------------|
| MOT test number | 745774783055 |
| Result | ✓ Passed |

CarCheck.co.uk page 3/15



report date: 2024-03-29

MOT #20 2023-02-21 12:24

MOT test number 291848396019

Result X Failed

MAJOR Front Exhaust has a major leak of exhaust gases joiner after catalysis (6.1.2 (a))

MAJOR Nearside Front Outer Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

Advice Offside Front Nail in tyre

MAJOR Offside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))

DANGEROUS Offside Front Outer Tyre has a tear, caused by separation or partial failure of its structure (5.2.3 (d) (ii))

MAJOR Offside Front Outer Track rod end ball joint dust cover insecure so that it no longer prevents the ingress of dirt (2.1.3 (g) (ii))

MAJOR Offside Front Headlamp light intensity severely reduced (4.1.4 (a))

Advice Offside Rear Inner Tyre slightly damaged/cracking or perishing outer (5.2.3 (d) (ii))

Advice Offside Front Inner Drag link end ball joint has slight play tie rod (2.1.3 (b) (i))

MAJOR Offside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

MAJOR Nearside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))

Advice Clutch slipping

Advice Offside Rear Nail in tyre

MAJOR Nearside Front Outer Track rod end ball joint dust cover insecure so that it no longer prevents the ingress of dirt (2.1.3 (g) (ii))

MAJOR Offside Front Position lamp not working (4.2.1 (a) (ii))

Advice Front Inner Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Advice Nearside Front Inner Drag link end ball joint has slight play tie rod (2.1.3 (b) (i))

MOT #19 2022-02-23 11:29

MOT test number 259139812341

Result ✓ Passed

CarCheck.co.uk page 4/15



report date: 2024-03-29

MOT #18 2022-02-22 15:45

MOT test number 791597328966

Result X Failed

MAJOR Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

MAJOR Exhaust noise is clearly in excess of that emitted by a similar vehicle fitted with a standard silencer in average condition (8.1.1 (a))

MAJOR Parking brake efficiency below requirements (1.4.2 (a) (i))

MAJOR Front Exhaust has a major leak of exhaust gases pipe (6.1.2 (a))

MAJOR Offside Front Upper Anti-roll bar ball joint dust cover no longer prevents the ingress of dirt (5.3.4

(b) (ii))

MOT #17 2021-02-11 15:25

MOT test number 919295299018

Result ✓ Passed

MOT #16 2020-02-24 11:02

MOT test number 419862648536

Result ✓ Passed

MOT #15 2018-10-01 10:34

MOT test number 540310720411

Result
✓ Passed

MOT #14 2017-10-24 15:41

MOT test number 832924257974

Result \(\sqrt{Passed} \)

Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)

Advice Offside Play in steering rack inner joint(s)

CarCheck.co.uk page 5/15



report date: 2024-03-29

MOT #13 2017-10-24 09:09 **MOT** test number 358343028901 Result × Failed Fail Rear Brakes imbalanced across an axle Axle 2 (3.7.B.5b) **Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1) **Fail** Offside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1) **Advice** Offside Play in steering rack inner joint(s) Fail Service brake: efficiency below requirements (3.7.B.7) Fail Rear Brake pad(s) less than 1.5 mm thick (3.5.1g) Nearside Rear Tyre tread depth below requirements of 1.6mm 205 45 16 (4.1.E.1) Fail Fail Exhaust system not adequately supported back box (7.1.1) Fail Offside Registration plate lamp not working (1.1.C.1d)

MOT #12

MOT test number

568529819184

Result

Advice Exhaust has a minor leak of exhaust gases (7.1.2)

MOT #11

Result

Fail Parking brake: efficiency below requirements (3.7.B.7)

Fail Windscreen wiper does not clear the windscreen effectively (8.2.2)

Advice Rear Brake pad(s) wearing thin (3.5.1g)

Fail Offside rear parking brake recording little or no effort (3.7.B.6a)

CarCheck.co.uk page 6/15



report date: 2024-03-29

MOT #10 2015-10-07 11:59

MOT test number 507766287130

Result ✓ Passed

MOT #9 2015-10-07 11:59

MOT test number 699950018535

Result X Failed

Pass with rectification Nearside Front Headlamp not working on dipped beam (1.7.5a)

Pass with rectification Offside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)

MOT #8 2015-03-19 15:29

MOT test number 768578075021

Result \rightarrow Passed

MOT #7 2014-03-25 14:58

MOT test number 138974884022

Result ✓ Passed

Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)

MOT #6 2013-03-01 12:08

MOT test number 239420263001

MOT #5 2013-02-22 10:16

MOT test number 997293053070

Result X Failed

Fail Offside Front Suspension arm has excessive play in a ball joint (2.4.G.2)

CarCheck.co.uk page 7/15



report date: 2024-03-29

MOT #4 2012-02-15 10:23

MOT test number 105126042474

MOT #3 2011-02-25 11:49

MOT test number 637156451084

Result

Passed

MOT #2 2010-02-05 14:40

MOT test number 502676430058

Result ✓ Passed

Advice Offside Inner Front Tyre worn close to the legal limit (4.1.E.1)

Notice Nail in nearside front tyre

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

MOT #1 2009-02-04 14:57

MOT test number 552465039030

Advice Offside Rear Brake pad(s) wearing thin (3.5.1g)

CarCheck.co.uk page 8/15





report date: 2024-03-29

Tax & MOT check



| Tax status | Valid until 1 June |
|------------------|--------------------|
| Days left | 32 |
| MOT expiry date | 27 April 2025 |
| Full MOT history | See MOT history |

Tax calculation

| Vehicle class | 48 |
|---|------------|
| Band | Н |
| Single payment (12 months) | £ 290,00,- |
| Single six month payment | £ 159,50,- |
| Total payable by 12 monthly instalments | £ 304,50,- |

CarCheck.co.uk page 9/15



report date: 2024-03-29

Damage history

Check the damage history for this PEUGEOT. See if, where and when this PEUGEOT had damage and the car repair costs. We also check if this PEUGEOT was scrapped. Download the premium report here for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



Extra PEUGEOT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 10/15



report date: 2024-03-29

Vehicle valuation

What is this car worth? See the vehicle value of this PEUGEOT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 11/15



KX56WGW
report date: 2024-03-29

| Owner history | | |
|---|---------------|-----|
| For how long did the current and previous owner(s) have this PEUGEOT? How many owner have? Check it in the premium report and see all owner registrations. Download the full is | | EOT |
| ******** | | |
| | | |
| *************************************** | | |
| *************************************** | | |
| | | |
| *************************************** | | |
| | More info > | |
| Plate changes | | |
| See in this check if this PEUGEOT had different number plates. | | |
| Number of plates | | |
| Current registration | UK CONTRACTOR | |
| Plate since | | |
| Current registration | UK CONTRACTOR | |
| Plate since | | |
| | More info > | |

CarCheck.co.uk page 12/15



report date: 2024-03-29

Finance check

Check if this PEUGEOT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this PEUGEOT has been settled.

If not, and you buy this PEUGEOT then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this PEUGEOT is financed.

Finance company

Date of agreement

Agreement type

Agreement term

Agreement number

Contact info

More info >


CarCheck.co.uk page 13/15



report date: 2024-03-29

Mileage check

| Odometer | In miles |
|----------------------------|------------|
| Mileage registrations | 25 |
| First mileage registration | 2006-09-30 |
| Last registration | 2024-04-26 |
| Complete history | See info |

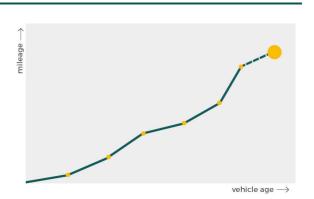

| Registration #1 | 2006-09-30 | 9 mi |
|--|------------|-----------|
| Registration #2 | 2009-02-04 | 11.296 mi |
| Registration #3 | 2010-02-05 | 17.972 mi |
| Registration #4 | 2011-02-25 | 21.600 mi |
| Registration #5 | 2012-02-15 | 27.361 mi |
| Registration #6 | 2013-02-22 | 32.174 mi |
| Registration #7 | 2013-03-01 | 32.223 mi |
| Registration #8 | 2014-03-25 | 37.096 mi |
| Registration #9 | 2015-03-19 | 38.113 mi |
| Registration #10 | 2015-10-07 | 38.971 mi |
| Registration #11 | 2015-10-07 | 38.971 mi |
| Registration #12 | 2016-08-30 | 41.894 mi |
| Registration #13 | 2016-10-03 | 42.217 mi |
| | | |
| Registration #14 | | 11.177 es |
| Registration #14 Registration #15 | | 11.777 es |
| | | |
| Registration #15 | | |
| Registration #15 Registration #16 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 Registration #18 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 | | 11.777 mi |
| Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21 Registration #22 Registration #22 | | 11.777 mi |



report date: 2024-03-29

Car features

| S0225 | Air conditionin |
|-------|-----------------|
| S0295 | |
| S0482 | |
| S0501 | |
| S0566 | |
| S0567 | |
| 50569 | |

Safety ratings

| NCAP rating | *** |
|-------------|-----------------|
| Video | see crash video |



Dimensions & weight

| Width | 1673 mm |
|---------------------|---------|
| Height | 1373 mm |
| Length | 3835 mm |
| Wheel base | 2442 mm |
| Kerb weight | 1215 kg |
| Max. allowed weight | 1535 kg |

Additional information

| Fuel tank capacity | 47 |
|-----------------------------------|-----------------------|
| Fuel delivery | Multi-Point Injection |
| Number of doors | 2 |
| Number of seats CarCheck.co.uk | 4 page 15/1: |

Number of axles 2

Engine number FX6N2895274