





report date: 2024-03-29

General information

Make	AUDI
Model	A4 TDI S LINE
Colour	Silver
Year of manufacture	2008
Top speed	134 mph
Gearbox	6 speed Manual

Engine & fuel consumption

Power	143 BHP
Max. torque	320 Nm at 2.100 rpm
Engine capacity	1.968 cc
Cylinders	4
Fuel type	Diesel
Consumption city	36.7 mpg
Consumption extra urban	65.7 mpg
Consumption combined	51.4 mpg
CO2 emission	139 g/km
CO2 label	E



CarCheck.co.uk page 1/16



report date: 2024-03-29

Internet history

Entry 1

Date 2021-01-27

Pictures 10

Listing price <u>View report</u>









source: autoonline.co.uk

CarCheck.co.uk page 2/16



report date: 2024-03-29

MOT history

MOT expiry date	2024-11-03
MOT pass rate	72 %
MOT passed	13
Failed MOT tests	5
Total advice items	49
Total items failed	13

MOT #18	2023-10-16 13:06
MOT test number	565932115580
Result	✓ Passed
Next expiry date	2024-11-03
Advice Nearside Rear Child Seat fitted not allowing full inspection of adult belt	
Advice Offside Front Upper Suspension arm pin or bush worn but not resulting in excessive movement	
Both upper arms, inner bushes perished (5.3.4 (a) (i))	
Advice Nearside Front Upper Suspension arm pin or bush worn but not resulting in excessive movement	
Both upper arms, inner bushes perished (5.3.4 (a) (i))	
Advice Front Lower Suspension arm pin or bush worn but not resulting in excessive movement Both front	
lower arm centre bushes perished, both sides (5.3.4 (a) (i))	
Advice Front Tyre worn close to legal limit/worn on edge Both front tyres on 2mm	n (5.2.3 (e))

MOT #17	2022-10-17 15:24
MOT test number	989592042804
Result	✓ Passed
Advice Front Suspension arm pin or bush worn but not resulting in excessive move front lower arms on both sides of car (5.3.4 (a) (i))	ement Central bushes in
Minor Offside Obligatory mirror slightly loose Wing mirror (3.3 (b) (i))	
Advice Central Lower Exhaust has a minor leak of exhaust gases (6.1.2 (a))	
Advice Nearside Rear Child Seat fitted not allowing full inspection of adult belt	

CarCheck.co.uk page 3/16



report date: 2024-03-29

MOT #16 2021-10-11 09:13

MOT test number 869120047012

MOT #15 2020-11-04 15:39

MOT test number 235225914081

Result
✓ Passed

Advice Offside Front Brake disc worn, but not excessively (1.1.14 (a) (i))

Advice Nearside Front Brake disc worn, but not excessively (1.1.14 (a) (i))

MOT #14 2020-11-04 15:15

MOT test number 247236869452

Result X Failed

Advice Nearside Front Brake disc worn, but not excessively (1.1.14 (a) (i))

Fail Engine MIL inoperative or indicates a malfunction (8.2.2.2 (g))

Advice Offside Front Brake disc worn, but not excessively (1.1.14 (a) (i))

MOT #13 2019-10-05 08:40

MOT test number 657339473588

Result

Passed

Advice Central Exhaust has a minor leak of exhaust gases joint/sleeve (6.1.2 (a))

MOT #12 2019-10-04 14:48

MOT test number 271724502611

Result × Failed

Advice Central Exhaust has a minor leak of exhaust gases joint/sleeve (6.1.2 (a))

Fail Central Seat belt buckle not functioning as intended (7.1.2 (d))

Fail Offside Front Brake hose excessively twisted (1.1.12 (b) (ii))

CarCheck.co.uk page 4/16



MOT #11

SG580EX

report date: 2024-03-29

2018-09-28 14:07

MOT test number

Result

Advice Under Tray Fitted

Advice Offside Front Upper Suspension arm pin or bush worn but not resulting in excessive movement Both (5.3.4 (a) (i))

Advice Offside Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Advice Engine Cover Fitted

Advice Nearside Front Upper Suspension arm pin or bush worn but not resulting in excessive movement Both (5.3.4 (a) (i))

Advice Nearside Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Advice Offside Front Headlight Cleaning device Inoperative

Advice Nearside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b))

CarCheck.co.uk page 5/16



Advice

Advice

SG580EX

report date: 2024-03-29

MOT #10 2018-09-28 08:36

MOT test number 327670860966

Result × Failed **Advice** Nearside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)) Fail Offside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i)) Fail Nearside Rear Inner Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii)) Fail Offside Front Windscreen washer jets misaligned and not providing sufficient fluid to the windscreen (3.5 (a)) Advice Offside Rear Reverse light Bulb not Working **Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Advice **Under Tray Fitted** Advice Offside Front Upper Suspension arm pin or bush worn but not resulting in excessive movement Both (5.3.4 (a) (i)) Advice **Engine Cover Fitted** Offside Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)) Advice Advice Nearside Front Shock absorbers light misting of oil or has limited damping effect (5.3.2 (b)) Advice Offside Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii)) Fail Offside Rear Coil spring fractured or broken (5.3.1 (b) (i)) Fail Offside Rear Tyre tread depth below requirements of 1.6mm Bridgestone 245/40 R18 93Y S001 (5.2.3 (e)) **Advice** Nearside Front Upper Suspension arm pin or bush worn but not resulting in excessive movement Both (5.3.4 (a) (i))

CarCheck.co.uk page 6/16

Nearside Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

Offside Front Headlight Cleaning device Inoperative



report date: 2024-03-29

MOT test number

Result

Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)

Advice Front registration plate deteriorated but not likely to be misread (6.3.1d)

MOT #8

MOT test number

Result

MOT test number

Advice

2016-09-29 13:33

146864572429

Passed

2015-09-30 14:50

2015-09-30 14:50

360222019324

Passed

Advice

Engine Covers And Undertrays Obscuring Some Components

MOT #6

MOT test number

139293831957

Result

Fail Nearside Front suspension has excessive play in a lower suspension ball joint Forward Most (2.5.B.1a)

Advice Engine Covers And Undertrays Obscuring Some Components

 MOT #5
 2014-09-10 09:52


 MOT test number
 898513154202

 Result
 ✓ Passed

CarCheck.co.uk page 7/16



report date: 2024-03-29

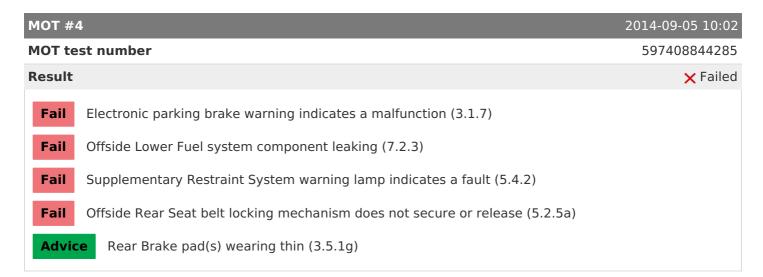

MOT #3		2013-09-04 14:51
MOT test	number	226237043276
Result		✓ Passed
Notice	Front tyres worn low on inner edges .	
Notice	Centre exhaust sleeve badly corroded	
Advice	Offside Rear Brake pad(s) wearing thin (3.5.1g)	
Notice	Front brake discs badly worn	
Notice	Nearside rear tyre worn on inner edge of tread	

MOT #2		2012-09-07 11:11
MOT test	number	847771152233
Result		✓ Passed
Notice	0 reading on emissions	
Advice	Offside Front Brake pad(s) wearing thin (3.5.1g)	
Notice	Front brake discs havelarge amount of wear	
Advice	Nearside Front Brake pad(s) wearing thin (3.5.1g)	

CarCheck.co.uk page 8/16



report date: 2024-03-29

MOT #1 2011-09-05 12:12

MOT test number 309248741459

CarCheck.co.uk page 9/16



report date: 2024-03-29

Tax & MOT check



Tax status	Valid until 1 January
Days left	246
MOT expiry date	3 November 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	49
Band	Е
Single payment (12 months)	£ 180,00,-
Single six month payment	£ 99,00,-
Total payable by 12 monthly instalments	£ 189,00,-

CarCheck.co.uk page 10/16



report date: 2024-03-29

Damage history

Check the damage history for this AUDI. See if, where and when this AUDI had damage and the car repair costs. We also check if this AUDI was scrapped. Download the premium report here for the results.

Damage 1	
Date	
Category	
Туре	
Damage 2	
Date	
Category	
Туре	



Extra AUDI salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 11/16



report date: 2024-03-29

Vehicle valuation

What is this car worth? See the vehicle value of this AUDI in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 12/16



faste since

SG580EX

report date: 2024-03-29

More info >

Owner history For how long did the current and previous owner(s) have this AUDI? How many owners did this AUDI have? Check it in the premium report and see all owner registrations. Download the full report <u>here</u>. More info > Plate changes See in this check if this AUDI had different number plates. about of pliates

CarCheck.co.uk page 13/16



report date: 2024-03-29

Finance check

Check if this AUDI is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this AUDI has been settled.

If not, and you buy this AUDI then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this AUDI is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

More info >

CarCheck.co.uk page 14/16



report date: 2024-03-29

Mileage check

Odometer	In miles
Mileage registrations	20
First mileage registration	2008-09-05
Last registration	2023-10-16
Complete history	See info



Registration #1	2008-09-05	29 mi
Registration #2	2011-09-05	31.566 mi
Registration #3	2012-09-07	43.083 mi
Registration #4	2013-09-04	53.476 mi
Registration #5	2014-09-05	68.202 mi
Registration #6	2014-09-10	68.300 mi
Registration #7	2015-09-30	84.245 mi
Registration #8	2015-09-30	84.245 mi
Registration #9	2016-09-29	97.363 mi
Registration #10	2017-09-28	112.507 mi
Registration #11		9.70 es
Registration #12		11.777 es
Registration #13		9.70 es
Registration #14		11.777 es
Registration #15		9.70 es
Registration #16		11.777 es
Registration #17		9.70 es
Registration #18		11.777 es
Registration #19		11.777 es
Registration #20		71.777 au

More info >

CarCheck.co.uk page 15/16



report date: 2024-03-29

Car features

S0225	Air conditioning
S0295	
50482	
50501	
50566	
50567	
50569	

Safety ratings

NCAP rating	****
Video	see crash video



Dimensions & weight

Width	1826 mm
Height	1427 mm
Length	4703 mm
Wheel base	2808 mm
Kerb weight	1460 kg
Max. allowed weight	2015 kg

Additional information

Fuel tank capacity	65 I	
Fuel delivery	Direct Injection	
Number of doors	4	
Number of seats CarCheck.co.uk	5	page 16/16

Number of axles 2

Engine number CAG 086516