





report date: 2024-03-29

General information

Make	AUDI
Model	TT ROADSTER 150
Colour	Blue
Year of manufacture	-
Top speed	133 mph
Gearbox	5 speed Manual

Engine & fuel consumption

Power	150 BHP
Max. torque	210 Nm at 1.750 rpm
Cylinders	4
Fuel type	Petrol
Consumption city	25.0 mpg
Consumption extra urban	43.5 mpg
Consumption combined	34.0 mpg



CarCheck.co.uk page 1/15



report date: 2024-03-29

Internet history

Entry 1

Date 2021-01-28

Pictures 10

Listing price <u>View report</u>









source: autoonline.co.uk

CarCheck.co.uk page 2/15



report date: 2024-03-29

✓ Passed

MOT history

Result

MOT #23	2021-08-04 19:39
MOT test number	740250908924
Result	✓ Passed
Next expiry date	2022-08-03

MOT #22 2021-07-30 08:51

MOT test number 164187303487

Result × Failed

Fail Offside Steering rack gaiter missing or no longer prevents the ingress of dirt (2.1.3 (g) (ii))

Fail Offside Side repeater not working (4.4.1 (a) (ii))

Fail Registration plate lamp inoperative in the case of a single lamp or all lamps n/s + o/s (4.7.1 (b) (ii))

Fail Offside Rear Coil spring fractured or broken (5.3.1 (b) (i))

 MOT #21
 2020-06-06 10:20

 MOT test number
 233371792328

MOT #20 2020-03-12 10:55

MOT test number 804295262046

Result × Failed

Fail Nearside Rear Brake disc contaminated (1.1.14 (b))

Fail Offside Sub-frame corroded and seriously weakened (5.3.3 (b) (i))

Fail Nearside Rear Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))

Fail Nearside Rear Service brake excessively binding (1.2.1 (f))

CarCheck.co.uk page 3/15



report date: 2024-03-29

MOT #19 2020-02-07 09:40

MOT test number 394476102246

Result X Failed

Fail Front Sub-frame corroded to the extent that the rigidity of the assembly is significantly reduced (6.1.1 (c) (i))

Fail Nearside Rear Service brake excessively binding (1.2.1 (f))

Advice Offside Rear Axle swivel pins and bushes swivel pin and/or bush slightly worn (5.1.2 (b) (i))

Fail Offside Front Suspension arm pin or bush excessively worn (5.3.4 (a) (i))

Advice Nearside Rear Axle swivel pins and bushes swivel pin and/or bush slightly worn (5.1.2 (b) (i))

MOT #18 2019-01-26 10:39

MOT test number 931057793749

Advice Nearside Rear Brake hose has slight corrosion to ferrule Axle (1.1.12 (f) (i))

Advice Front Undertray not fully secure (8.1.1 (b) (i))

Advice Engine oil level overfilled

Advice Offside Front Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))

Advice Offside Rear Brake hose has slight corrosion to ferrule Axle (1.1.12 (f) (i))

Advice Front Exhaust has a minor leak of exhaust gases Connecton after Cat (6.1.2 (a))

Advice Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Advice Nearside Front Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))

CarCheck.co.uk page 4/15



report date: 2024-03-29

MOT #17 2018-02-23 09:33 **MOT** test number 393339932668 Result ✓ Passed **Advice** Nearside Rear Brake pipe slightly corroded (3.6.B.2c) Advice Nearside Rear Shock absorber has slight corrosion to the casing (2.7.2a) Offside Rear coil spring corroded (2.4.C.1b) Advice Oil leak Advice Advice Offside Rear Brake pipe slightly corroded (3.6.B.2c) Offside Rear Shock absorber has slight corrosion to the casing (2.7.2a) Advice **Advice** Vehicles internal headlight adjuster altered to recheck lights

MOT #16 2018-02-23 09:33 **MOT** test number 313899815366 X Failed Result Nearside Rear Brake pipe slightly corroded (3.6.B.2c) **Advice** Advice Nearside Rear Shock absorber has slight corrosion to the casing (2.7.2a) Advice Offside Rear coil spring corroded (2.4.C.1b) Pass with rectification Nearside Headlamp aim too low (1.8) Oil leak Advice Offside Rear Brake pipe slightly corroded (3.6.B.2c) Advice Advice Offside Rear Shock absorber has slight corrosion to the casing (2.7.2a) Advice Vehicles internal headlight adjuster altered to recheck lights Pass with rectification Offside Headlamp aim too low (1.8)

CarCheck.co.uk page 5/15



report date: 2024-03-29

MOT #15 2017-02-28 12:44

MOT test number 825261351467

Result ✓ Passed

Advice Nearside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement rear bush split (2.4.G.2)

Advice Nearside Rear Exhaust has a minor leak of exhaust gases exhaust badly corroded and blowing from backbox (7.1.2)

MOT #14 2016-02-27 11:39

MOT test number 810092699657

Result ✓ Passed

Advice Centre exhaust hanger cracked

MOT #13 2015-02-26 13:15

MOT test number 749687955019

Result

Passed

Notice Under-trays fitted obscuring some underside components

Notice Nsr tyre badly perished/cracked

Advice Offside Front Tyre worn close to the legal limit (4.1.E.1)

Notice Nsf wishbone bush wear

Notice Osf tyre inner edge worn

Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)

Notice Engine covers fitted obscuring some components in the engine bay

Notice Osr tyre perishing

Notice Nsf tyre inner edge wear

CarCheck.co.uk page 6/15



report date: 2024-03-29

MOT #12	2014-02-28 15:06
MOT test number	347959954041
Result	✓ Passed
Notice Under-trays fitted obscuring some underside com	ponents
Notice Engine covers fitted obscuring some components	in the engine bay

MOT #11		2013-02-25 10:00
MOT test	number	906146153012
Result		✓ Passed
Notice	Under-trays fitted obscuring some underside components	
Notice	Engine covers fitted obscuring some components in the engine bay	

MOT #10	2012-02-25 11:42
MOT test number	119456952448
Result	✓ Passed
Advice Nearside Front Suspension arm has slight play in a pin/bush (2.4.G.2)	

MOT #9	2011-02-26 11:39
MOT test number	397457251005
Result	✓ Passed

MOT #8	2010-03-03 13:02
MOT test number	103192760061
Result	✓ Passed

CarCheck.co.uk page 7/15



report date: 2024-03-29

MOT test number

Failed

Advice Nearside Front Suspension arm has slight play in a pin/bush (2.4.G.2)

Pass with rectification Offside Registration plate lamp not working (1.1.5c)

Advice Front Anti-roll bar has slight play in a pin/bush (2.4.G.2)

Pass with rectification Offside Windscreen wiper does not clear the windscreen effectively (8.2.2)

MOT test number
931353769024

Result

Advice Front Anti-roll bar has slight play in a pin/bush (2.4.G.2)

Advice Nearside Front Suspension arm has slight play in a pin/bush (2.4.G.2)

MOT #5		2008-07-17 11:54
MOT test	number	961529998181
Result		✓ Passed
Advice	Front Anti-roll bar synthetic bush deteriorated but not resulting in exces	sive movement (2.4.G.2)
Advice Nearside Front Bonded suspension unit deteriorated but can function as intended (2.4.F.3)		
Advice Parking brake: parking brake efficiency only just met. It would appear that the braking system requires adjustment or repair. (3.7.B.7)		

CarCheck.co.uk page 8/15



Advice

Advice

NC03HVH

report date: 2024-03-29

MOT #4 2008-07-09 09:36 194831998154 **MOT** test number Result × Failed **Advice** Front Anti-roll bar synthetic bush deteriorated but not resulting in excessive movement (2.4.G.2) Notice Exhaust centre section bracket snapped Fail Offside Rear coil spring cracked (2.4.C.1a) Advice Nearside Front Bonded suspension unit deteriorated but can function as intended (2.4.F.3) **Notice** Both rear tyre side walls perished Fail Front brake application uneven (3.7.B.2)

MOT #3	2008-06-05 16:02
MOT test number	374107358172
Result	✓ Passed
MOT #2	2007-07-27 09:39
MOT test number	744288907289
Result	✓ Passed
MOT #1	2006-06-06 11:09
MOT test number	202237256108
Result	✓ Passed

Offside Front Tyre worn close to the legal limit (4.1.E.1)

Nearside Front Tyre worn close to the legal limit (4.1.E.1)

CarCheck.co.uk page 9/15



report date: 2024-03-29

Damage history

Check the damage history for this AUDI. See if, where and when this AUDI had damage and the car repair costs. We also check if this AUDI was scrapped. Download the premium report here for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



Extra AUDI salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 10/15



report date: 2024-03-29

Vehicle valuation

What is this car worth? See the vehicle value of this AUDI in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value

Auction value

Average private trade value

More info >

CarCheck.co.uk page 11/15



report date: 2024-03-29

Owner history

For how long did the current and previous owner(s) have this AUDI? How many owners di Check it in the premium report and see all owner registrations. Download the full report <u>k</u>	

THE STATE OF THE S	

	More info >
Plate changes	
See in this check if this AUDI had different number plates.	
Number of plates	
Current registration	UK UK
Plate since	mm.m.m
Current registration	UK UK
Plate since	
	More info >

CarCheck.co.uk page 12/15



report date: 2024-03-29

Finance check

Check if this AUDI is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this AUDI has been settled.

If not, and you buy this AUDI then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this AUDI is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

Contact info

More info >


CarCheck.co.uk page 13/15



report date: 2024-03-29

Mileage check

Odometer	In miles
Mileage registrations	24
First mileage registration	2003-06-12
Last registration	2021-08-04
Complete history	See info

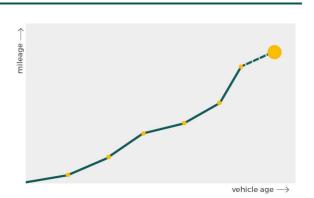

Registration #1	2003-06-12	12 mi
Registration #2	2006-06-06	22.996 mi
Registration #3	2007-07-27	32.914 mi
Registration #4	2008-06-05	39.202 mi
Registration #5	2008-07-09	39.758 mi
Registration #6	2008-07-17	39.759 mi
Registration #7	2009-03-04	39.832 mi
Registration #8	2010-03-03	49.550 mi
Registration #9	2011-02-26	58.177 mi
Registration #10	2012-02-25	66.025 mi
	2012.02.25	70.486 mi
Registration #11	2013-02-25	70.400 1111
Registration #11 Registration #12	2013-02-25	73.571 mi
Registration #12	2014-02-28	
Registration #12 Registration #13	2014-02-28	
Registration #12 Registration #13 Registration #14	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20	2014-02-28	
Registration #12 Registration #13 Registration #14 Registration #15 Registration #16 Registration #17 Registration #18 Registration #19 Registration #20 Registration #21	2014-02-28	

More info >



report date: 2024-03-29

Car features

S0225	Air conditioning
S0295	
50482	
50501	
50566	
50567	
50569	

Safety ratings

NCAP rating	****
Video	see crash video



Dimensions & weight

Width	1856 mm
Height	1348 mm
Length	4041 mm
Wheel base	2429 mm
Kerb weight	1335 kg
Max. allowed weight	1635 kg

Additional information

Fuel tank capacity	55 I	
Fuel delivery	Multi-Point Injection	
Number of doors	2	
Number of axles CarCheck.co.uk	2 page	15/15