





report date: 2024-03-29

### General information

Make	CITROEN
Model	C2 HDI DESIGN
Colour	Yellow
Year of manufacture	2005
Top speed	103 mph
0 - 60 mph	13.5 seconds
Gearbox	5 speed Manual

### Engine & fuel consumption

Power	67 BHP
Max. torque	160 Nm at 1.750 rpm
Engine capacity	1.398 сс
Cylinders	4
Fuel type	Diesel
Consumption city	55.4 mpg
Consumption extra urban	76.4 mpg
Consumption combined	67.3 mpg
CO2 emission	107 g/km
CO2 label	В



CarCheck.co.uk page 1/17



report date: 2024-03-29

# Internet history

### Entry 1

Date 2021-12-19

Pictures 17

Listing price <u>View report</u>









source: autotrader.co.uk

CarCheck.co.uk page 2/17



report date: 2024-03-29

	_			
MO	1	hic	to	r\/
				ıv.
				. ,

MOT expiry date	2024-11-17
MOT pass rate	65 %
MOT passed	17
Failed MOT tests	9
Total advice items	43
Total items failed	31

MOT #26	2023-10-28 10:01
MOT test number	797734295571
Result	<b>✓</b> Passed
Next expiry date	2024-11-17

MOT #25	2023-10-28 10:01
MOT test number	641977253235
Result	<b>▼</b> Failed
Pass with rectification	Nearside Front Headlamp not working on main beam (4.1.1 (a) (ii))
Pass with rectification (b) (i))	Nearside Front Outer Track rod end ball joint has excessive play loose nut (2.1.3

MOT #24	20	22-11-18 12:02
MOT test	number	635659706988
Result		✓ Passed
Advice	Front Registration plate deteriorated but not likely to be misread (0.1 (b))	
Advice (a) (i))	Offside Front Macpherson strut pin or bush worn but not resulting in excessive move	ment (5.3.4
Advice (i))	Offside Rear Suspension arm pin or bush worn but not resulting in excessive movem	ent (5.3.4 (a)
Advice (a) (i))	Nearside Rear Suspension arm pin or bush worn but not resulting in excessive move	ment (5.3.4
Advice	Front subframe corroded	

CarCheck.co.uk page 3/17



Front subframe corroded

**Advice** 

SB54WRT

report date: 2024-03-29

**MOT #23** 2022-11-16 12:03 599117448233 **MOT** test number Result × Failed **Advice** Nearside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i)) **Advice** Offside Front Macpherson strut pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i)) Advice Front Registration plate deteriorated but not likely to be misread (0.1 (b)) **Advice** Offside Rear Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i)) Fail Nearside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))

MOT #22

MOT test number

496280911343

Result

✓ Passed

**MOT #21** 2021-11-12 12:01 **MOT** test number 803467460442 Result × Failed Fail Nearside Rear Tyre tread depth below requirements of 1.6mm (5.2.3 (e)) Fail Offside Front Side repeater not working (4.4.1 (a) (ii)) **Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) **Advice** Nearside Side repeater slightly discoloured (4.4.3 (a)) Minor Offside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

CarCheck.co.uk page 4/17



report date: 2024-03-29

MOT #20 2021-01-22 14:01

**MOT** test number 770368993525

✓ Passed Result Advice Coolant reservoir empty Offside Rear Brake hose slightly deteriorated (1.1.12 (b) (ii)) Advice Advice Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Advice Rear Coil spring corroded Both sides (5.3.1 (b) (i)) Advice Oil leak, but not excessive (8.4.1 (a) (i)) Advice Underbody corroded Advice Nearside Front Lower Suspension arm pin or bush worn but not resulting in excessive movement

Front bush (5.3.4 (a) (i))

**Advice** Offside Rear Brake hose has slight corrosion to ferrule (1.1.12 (f) (i))

CarCheck.co.uk page 5/17



report date: 2024-03-29

**MOT #19** 2021-01-21 13:34

**MOT test number** 899948035346

Result X Failed

Fail Nearside Rear Brake hose excessively deteriorated + spring clip heavily corroded (1.1.12 (b) (ii))

Advice Rear Brake hose has slight corrosion to ferrule Both sides (1.1.12 (f) (i))

**Advice** Nearside Front Lower Suspension arm pin or bush worn but not resulting in excessive movement Front bush (5.3.4 (a) (i))

Fail Front Windscreen wiper does not clear the windscreen effectively Both sides (3.4 (b) (ii))

Advice Rear Coil spring corroded Both sides (5.3.1 (b) (i))

**Advice** Underbody corroded

**Advice** Oil leak, but not excessive (8.4.1 (a) (i))

Advice Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Advice Offside Rear Brake hose slightly deteriorated (1.1.12 (b) (ii))

Fail Offside Front Wheel bearing has excessive play (5.1.3 (a) (i))

**Fail** Supplementary restraint system warning lamp indicates a fault (7.1.6 (a))

Fail Nearside Front Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

**Advice** Coolant reservoir empty

Fail Brake fluid contaminated (1.8 (a))

**Fail** Exhaust emissions test not completed because smoke levels are significantly in excess of the specified limit values (8.2.2.2 (f))

MOT #18 2020-01-13 12:45

MOT test number 198202048206

**Result** 
✓ Passed

CarCheck.co.uk page 6/17



report date: 2024-03-29

**MOT #17** 2019-01-11 13:14

**MOT test number** 614186981024

**Result** ✓ Passed

Advice

(a) (i))

Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4  $\,$ 

**MOT #16** 2019-01-09 14:43

MOT test number 451999883411

Result × Failed

Fail Offside Front Suspension arm pin or bush excessively worn (5.3.4 (a) (i))

Fail Offside Track rod end ball joint has excessive play (2.1.3 (b) (i))

**Fail** Offside Outer Suspension component mounting prescribed area excessively corroded significantly reducing structural strength sill (5.3.6 (a) (i))

Advice Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement (5.3.4 (a) (i))

Fail Offside Side repeater not working (4.4.1 (a) (ii))

**Fail** Nearside Outer Suspension component mounting prescribed area excessively corroded significantly reducing structural strength sill (5.3.6 (a) (i))

**MOT #15** 2017-12-28 11:42

MOT test number 895589068077

Result 

Passed

**Advice** All brake hoses perished

**Advice** Under body corriosn

**Advice** Both number plates poor

**Advice** Oil leak

**Advice** Both front lower arms bushes perished

**MOT #14** 2017-01-17 10:40

**MOT test number** 218822164895

CarCheck.co.uk page 7/17



report date: 2024-03-29

MOT #13	2017-01-10 14:35
MOT test number	323754381684
Result	🗙 Failed
Fail Nearside Rear coil spring broken (2.4.C.1a)	
Fail Offside Front Tyre tread depth below requirements of 1.6mm (4.1.E.1)	
Advice Offside Rear Tyre worn close to the legal limit (4.1.E.1)	
Advice Nearside Front Tyre worn close to the legal limit (4.1.E.1)	
Fail Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)	

MOT #12	2016-02-24 10:44
MOT test number	858495802098
Result	✓ Passed
MOT #11	2015-02-26 19:01
MOT test number	567457755041
Result	✓ Passed
MOT #10	2015-02-26 10:43

MOT #	10	2015-02-26 10:43
MOT te	est number	299957355048
Result		<b>×</b> Failed
Fail	Offside Front Direction indicator incorrect colour (1.4.A.2f)	
Fail	Rear Registration plate lamp not working (1.1.C.1d)	
Fail	Offside Stop lamp not working (1.2.1b)	
Fail	Nearside Side repeater incorrect colour (1.4.A.2f)	
Fail	Nearside Stop lamp not working (1.2.1b)	

CarCheck.co.uk page 8/17



report date: 2024-03-29

MOT #9

MOT test number

Sesult

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

MOT test number

838539354064

Result

Fail Offside Front Suspension arm has excessive play in a ball joint (2.4.G.2)

Fail Nearside Front Suspension arm has excessive play in a ball joint (2.4.G.2)

Advice Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)

 MOT #7
 2013-01-29 13:05

 MOT test number
 778139223051

 Result
 ✓ Passed

MOT #6

MOT test number

Fesult

Advice

Nearside Front Tyre worn close to the legal limit (4.1.E.1)

Notice

Items removed from driver's view prior to test

Advice

Offside Front Tyre worn close to the legal limit (4.1.E.1)

 MOT #5
 2011-02-22 13:08

 MOT test number
 688813151083

 Result
 ✓ Passed

CarCheck.co.uk page 9/17



Result

**MOT** test number

SB54WRT

report date: 2024-03-29

✓ Passed

683286258042

 MOT #4
 2010-03-02 10:14

 MOT test number
 950181560045

Result × Failed

**Pass with rectification** Offside Stop lamp not working (1.2.1b)

**Pass with rectification** Offside Rear Direction indicator incorrect colour (1.4.A.2f)

**Pass with rectification** Nearside Stop lamp not working (1.2.1b)

**Pass with rectification** Nearside Rear Direction indicator incorrect colour (1.4.A.2f)

 MOT #3
 2010-03-02 10:14

 MOT test number
 610911860080

MOT #2 2009-02-04 16:23 MOT test number 650395339067

MOT #1 2008-02-25 10:53

**Result** ✓ Passed

CarCheck.co.uk page 10/17



report date: 2024-03-29

### Tax & MOT check

Tax expired: 1 March 2024





Expires: 17 November 2024

Tax statusExpired at 1 March 2024Days left58 days too late

MOT expiry date 17 November 2024

Full MOT history See MOT history

### Tax calculation

Vehicle class	49
Band	В
Single payment (12 months)	£ 20,00,-
Single six month payment	Not applicable
Total payable by 12 monthly instalments	£ 21,00,-

CarCheck.co.uk page 11/17



report date: 2024-03-29

### Damage history

Check the damage history for this CITROEN. See if, where and when this CITROEN had damage and the car repair costs. We also check if this CITROEN was scrapped. Download the premium report <a href="https://example.com/here">here</a> for the results.

Damage 1	
Date	
Category	
Туре	
Damage 2	
Damage 2	
Date	
Category	
Туре	



#### Extra CITROEN salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 12/17



SB54WRT report date: 2024-03-29

Vehicle valuation

What is this car worth? See the vehicle value of this CITROEN in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

**Trade retail value** 

**Auction value** 

Average private trade value

More info >

CarCheck.co.uk page 13/17



report date: 2024-03-29

More info >

# Owner history For how long did the current and previous owner(s) have this CITROEN? How many owners did this CITROEN have? Check it in the premium report and see all owner registrations. Download the full report <u>here</u>. More info > Plate changes See in this check if this CITROEN had different number plates. about of pliates factor scincol

CarCheck.co.uk page 14/17



report date: 2024-03-29

### Finance check

Check if this CITROEN is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this CITROEN has been settled.

If not, and you buy this CITROEN then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this CITROEN is financed.

Pinance company

Date of agreement

Agreement type

Agreement term

Agreement number

**Contact info** 

More info >


CarCheck.co.uk page 15/17



report date: 2024-03-29

# Mileage check

Odometer	In miles
Mileage registrations	27
First mileage registration	2005-01-31
Last registration	2023-10-28
Complete history	See info

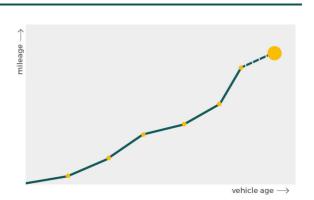

Registration #1	2005-01-31	21 mi
Registration #2	2008-02-25	18.991 mi
Registration #3	2009-02-04	24.449 mi
Registration #4	2010-03-02	40.785 mi
Registration #5	2011-02-22	52.945 mi
Registration #6	2012-02-13	56.676 mi
Registration #7	2013-01-29	64.120 mi
Registration #8	2014-02-28	70.914 mi
Registration #9	2014-02-28	70.917 mi
Registration #10	2015-02-26	76.088 mi
Registration #11	2015-02-26	76.090 mi
Registration #12	2016-02-24	82.866 mi
Registration #13	2017-01-10	90.013 mi
Registration #14	2017-01-17	90.034 mi
Registration #15		77.777 46
Registration #16		71.777 es
Registration #17		11.177 es
Registration #18		71.777 es
Registration #19		11.177 es
Registration #20		11.777 es
Registration #21		11.777 es
Registration #22		71.777 66
Registration #23		11.777 66
Registration #24		71.777 46
Registration #25		11.777 ea
Registration #26		71,777 66
CarCheck.co.uk		page 16/17

More info >



report date: 2024-03-29

# Safety ratings

NCAP rating	****
Video	see crash video



# Dimensions & weight

Width	1659 mm
Height	1461 mm
Length	3666 mm
Wheel base	2315 mm
Kerb weight	996 kg
Max. allowed weight	1390 kg

# Additional information

Fuel tank capacity	41
Fuel delivery	Direct Injection
Number of doors	3
Number of seats	4
Number of axles	2
Engine number	FD661063782

CarCheck.co.uk page 17/17