





report date: 2024-03-28

### General information

Make	HONDA
Model	ELYSION
Colour	White
Year of manufacture	2004
Gearbox	-

# Engine & fuel consumption

Engine capacity	2.300 cc
Fuel type	Petrol



CarCheck.co.uk page 1/16



report date: 2024-03-28

## Internet history

### Entry 1


Date 2021-09-10

Pictures 12

Listing price <u>View report</u>





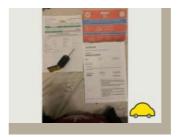



source: autotrader.co.uk

CarCheck.co.uk page 2/16



report date: 2024-03-28

# MOT history

MOT expiry date	2025-02-18
MOT pass rate	56 %
MOT passed	9
Failed MOT tests	7
Total advice items	80
Total items failed	0

MOT #16	2024-02-19 11:55
MOT test number	545398229784
Result	✓ Passed
Next expiry date	2025-02-18

MOT #15		2024-02-05 12:58
MOT test	number	216057789849
Result		<b>X</b> Failed
MAJOR	Offside Front Suspension arm ball joint excessively worn (5.3.4 (a) (i))	

MOT #14	2023-02-04 10:31
MOT test number	601112483211
Result	✓ Passed
Advice Brake pedal wearing smooth (1.1.2 (c))	
Advice Offside Play in steering rack inner joint(s)	

CarCheck.co.uk page 3/16



report date: 2024-03-28

**MOT #13** 2023-01-27 10:29

**MOT test number** 752136755454

Result X Failed

**MAJOR** Nearside Rear Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (5.2.3 (d) (i))

**Advice** Brake pedal wearing smooth (1.1.2 (c))

**Advice** Offside Play in steering rack inner joint(s)

**DANGEROUS** Offside Front Tyre has a lump, caused by separation or partial failure of its structure (5.2.3 (d) (ii))

**MAJOR** Nearside Rear Wheel bearing has excessive play (5.1.3 (a) (i))

**DANGEROUS** Nearside Front Tyre has a lump, caused by separation or partial failure of its structure (5.2.3 (d) (ii))

**MOT #12** 2022-02-02 12:54

**MOT test number** 221580748197

Result Passed

Minor Nearside Front Side repeater lens defective which has no effect on emitted light (4.4.1 (b) (i))

**Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

**Advice** Nearside Rear Wheel bearing has slight play (5.1.3 (a) (i))

Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Minor Offside Front Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))

Advice Nearside Rear Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

CarCheck.co.uk page 4/16



report date: 2024-03-28

**MOT #11** 2022-01-13 12:01

**MOT test number** 297389694960

Result × Failed **Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) **MAJOR** Nearside Front Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii)) **MAJOR** Nearside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength chasis leg (5.3.6 (a) (i)) Offside Front Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i)) **MAJOR MAJOR** Nearside Front Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii)) **Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) **Advice** Power steering pipe/hose has slight seepage (2.1.5 (a)) Minor Offside Front Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i)) **MAJOR** Offside Front Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii)) **MAJOR** Offside Rear Suspension component mounting prescribed area excessively corroded significantly reducing structural strength (5.3.6 (a) (i)) **Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt Advice Nearside Rear Wheel bearing has slight play (5.1.3 (a) (i)) Advice Nearside Rear Tyre slightly damaged/cracking or perishing 215/65/16 (5.2.3 (d) (ii))

**MAJOR** Nearside Front Track rod end ball joint dust cover excessively damaged or deteriorated so that it no longer prevents the ingress of dirt (2.1.3 (g) (ii))

Minor Nearside Front Side repeater lens defective which has no effect on emitted light (4.4.1 (b) (i))

CarCheck.co.uk page 5/16



report date: 2024-03-28

**MOT #10** 2021-01-27 16:15 736464517029 **MOT** test number Result ✓ Passed **Advice** Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Advice Power steering pipe/hose has slight seepage power steering pipe (2.1.5 (a)) Minor Nearside Front Lower Suspension arm ball joint dust cover severely deteriorated (5.3.4 (b) (i)) Advice Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e)) Minor Nearside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i)) Nearside Rear Wheel bearing has slight play (5.1.3 (a) (i)) **Advice** 

MOT #9		2021-01-22 10:21
MOT test	number	750803177345
Result		<b>×</b> Failed
Advice	Offside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))	
Advice	Offside Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))	
Advice	Power steering pipe/hose has slight seepage power steering pipe (2.1.5 (a))	
Minor	Nearside Front Lower Suspension arm ball joint dust cover severely deteriorate	ted (5.3.4 (b) (i))
Advice	Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))	
Advice	Nearside Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))	
MAJOR	Nearside Headlamp not working on dipped beam (4.1.1 (a) (ii))	
<b>Minor</b> ingress of	Nearside Front Track rod end ball joint dust cover damaged or deteriorated, by dirt $(2.1.3 (g) (i))$	out preventing the
Advice	Nearside Rear Wheel bearing has slight play (5.1.3 (a) (i))	

CarCheck.co.uk page 6/16



report date: 2024-03-28

MOT #8 2021-01-19 16:25

MOT test number 379288066254

Result X Failed

**MAJOR** Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

MAJOR Nearside Headlamp not working on dipped beam (4.1.1 (a) (ii))

MAJOR Nearside Rear Other passenger door cannot be opened from outside the vehicle (6.2.3 (a))

Advice Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))

**MAJOR** Nearside Front Outer Track rod end ball joint dust cover excessively damaged or deteriorated so that it no longer prevents the ingress of dirt (2.1.3 (g) (ii))

MAJOR Nearside Front Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))

MAJOR Offside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

MAJOR Nearside Rear Wheel bearing rough when rotated (5.1.3 (b) (i))

Advice Front Tyre worn close to legal limit/worn on edge both (5.2.3 (e))

**MAJOR** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))

MOT #7 2020-01-25 11:55

MOT test number 263883196015

Result 

Passed

**Advice** Offside Rear Nail in tyre

**Advice** Offside Rear Upper spring mount slightly corroded

CarCheck.co.uk page 7/16



report date: 2024-03-28

**MOT #6** 2020-01-21 13:46

MOT test number 824393755602

**Result** X Failed

**MAJOR** Nearside Front Track rod end ball joint dust cover excessively damaged or deteriorated so that it no longer prevents the ingress of dirt (2.1.3 (g) (ii))

**MAJOR** Rear fog lamp missing (4.5.1 (a) (ii))

**MAJOR** Nearside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

MAJOR Nearside Rear Anti-roll bar ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

**Advice** Offside Rear Nail in tyre

**MAJOR** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))

MAJOR Nearside Rear Other passenger door cannot be opened from outside the vehicle (6.2.3 (a))

**Advice** Offside Rear Upper spring mount slightly corroded

**DANGEROUS** Rear Stop lamp(s) all not working (4.3.1 (a) (iii))

MAJOR Offside Front Upper Suspension arm ball joint excessively worn (5.3.4 (a) (i))

MOT #5 2019-01-18 11:46

MOT test number 313657584189

Result 

Passed

**Advice** Offside Front Anti-roll bar ball joint has slight play (5.3.4 (a) (i))

MOT #4 2019-01-08 12:35

MOT test number 610359830423

**Result** X Failed

**MAJOR** Offside Front Lower Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))

**Advice** Offside Front Anti-roll bar ball joint has slight play (5.3.4 (a) (i))

MAJOR Offside Front Suspension arm pin or bush excessively worn most forward (5.3.4 (a) (i))

MAJOR Nearside Front Suspension arm pin or bush excessively worn most forward (5.3.4 (a) (i))

CarCheck.co.uk page 8/16



report date: 2024-03-28

MOT #3 2018-01-26 10:49

MOT test number 232839042874

**Result** ✓ Passed

Advice Offside Front Upper Suspension arm has slight play in a ball joint (2.4.G.2)

**Advice** Offside Front Lower Suspension arm ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)

**Advice** Offside Front Suspension arm rubber bush deteriorated but not resulting in excessive movement most forward (2.4.G.2)

**Advice** Nearside Front Lower Suspension arm ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)

Advice Central Front Suspension arm rubber bush deteriorated but not resulting in excessive movement most forward (2.4.G.2)

MOT #2 2017-01-10 13:58

**MOT test number** 389572173227

Result 

Passed

**Advice** Front Brake pad(s) wearing thin both sides (3.5.1g)

**Advice** Offside Front Suspension arm ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)

**Advice** Nearside Front Suspension arm ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)

**MOT #1** 2016-01-13 10:20

**MOT test number** 149565469487

CarCheck.co.uk page 9/16



**HL04ZHH** report date: 2024-03-28

18 February 2025

#### Tax & MOT check

**MOT** expiry date



**Full MOT history** See MOT history

CarCheck.co.uk page 10/16



report date: 2024-03-28

### Damage history

Check the damage history for this HONDA. See if, where and when this HONDA had damage and the car repair costs. We also check if this HONDA was scrapped. Download the premium report <u>here</u> for the results.

Damage 1
Date
Category
Type
Damage 2
Date
Category
Type



#### Extra HONDA salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report <u>here</u> for more information.

More info >

CarCheck.co.uk page 11/16



HLO4ZHH report date: 2024-03-28

Vehicle valuation

What is this car worth? See the vehicle value of this HONDA in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

**Trade retail value** 

**Auction value** 

Average private trade value

More info >

CarCheck.co.uk page 12/16



report date: 2024-03-28

## Owner history

For how long did the current and previous owner(s) have this HONDA? How many owners have? Check it in the premium report and see all owner registrations. Download the full it	
***************************************	
***************************************	
***************************************	
***************************************	
	More info >
Plate changes	
See in this check if this HONDA had different number plates.	
Number of plates	,
Current registration	UK UK
Plate since	
Current registration	OK SIE
Plate since	
	More info >

CarCheck.co.uk page 13/16



report date: 2024-03-28

#### Finance check

Check if this HONDA is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this HONDA has been settled.

If not, and you buy this HONDA then you could lose the money and the car you paid for.

Download the premium report <u>here</u> and check if this HONDA is financed.

Finance company	
Date of agreement	
Agreement type	
Agreement term	
Agreement number	
Contact info	

Contact info

More info >

CarCheck.co.uk page 14/16



report date: 2024-03-28

# Mileage check

Odometer	In kilometers
Mileage registrations	18
First mileage registration	2004-08-15
Last registration	2024-02-19
Complete history	See info



Registration #1	2004-08-15	28 mi
Registration #2	2016-01-13	94.201 mi
Registration #3	2017-01-10	59.342 mi
Registration #4	2018-01-26	63.523 mi
Registration #5	2019-01-08	68.589 mi
Registration #6	2019-01-18	68.595 mi
Registration #7	2020-01-21	83.347 mi
Registration #8	2020-01-25	83.347 mi
Registration #9	2021-01-19	91.976 mi
Registration #10		11.777 es
Registration #11		11.777 es
Registration #12		11.777 es
Registration #13		11.777 es
Registration #14		11.777 es
Registration #15		11.777 es
Registration #16		11.777 es
Registration #17		11.777 es
Registration #18		11.777 es

More info >

CarCheck.co.uk page 15/16



HLO4ZHH report date: 2024-03-28

## Additional information

Number of seats	8
Engine number	NOT KNOWN

CarCheck.co.uk page 16/16