



TOYOTA




report date: 2024-03-28

General information

Make	TOYOTA
Model	COROLLA VERSO VVTI T SPIRIT
Colour	Blue
Year of manufacture	2006
Top speed	121 mph
Gearbox	5 speed Semi-Automatic

Engine & fuel consumption

Power	127 BHP
Max. torque	170 Nm at 4.200 rpm
Engine capacity	1.794 cc
Cylinders	4
Fuel type	Petrol
Consumption city	30.1 mpg
Consumption extra urban	44.1 mpg
Consumption combined	37.7 mpg
CO2 emission	179 g/km
CO2 label	I

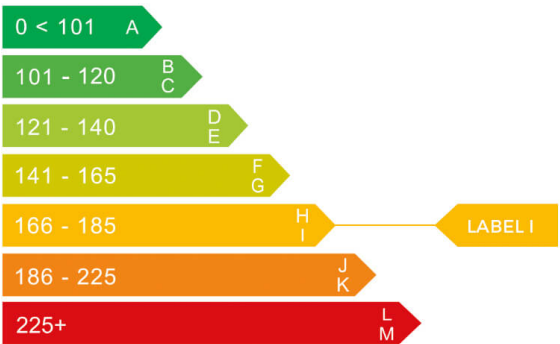



Internet history

Entry 1

Date	2021-07-11
Pictures	10
Listing price	View report



source: [autotrader.co.uk](https://www.autotrader.co.uk)



MOT history

MOT expiry date	2025-03-01
MOT pass rate	71 %
MOT passed	15
Failed MOT tests	6
Total advice items	57
Total items failed	13

MOT #21	2024-03-02 13:18
MOT test number	936571907973
Result	✓ Passed
Next expiry date	2025-03-01
Advice	Nearside Front Brake disc worn, but not excessively (1.1.14 (a) (i))
Advice	Integral body structure is repaired but structural rigidity is not significantly reduced (6.1.1 (d) (i))
Advice	Offside Front Suspension rod corroded but not seriously weakened (5.3.3 (b) (i))
Advice	Offside Front Brake disc worn, but not excessively (1.1.14 (a) (i))
Advice	Suspension component corroded but not seriously weakened (5.3.3 (b) (i))
Advice	Nearside Front Suspension rod corroded but not seriously weakened (5.3.3 (b) (i))

**MOT #20**

2024-03-02 12:20

MOT test number

924102268640

Result

✗ Failed

Fail Horn not working (7.7 (a))**Advice** Nearside Front Suspension rod corroded but not seriously weakened (5.3.3 (b) (i))**Advice** Nearside Front Brake disc worn, but not excessively (1.1.14 (a) (i))**Advice** Integral body structure is repaired but structural rigidity is not significantly reduced (6.1.1 (d) (i))**Fail** Offside Front Outer Prop shaft joint excessively worn (6.1.7 (c) (i))**Advice** Offside Front Suspension rod corroded but not seriously weakened (5.3.3 (b) (i))**Advice** Offside Front Brake disc worn, but not excessively (1.1.14 (a) (i))**MOT #19**

2022-11-29 13:17

MOT test number

717005930877

Result

✓ Passed

Minor Offside Front Track rod end ball joint dust cover damaged or deteriorated, but preventing the ingress of dirt (2.1.3 (g) (i))**Advice** Integral body structure is corroded but structural rigidity is not significantly reduced under body (6.1.1 (c) (i))**Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt**Advice** Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**Advice** Suspension component corroded but not seriously weakened all (5.3.3 (b) (i))**MOT #18**

2021-11-17 17:06

MOT test number

638814390473

Result

✓ Passed

Advice Oil leak, but not excessive (8.4.1 (a) (i))**Advice** Rear Coil spring corroded both sided (5.3.1 (b) (i))**Advice** Rear Shock absorbers has slight external damage to the casing both sides (5.3.2 (b))

**MOT #17**

2021-11-17 17:06

MOT test number

482552343640

Result**✗ Failed****Advice** Rear Coil spring corroded both sided (5.3.1 (b) (i))**Advice** Rear Shock absorbers has slight external damage to the casing both sides (5.3.2 (b))**Pass with rectification** Offside Front Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**MOT #16**

2021-10-26 12:15

MOT test number

388529333916

Result**✗ Failed****Fail** Nearside Front Position lamp not working (4.2.1 (a) (ii))**Fail** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))**Advice** Rear Shock absorbers has slight external damage to the casing both sides (5.3.2 (b))**Advice** Rear Coil spring corroded (5.3.1 (b) (i))**Fail** Supplementary restraint system warning lamp indicates a fault (7.1.6 (a))**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**Advice** Brake pipe corroded, covered in grease or other material (1.1.11 (c))

**MOT #15**

2021-08-19 15:40

MOT test number

638252110363

Result

✗ Failed

Fail Front Brake disc in such a condition that it is seriously weakened (1.1.14 (a) (ii))**Fail** Nearside Front Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**Fail** Exhaust Lambda reading after 2nd fast idle outside specified limits (8.2.1.2 (c))**Advice** Oil leak, but not excessive (8.4.1 (a) (i))**MOT #14**

2020-09-01 15:00

MOT test number

523645416884

Result

✓ Passed

Minor Offside Front Windscreen wiper blade defective (3.4 (b) (i))**Advice** Central Front Items removed from driver's view prior to test**Advice** Nearside Rear Brake pipe corroded, covered in grease or other material to flexi (1.1.11 (c))**Minor** Nearside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**Advice** Front Oil leak, but not excessive (8.4.1 (a) (i))**Advice** Rear Exhaust mounting defective back box front mount (6.1.2 (a))**Minor** Nearside Front Battery insecure but not likely to fall from carrier (4.13 (a) (i))**Advice** Front Oil leak, but not excessive (8.4.1 (a) (i))**Minor** Nearside Rear Tyre obviously under inflated (5.2.3 (l))

**MOT #13**

2020-09-01 14:38

MOT test number

819382441013

Result**✗ Failed**

Minor Nearside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

Advice Rear Exhaust mounting defective back box front mount (6.1.2 (a))

Advice Front Oil leak, but not excessive (8.4.1 (a) (i))

Minor Nearside Front Battery insecure but not likely to fall from carrier (4.13 (a) (i))

Advice Central Front Items removed from driver's view prior to test

Minor Nearside Rear Tyre obviously under inflated (5.2.3 (l))

Fail Nearside Front Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))

Advice Nearside Rear Brake pipe corroded, covered in grease or other material to flexi (1.1.11 (c))

Minor Offside Front Windscreen wiper blade defective (3.4 (b) (i))

Advice Front Oil leak, but not excessive (8.4.1 (a) (i))

MOT #12

2019-09-02 13:44

MOT test number

928427794882

Result**✓ Passed**

Advice Front Brake disc worn, but not excessively (1.1.14 (a) (i))

Advice Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))

Advice Driver's door hinge deteriorated but the door can still be readily opened and closed (6.2.3 (c) (i))

Advice Tyre slightly damaged/cracking or perishing both rear (5.2.3 (d) (ii))

MOT #11

2018-07-18 11:44

MOT test number

308909880225

Result**✓ Passed**

**MOT #10** 2018-07-17 15:07**MOT test number** 179499445592**Result** ✗ Failed**Fail** Nearside Steering locking device missing track rod end split pin (2.1.3 (d))**Fail** Offside Rear Brake pipe excessively corroded (1.1.11 (c))**Fail** Offside Rear Steering locking device missing track rod end split pin (2.1.3 (d))**MOT #9** 2017-08-15 12:34**MOT test number** 289180024031**Result** ✓ Passed**Advice** Nearside Front Tyre worn close to the legal limit 1.7mm (4.1.E.1)**Advice** Offside Front Tyre worn close to the legal limit 1.8mm (4.1.E.1)**MOT #8** 2016-08-16 08:56**MOT test number** 738927729233**Result** ✓ Passed**MOT #7** 2015-08-11 12:43**MOT test number** 859920659902**Result** ✓ Passed**MOT #6** 2014-08-01 10:42**MOT test number** 965733514290**Result** ✓ Passed**Notice** Offside front washer jet not working but getting water for the nearside jet**Notice** Both front tyres slight abnormal wear**Notice** Front undertray slightly insecure**Notice** Nail in nearside rear tyre



MOT #5 2013-08-01 14:41

MOT test number 545843213249

Result ✓ Passed

MOT #4 2012-07-30 16:02

MOT test number 998122312290

Result ✓ Passed

MOT #3 2011-08-25 16:15

MOT test number 185797731257

Result ✓ Passed

MOT #2 2010-08-25 16:08

MOT test number 312557230446

Result ✓ Passed

Advice Front Brake pad(s) wearing thin (3.5.1g)

MOT #1 2009-09-02 11:41

MOT test number 430105949278

Result ✓ Passed



Tax & MOT check

✓
Taxed
Tax due:
1 March 2025

✓
MOT
Expires:
1 March 2025

Tax status		Valid until 1 March
Days left		307
MOT expiry date		1 March 2025
Full MOT history		See MOT history

Tax calculation

Vehicle class	48
Band	I
Single payment (12 months)	£ 320,00,-
Single six month payment	£ 176,00,-
Total payable by 12 monthly instalments	£ 336,00,-



Damage history

Check the damage history for this TOYOTA. See if, where and when this TOYOTA had damage and the car repair costs. We also check if this TOYOTA was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	



Damage 2

Date	
Category	
Type	

Extra TOYOTA salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this TOYOTA in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this TOYOTA? How many owners did this TOYOTA have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration
Owner	Registration

More info >

Plate changes

See in this check if this TOYOTA had different number plates.

Number of plates	1
Current registration	
Plate since	2024-03-28
Current registration	
Plate since	2024-03-28

More info >



Finance check

Check if this TOYOTA is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this TOYOTA has been settled. If not, and you buy this TOYOTA then you could lose the money and the car you paid for. Download the premium report [here](#) and check if this TOYOTA is financed.

Finance company	XXXXXXXX XX
Date of agreement	XXXXXXXX XX
Agreement type	XXXXXXXX XX
Agreement term	XXXXXXXX XX
Agreement number	XXXXXXXX XX
Contact info	XXXXXXXX XX

More info >



Mileage check

Odometer	In miles
Mileage registrations	23
First mileage registration	2006-09-01
Last registration	2024-03-02
Complete history	See info



Registration #1	2006-09-01	23 mi
Registration #2	2009-09-02	30.975 mi
Registration #3	2010-08-25	38.815 mi
Registration #4	2011-08-25	45.865 mi
Registration #5	2012-07-30	55.150 mi
Registration #6	2013-08-01	57.813 mi
Registration #7	2014-08-01	62.010 mi
Registration #8	2015-08-11	66.666 mi
Registration #9	2016-08-16	72.667 mi
Registration #10	2017-08-15	81.631 mi
Registration #11	2018-07-17	86.800 mi
Registration #12	2018-07-18	86.804 mi
Registration #13	2019-06-20	91.277 mi
Registration #14	2019-06-20	91.277 mi
Registration #15	2019-06-20	91.277 mi
Registration #16	2019-06-20	91.277 mi
Registration #17	2019-06-20	91.277 mi
Registration #18	2019-06-20	91.277 mi
Registration #19	2019-06-20	91.277 mi
Registration #20	2019-06-20	91.277 mi
Registration #21	2019-06-20	91.277 mi
Registration #22	2019-06-20	91.277 mi
Registration #23	2019-06-20	91.277 mi

More info >



Car features

The TOYOTA factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete TOYOTA factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating

Video [see crash video](#)



Dimensions & weight

Width	1770 mm
Height	1660 mm
Length	4360 mm
Wheel base	2750 mm
Kerb weight	1365 kg
Max. allowed weight	2035 kg

Additional information

Fuel tank capacity	60 l
Fuel delivery	Multi-Point Injection
Number of doors	5
Number of seats	7

Number of axles	2
Engine number	1ZZE528551