



Mercedes-Benz

**FD6IBMZ**

report date: 2024-03-28

General information

Make	MERCEDES-BENZ
Model	VITO 116 CDI DUALINER
Colour	Black
Year of manufacture	2011
Gearbox	6 speed Manual

Engine & fuel consumption

Power	163 BHP
Max. torque	360 Nm at 1.600 rpm
Engine capacity	2.143 cc
Cylinders	4
Fuel type	Diesel
Consumption city	30.4 mpg
Consumption extra urban	43.5 mpg
Consumption combined	37.7 mpg





LABEL UNKNOWN



Internet history

Entry 1

Date	2021-08-10
Pictures	13
Listing price	<a href="#">View report</a>

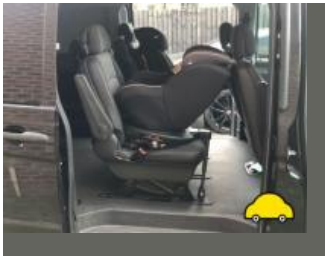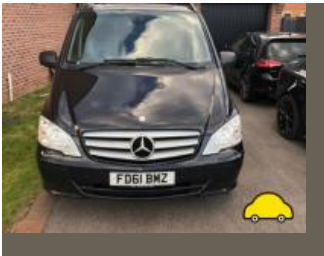

source: [autotrader.co.uk](https://www.autotrader.co.uk)



MOT history

MOT expiry date	2025-02-05
MOT pass rate	71 %
MOT passed	10
Failed MOT tests	4
Total advice items	28
Total items failed	18

MOT #14	2024-02-06 13:30
MOT test number	113152836455
Result	✓ Passed
Next expiry date	2025-02-05
Minor	Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
Advice	Offside Rear tyre slightly out of shape

**MOT #13**

2024-01-26 14:59

**MOT test number**

598181002163

**Result****✗ Failed**

- Advice** Offside Rear tyre slightly out of shape
- Fail** Windscreen washer provides insufficient washer liquid (3.5 (a))
- Fail** Offside Headlamp not working on dipped beam (4.1.1 (a) (ii))
- Fail** Nearside Rear Coil spring fractured or broken (5.3.1 (b) (i))
- Minor** Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Offside Front Service brake binding but not excessively (1.2.1 (f))
- Fail** Offside Headlamp aim unable to be tested (4.1.2 (b))
- Fail** Offside Stop lamp(s) not working (4.3.1 (a) (ii))
- Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Fail** Offside Front Suspension arm ball joint excessively worn (5.3.4 (a) (i))

**MOT #12**

2023-01-26 10:00

**MOT test number**

514088621586

**Result****✓ Passed**

- Advice** Windscreen damaged out of swept area

**MOT #11**

2023-01-24 13:33

**MOT test number**

973867685854

**Result**

✗ Failed

- Fail** Offside Rear Service brake excessively binding (1.2.1 (f))
- Fail** Exhaust emissions exceed manufacturer's specified limit (8.2.2.2 (a))
- Fail** Nearside Rear Service brake excessively binding (1.2.1 (f))
- Advice** Nearside Front Suspension arm ball joint has slight play under load (5.3.4 (a) (i))
- Fail** Front Brakes imbalanced across an axle (1.2.1 (b) (i))
- Advice** Windscreen damaged out of swept area

**MOT #10**

2022-01-26 11:03

**MOT test number**

738366064340

**Result**

✓ Passed

- Minor** Front Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Advice** Nearside Front Tyre worn close to legal limit/worn on edge (5.2.3 (e))

**MOT #9**

2021-01-21 10:03

**MOT test number**

981577200957

**Result**

✓ Passed

- Advice** Child Seat fitted not allowing full inspection of adult belt
- Advice** Windscreen damaged out of swept area

**MOT #8**

2020-01-27 14:31

**MOT test number**

129542802524

**Result**

✓ Passed

- Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))



MOT #7	2020-01-24 15:11
MOT test number	279668657592
Result	✗ Failed
Fail	Offside Rear Coil spring fractured or broken (5.3.1 (b) (i))
Advice	Offside Front Direction indicator slightly discoloured (4.4.3 (a))
Minor	Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
Advice	Offside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
Fail	Exhaust emissions exceed manufacturer's specified limit (8.2.2.2 (a))
Advice	Rear Direction indicator slightly discoloured n/s and o/s (4.4.3 (a))
Advice	Central Exhaust mounting defective (6.1.2 (a))

**MOT #6** 2020-01-23 12:39**MOT test number** 408553120349**Result** ✗ Failed**Fail** Horn sound not in accordance with requirements (7.7 (c))**Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt**Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))**Fail** Nearside Rear Direction indicator incorrect colour (4.4.3 (a))**Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement front bush (5.3.4 (a) (i))**Fail** Nearside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))**Fail** Offside Front Direction indicator incorrect colour (4.4.3 (a))**Advice** Offside Front Play in steering rack inner joint(s)**Minor** Nearside Front Lower Suspension arm ball joint dust cover severely deteriorated (5.3.4 (b) (i))**Fail** Offside Rear Direction indicator incorrect colour (4.4.3 (a))**Advice** Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement front bush (5.3.4 (a) (i))**Fail** Offside Rear Coil spring fractured or broken (5.3.1 (b) (i))**MOT #5** 2019-01-03 08:37**MOT test number** 620059316019**Result** ✓ Passed**MOT #4** 2018-01-24 16:10**MOT test number** 191897222881**Result** ✓ Passed



MOT #3	2016-12-08 10:12
MOT test number	435546215797
Result	✓ Passed

MOT #2	2015-12-17 14:54
MOT test number	197823806947
Result	✓ Passed

MOT #1	2014-12-12 13:57
MOT test number	667936544352
Result	✓ Passed

**Notice** N/s/f tyre wearing on outer edge.





Tax & MOT check

✓  
**Taxed**  
**Tax due:**  
1 July 2024

✓  
**MOT**  
**Expires:**  
5 February 2025

Tax status		Valid until 1 July
Days left		64
MOT expiry date		5 February 2025
Full MOT history		<a href="#">See MOT history</a>



Damage history

Check the damage history for this MERCEDES-BENZ. See if, where and when this MERCEDES-BENZ had damage and the car repair costs. We also check if this MERCEDES-BENZ was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra MERCEDES-BENZ salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this MERCEDES-BENZ in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this MERCEDES-BENZ? How many owners did this MERCEDES-BENZ have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this MERCEDES-BENZ had different number plates.

Number of plates	1
Current registration	 <b>FD61BMZ</b>
Plate since	2019-03-28
Current registration	 <b>FD61BMZ</b>
Plate since	2019-03-28

More info >



Finance check

Check if this MERCEDES-BENZ is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this MERCEDES-BENZ has been settled.

If not, and you buy this MERCEDES-BENZ then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this MERCEDES-BENZ is financed.

Finance company	XXXXXXXX	XXXX
Date of agreement	XXXXXXXX	XXXX
Agreement type	XXXXXXXX	XXXX
Agreement term	XXXXXXXX	XXXX
Agreement number	XXXXXXXX	XXXX
Contact info	XXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	16
First mileage registration	2011-12-30
Last registration	2024-02-06
Complete history	<a href="#">See info</a>



Registration #1	2011-12-30	19 mi
Registration #2	2014-12-12	59.212 mi
Registration #3	2015-12-17	81.245 mi
Registration #4	2016-12-08	97.527 mi
Registration #5	2018-01-24	115.634 mi
Registration #6	2019-01-03	128.960 mi
Registration #7	2020-01-23	142.487 mi
Registration #8	2020-01-24	142.526 mi
Registration #9	2020-01-24	142.526 mi
Registration #10	2020-01-24	142.526 mi
Registration #11	2020-01-24	142.526 mi
Registration #12	2020-01-24	142.526 mi
Registration #13	2020-01-24	142.526 mi
Registration #14	2020-01-24	142.526 mi
Registration #15	2020-01-24	142.526 mi
Registration #16	2020-01-24	142.526 mi

More info >



Car features

The MERCEDES-BENZ factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete MERCEDES-BENZ factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating



Video

[see crash video](#)



Additional information

Fuel tank capacity	75 l
Fuel delivery	Direct Injection
Number of doors	5
Number of seats	6
Engine number	65194030552142