



General information

Make	FORD
Model	FIESTA STYLE PLUS TDCI
Colour	Silver
Year of manufacture	2010
Top speed	101 mph
0 - 60 mph	14.4 seconds
Gearbox	5 speed Manual

Engine & fuel consumption

Power	67 BHP
Max. torque	160 Nm at 1.750 rpm
Engine capacity	1.399 cc
Cylinders	4
Fuel type	Diesel
Consumption city	53.3 mpg
Consumption extra urban	80.7 mpg
Consumption combined	67.3 mpg
CO2 emission	110 g/km
CO2 label	B





Internet history

Entry 1

Date	2021-06-08
Pictures	14
Listing price	View report



source: [autotrader.co.uk](https://www.autotrader.co.uk)



MOT history

MOT expiry date	2024-11-10
MOT pass rate	55 %
MOT passed	12
Failed MOT tests	10
Total advice items	58
Total items failed	29

MOT #22	2023-11-11 08:16
MOT test number	119903517392
Result	✓ Passed
Next expiry date	2024-11-10
Advice	Rear Coil spring corroded both os and ns (5.3.1 (b) (i))
Advice	Rear Integral body structure is modified but structural rigidity is not significantly reduced both sills corroded (6.1.1 (d) (i))
Minor	Nearside Rear Rear reflector insecure (4.8.1 (b) (i))
Advice	Rear Axle swivel pins and bushes swivel pin and/or bush slightly worn both (5.1.2 (b) (i))
Advice	Front Coil spring corroded both os an ns (5.3.1 (b) (i))

**MOT #21**

2023-11-07 13:25

MOT test number

509723706250

Result**✗ Failed**

- Advice** Rear Coil spring corroded both os and ns (5.3.1 (b) (i))
- Advice** Rear Integral body structure is modified but structural rigidity is not significantly reduced both sills corroded (6.1.1 (d) (i))
- Fail** Bonnet cannot be secured in the closed position (3.1 (b) (i))
- Fail** Rear Rear fog lamp not working (4.5.1 (a) (ii))
- Advice** Front Coil spring corroded both os an ns (5.3.1 (b) (i))
- Advice** Rear Axle swivel pins and bushes swivel pin and/or bush slightly worn both (5.1.2 (b) (i))
- Minor** Nearside Rear Rear reflector insecure (4.8.1 (b) (i))

MOT #20

2022-11-10 16:05

MOT test number

950770727868

Result**✓ Passed**

- Advice** Brake pedal long
- Advice** Engine undercover broken
- Advice** Both rear main suspension bushes worn
- Minor** Nearside Rear Rear reflector insecure (4.8.1 (b) (i))
- Advice** Rear exhaust box corroded

**MOT #19**

2022-10-19 10:52

MOT test number

297161179801

Result**✗ Failed**

- Advice** O/s/f fog lamp hanging under car
- Fail** Offside Rear Position lamp not working (4.2.1 (a) (ii))
- Fail** Offside Front Lower Suspension arm ball joint excessively worn (5.3.4 (a) (i))
- Fail** Headlamp aim too low both (4.1.2 (a))
- Advice** Brake pedal long
- Fail** Nearside Front Steering linkage ball joint has excessive play inner rack arm ball joint/ rack (2.1.3 (b) (i))
- Advice** Front Brake pad(s) wearing thin (1.1.13 (a) (ii))
- Advice** Sub-frame pin or bush worn but not resulting in excessive movement both rear main (5.3.4 (a) (i))

MOT #18

2021-10-25 14:33

MOT test number

988227402190

Result**✓ Passed**

- Advice** Nearside Rear Seat belt slightly damaged (7.1.2 (b) (i))
- Minor** Nearside Rear Rear reflector insecure (4.8.1 (b) (i))
- Advice** Both rear trailing arm bushes are in poor condition
- Minor** Nearside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))

**MOT #17**

2021-10-25 09:55

MOT test number

167540063046

Result**✗ Failed****Minor** Nearside Rear Rear reflector insecure (4.8.1 (b) (i))**Advice** Nearside Rear Seat belt slightly damaged (7.1.2 (b) (i))**Minor** Nearside Rear Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**Fail** Offside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))**Fail** Offside Front Anti-roll bar ball joint excessively worn (5.3.4 (a) (i))**Advice** Both rear trailing arm bushes are in poor condition**MOT #16**

2020-10-01 10:32

MOT test number

124987231258

Result**✓ Passed****Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i))**Advice** Rear exhaust box corroded**Advice** Nearside Front Direction indicator slightly discoloured (4.4.3 (a))**Advice** Offside Rear Coil spring corroded (5.3.1 (b) (i))**MOT #15**

2020-09-30 12:36

MOT test number

547680190901

Result**✗ Failed****Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i))**Fail** Nearside Rear Stop lamp(s) not working (4.3.1 (a) (ii))**Advice** Nearside Front Direction indicator slightly discoloured (4.4.3 (a))**Advice** Offside Rear Coil spring corroded (5.3.1 (b) (i))**Advice** Rear exhaust box corroded



MOT #14	2020-04-09 11:24
MOT test number	446946622153
Result	✓ Passed
Advice	Brake pedal sinks slightly with engine running but is fine on road test

MOT #13	2020-04-03 13:32
MOT test number	700686312975
Result	✗ Failed
Fail	Exhaust emissions exceed default limit of 1.5m-1 (8.2.2.2 (b))
Fail	Nearside Rear Rear reflector likely to become detached (4.8.1 (b) (ii))
Fail	Offside Front Inner Tyre has a tear, caused by separation or partial failure of its structure (5.2.3 (d) (ii))
Fail	Offside Rear fog lamp does not emit a steady red light (4.5.4 (a))
Fail	Nearside Front Inner Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (5.2.3 (d) (i))
Fail	Offside Headlamp not working on dipped beam (4.1.1 (a) (ii))
Fail	Offside Rear Rear reflector likely to become detached (4.8.1 (b) (ii))
Fail	Brake pedal has insufficient reserve travel sinking to the floor (1.1.2 (a))

MOT #12	2019-03-29 14:42
MOT test number	687915109651
Result	✓ Passed
Advice	Nearside Front Tyre worn close to legal limit/worn on edge inner wear (5.2.3 (e))
Advice	Child Seat fitted not allowing full inspection of adult belt
Advice	Rear box outer skin corroded
Advice	Offside Front Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

**MOT #11**

2019-03-29 14:42

MOT test number

459510171977

Result**✗ Failed****Advice** Nearside Front Tyre worn close to legal limit/worn on edge inner wear (5.2.3 (e))**Advice** Rear box outer skin corroded**Advice** Offside Front Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))**Advice** Child Seat fitted not allowing full inspection of adult belt**Pass with rectification** Nearside Front Position lamp not working (4.2.1 (a))**MOT #10**

2019-03-23 10:45

MOT test number

603317470407

Result**✗ Failed****Advice** Offside Rear tyre underinflated**Fail** Nearside Front Position lamp not working (4.2.1 (a))**Fail** Nearside Rear reflector defective or damaged by more than 50% of the reflecting surface (4.8.1 (a) (ii))**Advice** Offside Rear Child Seat fitted not allowing full inspection of adult belt**Fail** Nearside Track rod end ball joint has excessive play (2.1.3 (b) (i))**Fail** Nearside Rear Direction indicator incorrect colour (4.4.3 (a))**Fail** Offside Windscreen wiper does not clear the windscreen effectively (3.4 (b) (ii))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge inner edge bald (5.2.3 (e))**Advice** Rear exhaust box deteriorated**Fail** Rear fog lamp does not emit a steady red light white light showing due to broken lens (4.5.4 (a))**Fail** Offside Rear reflector defective or damaged by more than 50% of the reflecting surface (4.8.1 (a) (ii))**Advice** Offside Front Service brake binding but not excessively (1.2.1 (f))**Advice** Offside Front Tyre slightly damaged/cracking or perishing (5.2.3 (d) (ii))

**MOT #9** 2018-03-24 09:56**MOT test number** 136422126580**Result** ✓ Passed**MOT #8** 2018-03-22 09:45**MOT test number** 948747837256**Result** ✗ Failed**Fail** Offside Front Anti-roll bar linkage has excessive play in a ball joint (2.4.G.2)**Fail** Nearside Front Headlamp not working on dipped beam (1.7.5a)**MOT #7** 2017-03-27 12:31**MOT test number** 885655647756**Result** ✓ Passed**MOT #6** 2017-03-27 12:31**MOT test number** 595544772729**Result** ✗ Failed**Pass with rectification** Rear Rear fog lamp emits a light other than red (1.3.2e)**MOT #5** 2016-03-15 11:15**MOT test number** 766382320328**Result** ✓ Passed**Advice** Exhaust back box poor condition**MOT #4** 2015-03-10 12:01**MOT test number** 459599965012**Result** ✓ Passed**Advice** Nearside Front Tyre worn close to the legal limit (4.1.E.1)**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)

**MOT #3** 2014-03-26 13:01**MOT test number** 318815184030**Result** Passed**MOT #2** 2014-03-14 14:47**MOT test number** 249543674028**Result** Failed**Advice** Nearside Front Road wheel with a slightly distorted bead rim (4.2.A.1a)**Notice** Rear silencer corroded not blowing**Fail** Offside Track rod end ball joint has excessive play (2.2.B.1f)**Notice** Nsf tyre edge worn**Notice** Long travel on service brake,efficiency ok**Notice** Rear heat shield loose**MOT #1** 2013-05-22 10:35**MOT test number** 227182843140**Result** Passed



Tax & MOT check

✓
Taxed
Tax due:
1 June 2024

✓
MOT
Expires:
10 November 2024

Tax status	Valid until 1 June
Days left	34
MOT expiry date	10 November 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	49
Band	B
Single payment (12 months)	£ 20,00,-
Single six month payment	Not applicable
Total payable by 12 monthly instalments	£ 21,00,-



Damage history


Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	

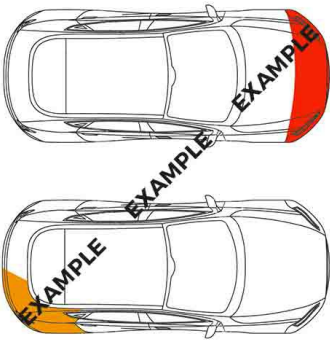

Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 10,000
Auction value	£ 10,000
Average private trade value	£ 10,000

More info >



Owner history

For how long did the current and previous owner(s) have this FORD? How many owners did this FORD have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

XXXXXX	XXXXXX
XXXXXXXXXXXX	XXXXXX
XXXXXXXXXX	XXXXXX
XXXXXX	XXXXXX
XXXXXXXXXXXX	XXXXXX
XXXXXXXXXX	XXXXXX

More info >

Plate changes

See in this check if this FORD had different number plates.

Number of plates	1
Current registration	 XXXXX
Plate since	2019-09-29
Current registration	 XXXXX
Plate since	2019-09-29

More info >



Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FORD is financed.


Finance company	XXXXXXXX	XXXX
Date of agreement	XXXXXXXX	XXXX
Agreement type	XXXXXXXX	XXXX
Agreement term	XXXXXXXX	XXXX
Agreement number	XXXXXXXX	XXXX
Contact info	XXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	24
First mileage registration	2010-06-30
Last registration	2023-11-11
Complete history	See info

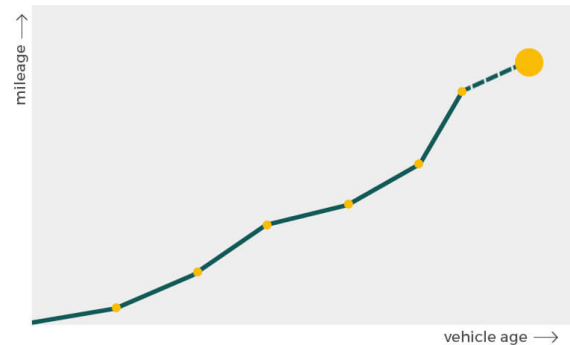

Registration #1	2010-06-30	7 mi
Registration #2	2013-05-22	52.629 mi
Registration #3	2014-03-14	66.078 mi
Registration #4	2014-03-26	66.080 mi
Registration #5	2015-03-10	70.531 mi
Registration #6	2016-03-15	77.626 mi
Registration #7	2017-03-27	85.119 mi
Registration #8	2017-03-27	85.119 mi
Registration #9	2018-03-22	91.102 mi
Registration #10	2018-03-24	91.106 mi
Registration #11	2019-03-23	97.575 mi
Registration #12	2019-03-29	97.730 mi
Registration #13	2019-03-29	97.730 mi
Registration #14	2019-03-29	97.730 mi
Registration #15	2019-03-29	97.730 mi
Registration #16	2019-03-29	97.730 mi
Registration #17	2019-03-29	97.730 mi
Registration #18	2019-03-29	97.730 mi
Registration #19	2019-03-29	97.730 mi
Registration #20	2019-03-29	97.730 mi
Registration #21	2019-03-29	97.730 mi
Registration #22	2019-03-29	97.730 mi
Registration #23	2019-03-29	97.730 mi
Registration #24	2019-03-29	97.730 mi

More info >



Car features

The FORD factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FORD factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★★

Video [see crash video](#)



Dimensions & weight

Width	1973 mm
Height	1481 mm
Length	3950 mm
Kerb weight	1141 kg
Max. allowed weight	1535 kg

Additional information

Fuel tank capacity	40 l
Fuel delivery	Direct Injection
Number of doors	3
Number of seats	5
Number of axles	2

Engine number

9R21853