



SP08XFN

report date: 2024-03-28

General information

Make	FIAT
Model	BRAVO ACTIVE
Colour	White
Year of manufacture	2008
Top speed	111 mph
Gearbox	6 speed Manual

Engine & fuel consumption

Power	90 BHP
Max. torque	128 Nm at 4.500 rpm
Engine capacity	1.368 cc
Cylinders	4
Fuel type	Petrol
Consumption city	32.5 mpg
Consumption extra urban	50.4 mpg
Consumption combined	42.2 mpg
CO2 emission	156 g/km
CO2 label	G






Internet history

Entry 1

Date	2021-07-02
Pictures	7
Listing price	View report

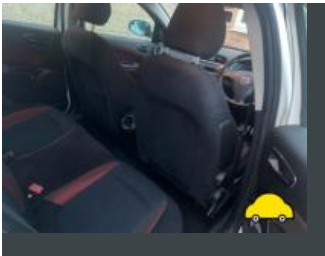

source: autotrader.co.uk



MOT history

MOT expiry date	2024-01-25
MOT pass rate	76 %
MOT passed	13
Failed MOT tests	4
Total advice items	73
Total items failed	11

MOT #17	2023-01-26 07:59
---------	------------------

MOT test number	696227217408
-----------------	--------------

Result	✓ Passed
Next expiry date	2024-01-25
Advice	Axle swivel pins and bushes swivel pin and/or bush slightly worn both rear (5.1.2 (b) (i))
Advice	Offside Play in steering rack inner joint(s)
Advice	Centre / rear exhaust heat shield loose
Advice	Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
Advice	Oil leak, but not excessive (8.4.1 (a) (i))
Advice	Offside Front Lower Suspension arm pin or bush worn but not resulting in excessive movement back bushes (5.3.4 (a) (i))
Minor	Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
Advice	Brake pad(s) wearing thin both front (1.1.13 (a) (ii))
Advice	Rear Suspension arm corroded but not seriously weakened axle (5.3.3 (b) (i))

**MOT #16**

2023-01-17 15:13

MOT test number

832722731175

Result

✗ Failed

- Fail** Exhaust has a major leak of exhaust gases flexy section (6.1.2 (a))
- Advice** Offside Play in steering rack inner joint(s)
- Fail** Nearside Front Lower Suspension arm pin or bush excessively worn back bush (5.3.4 (a) (i))
- Advice** Brake pad(s) wearing thin both front (1.1.13 (a) (ii))
- Fail** Offside Rear Brake disc significantly and obviously worn (1.1.14 (a) (i))
- Fail** Exhaust Lambda reading after 2nd fast idle outside specified limits (8.2.1.2 (c))
- Advice** Centre / rear exhaust heat shield loose
- Fail** Offside Rear Brake pad(s) less than 1.5 mm thick (1.1.13 (a) (ii))
- Advice** Rear Suspension arm corroded but not seriously weakened axle (5.3.3 (b) (i))
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge (5.2.3 (e))
- Advice** Offside Front Lower Suspension arm pin or bush worn but not resulting in excessive movement back bushes (5.3.4 (a) (i))
- Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))
- Advice** Axle swivel pins and bushes swivel pin and/or bush slightly worn both rear (5.1.2 (b) (i))
- Fail** Supplementary restraint system warning lamp indicates a fault (7.1.6 (a))
- Advice** Oil leak, but not excessive (8.4.1 (a) (i))

MOT #15

2022-01-17 14:27

MOT test number

459533158948

Result

✓ Passed

- Advice** Offside Rear Service brake binding but not excessively (1.2.1 (f))
- Advice** Central Front Oil leak, but not excessive (8.4.1 (a) (i))
- Advice** Front Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))

**MOT #14**

2022-01-17 14:27

MOT test number

873807145506

Result**✗ Failed**

- Advice** Front Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))
- Pass with rectification** Offside Front Headlamp not working on dipped beam (4.1.1 (a) (ii))
- Advice** Offside Rear Service brake binding but not excessively (1.2.1 (f))
- Advice** Central Front Oil leak, but not excessive (8.4.1 (a) (i))
- Pass with rectification** Nearside Front Headlamp not working on dipped beam (4.1.1 (a) (ii))
- Pass with rectification** Offside Rear Stop lamp(s) not working (4.3.1 (a) (ii))

MOT #13

2020-10-21 09:02

MOT test number

983003978384

Result**✓ Passed**

- Advice** Offside Rear Tyre slightly damaged/cracking or perishing outer wall (5.2.3 (d) (ii))
- Advice** Front Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))
- Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Advice** Rear Coil spring corroded both (5.3.1 (b) (i))
- Advice** Slight dampness around gearbox
- Advice** Anti-roll bar pin or bush worn but not resulting in excessive movement both front mounting bushes (5.3.4 (a) (i))
- Advice** Rear Sub-frame corroded but not seriously weakened (5.3.3 (b) (i))
- Advice** Front Lower Suspension arm pin or bush worn but not resulting in excessive movement both (5.3.4 (a) (i))
- Advice** Slight brake binding on offside rear wheel

**MOT #12**

2019-10-30 10:42

MOT test number

585110285357

Result

✓ Passed

- Advice** Brake hose has slight corrosion to ferrule Rears x2 (1.1.12 (f) (i))
- Advice** Nearside Front Suspension arm pin or bush worn but not resulting in excessive movement rear (5.3.4 (a) (i))
- Advice** Nearside Lower skirt damaged, cracked
- Advice** Front Anti-roll bar pin or bush worn but not resulting in excessive movement D bushes x2 cracking (5.3.4 (a) (i))
- Advice** Rear suspensions components showing corrosion
- Advice** Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))
- Advice** Offside Rear Service brake fluctuating, but not excessively (1.2.1 (e))
- Advice** Coil spring corroded Rears x2 (5.3.1 (b) (i))
- Advice** Offside Rear Brake pad(s) wearing thin VERY LOW (1.1.13 (a) (ii))
- Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt
- Advice** Rear Exhaust mounting defective Back box mounting cracking (6.1.2 (a))
- Minor** Windscreen damaged but not adversely affecting driver's view (3.2 (a) (i))
- Advice** Offside Front Suspension arm pin or bush worn but not resulting in excessive movement rear (5.3.4 (a) (i))
- Advice** Front suspensions components showing corrosion
- Advice** Offside Front Tyre slightly damaged/cracking or perishing 225/45/17 (5.2.3 (d) (ii))
- Advice** Rear Brakes imbalanced requirements only just met. It would appear that the braking system requires adjustment or repair. (1.2.1 (b) (i))
- Advice** Oil leak
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))

**MOT #11** 2018-11-08 12:13**MOT test number** 217777903687**Result** ✓ Passed

- Advice** Items removed from driver's view prior to test
- Advice** Front and rear suspension showing corrosion
- Minor** Offside Front Inner Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))
- Advice** Nearside Rear Coil spring corroded (5.3.1 (b) (i))
- Minor** Nearside Front Inner Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))
- Advice** Nearside Rear Child Seat fitted not allowing full inspection of adult belt
- Advice** Under trays and engine covers fitted
- Advice** Front Brake disc worn, pitted or scored, but not seriously weakened both (1.1.14 (a) (ii))
- Advice** Offside Rear Coil spring corroded (5.3.1 (b) (i))

MOT #10 2017-11-01 09:46**MOT test number** 555026887655**Result** ✓ Passed**MOT #9** 2016-11-08 09:13**MOT test number** 778214781094**Result** ✓ Passed

- Advice** Child Seat fitted not allowing full inspection of adult belt
- Advice** Items removed from driver's view prior to test

**MOT #8** 2016-11-04 17:24**MOT test number** 412565006713**Result** ✗ Failed**Advice** Child Seat fitted not allowing full inspection of adult belt**Fail** Nearside Front coil spring broken (2.4.C.1a)**Advice** Items removed from driver's view prior to test**MOT #7** 2015-11-11 12:37**MOT test number** 836090196963**Result** ✓ Passed**Advice** Exhaust has a minor leak of exhaust gases (7.1.2)**MOT #6** 2015-01-29 14:49**MOT test number** 485079625055**Result** ✓ Passed**MOT #5** 2014-01-25 09:59**MOT test number** 928215424007**Result** ✓ Passed**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**Advice** Front Exhaust has a minor leak of exhaust gases (7.1.2)**MOT #4** 2013-01-25 13:06**MOT test number** 679995423091**Result** ✓ Passed**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**Advice** Offside Front Tyre worn close to the legal limit (4.1.E.1)



MOT #3	2013-01-25 13:06
MOT test number	475155723041
Result	✗ Failed
Advice	Rear Brake pad(s) wearing thin (3.5.1g)
Pass with rectification	Offside Rear Stop lamp not working (1.2.1b)
Advice	Offside Front Tyre worn close to the legal limit (4.1.E.1)

MOT #2	2012-01-21 09:00
MOT test number	175801922014
Result	✓ Passed
Advice	Front Brake pad(s) wearing thin (3.5.1g)

MOT #1	2011-02-01 16:04
MOT test number	139622231407
Result	✓ Passed



Tax & MOT check

X

Untaxed

Tax expired:
23 October 2023

X

MOT

Expired:
25 January 2024

Tax status	Expired at 23 October 2023
Days left	189 days too late
MOT expiry date	25 January 2024
Full MOT history	See MOT history

Tax calculation

Vehicle class	48
Band	G
Single payment (12 months)	£ 240,00,-
Single six month payment	£ 132,00,-
Total payable by 12 monthly instalments	£ 252,00,-



Damage history

Check the damage history for this FIAT. See if, where and when this FIAT had damage and the car repair costs. We also check if this FIAT was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra FIAT salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FIAT in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this FIAT? How many owners did this FIAT have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****
*****	*****

More info >

Plate changes

See in this check if this FIAT had different number plates.

Number of plates	1
Current registration	*****
Plate since	2019-09-29
Current registration	*****
Plate since	2019-09-29

More info >



Finance check

Check if this FIAT is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FIAT has been settled.

If not, and you buy this FIAT then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FIAT is financed.

Finance company	XXXXXXXX XX
Date of agreement	XXXXXXXX XX
Agreement type	XXXXXXXX XX
Agreement term	XXXXXXXX XX
Agreement number	XXXXXXXX XX
Contact info	XXXXXXXX XX

More info >



Mileage check

Odometer	In miles
Mileage registrations	18
First mileage registration	2008-03-20
Last registration	2023-01-26
Complete history	See info



Registration #1	2008-03-20	23 mi
Registration #2	2011-02-01	28.824 mi
Registration #3	2012-01-21	31.588 mi
Registration #4	2013-01-25	41.860 mi
Registration #5	2014-01-25	47.186 mi
Registration #6	2015-01-29	52.147 mi
Registration #7	2015-11-11	55.246 mi
Registration #8	2016-11-04	59.550 mi
Registration #9	2016-11-08	59.613 mi
Registration #10	2016-11-08	59.613 mi
Registration #11	2016-11-08	59.613 mi
Registration #12	2016-11-08	59.613 mi
Registration #13	2016-11-08	59.613 mi
Registration #14	2016-11-08	59.613 mi
Registration #15	2016-11-08	59.613 mi
Registration #16	2016-11-08	59.613 mi
Registration #17	2016-11-08	59.613 mi
Registration #18	2016-11-08	59.613 mi

More info >



Car features

The FIAT factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FIAT factory list for this vehicle [here](#).

More info >

Safety ratings

NCAP rating ★★★★★

Video [see crash video](#)



Dimensions & weight

Width	1792 mm
Height	1498 mm
Length	4336 mm
Wheel base	2600 mm
Kerb weight	1205 kg
Max. allowed weight	1715 kg

Additional information

Fuel tank capacity	58 l
Fuel delivery	Multi-Point Injection
Number of doors	5
Number of seats	5

Number of axles	2
Engine number	1261766