



YG060BX

report date: 2024-03-29

General information

Make	FORD
Model	TRANSIT CONNECT T220 LWB P/V
Colour	White
Year of manufacture	-
Gearbox	5 speed Manual

Engine & fuel consumption

Cylinders	4
Fuel type	Diesel




LABEL UNKNOWN



Internet history

Entry 1

Date	2021-08-25
Pictures	3
Listing price	View report

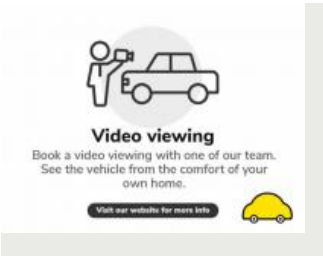

source: cargurus.co.uk

**MOT history****MOT #20**

2023-10-13 09:40

MOT test number

923832125412

Result**✗ Failed**

- Fail** Engine mounting bracket damaged or deteriorated resulting in excessive movement lower dog bone mount (6.1.8 (a) (i))
- Fail** Offside Rear Direction indicator incorrect colour (4.4.3 (a))
- Fail** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))
- Fail** Offside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Fail** Oil leaking excessively from engine (8.4.1 (a) (i))
- Fail** Nearside Integral body structure corroded to the extent that the rigidity of the assembly is significantly reduced inner sill, full length (6.1.1 (c) (i))
- Advice** Bonnet not open
- Advice** Exhaust has a minor leak of exhaust gases flex (6.1.2 (a))
- Fail** Offside Rear Position lamp not working (4.2.1 (a) (ii))
- Fail** Offside Front Inner Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))
- Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))
- Fail** Registration plate lamp inoperative in the case of a single lamp or all lamps (4.7.1 (b) (ii))
- Fail** Nearside Parking brake inoperative on one side (1.4.1 (a))
- Fail** Offside Rear Leaf spring fractured (5.3.1 (b) (i))
- Fail** Offside Integral body structure corroded to the extent that the rigidity of the assembly is significantly reduced inner and outer full length (6.1.1 (c) (i))

**MOT #19**

2022-09-16 15:50

MOT test number

364686508727

Result

✓ Passed

Advice Nearside Front Outer Tyre worn close to legal limit/worn on edge (5.2.3 (e))**Minor** Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**Advice** Offside Rear Inner Tyre slightly damaged (5.2.3 (d) (ii))**Advice** Offside Rear Inner Suspension component mounting prescribed area is corroded but not considered excessive sill (5.3.6 (a) (i))**Minor** Offside Front Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))**MOT #18**

2022-09-15 15:21

MOT test number

604784469316

Result

✗ Failed

Minor Nearside Registration plate lamp inoperative in the case of multiple lamps or light sources (4.7.1 (b) (i))**Advice** Offside Rear Inner Tyre slightly damaged (5.2.3 (d) (ii))**Advice** Offside Rear Inner Suspension component mounting prescribed area is corroded but not considered excessive sill (5.3.6 (a) (i))**Fail** Nearside Rear Leaf spring main leaf fractured (5.3.1 (b) (ii))**Fail** Nearside Seat belt anchorage prescribed area strength or continuity significantly reduced inner and outer sill (7.1.1 (a) (i))**Minor** Offside Front Outer Drive shaft joint constant velocity boot severely deteriorated (6.1.7 (g) (i))**Advice** Nearside Front Outer Tyre worn close to legal limit/worn on edge (5.2.3 (e))

**MOT #17** 2021-09-01 12:18**MOT test number** 488501312200**Result** ✓ Passed**Advice** Nearside Front Coil spring corroded (5.3.1 (b) (i))**Advice** Front Brake disc worn, pitted or scored, but not seriously weakened (1.1.14 (a) (ii))**Advice** Vehicle structure is corroded but structural rigidity is not significantly reduced all under van (6.1.1 (c) (i))**Advice** Offside Front Coil spring corroded (5.3.1 (b) (i))**MOT #16** 2020-09-30 09:13**MOT test number** 666277140409**Result** ✓ Passed**MOT #15** 2020-09-23 12:32**MOT test number** 521593381285**Result** ✗ Failed**Fail** Exhaust has a major leak of exhaust gases (6.1.2 (a))**Fail** Nearside Front Anti-roll bar linkage ball joint excessively worn (5.3.4 (a) (i))**Fail** Offside Front Outer Drive shaft joint constant velocity boot split or insecure, no longer prevents the ingress of dirt (6.1.7 (g) (ii))**Fail** Nearside Stop lamp(s) not working (4.3.1 (a) (ii))**MOT #14** 2019-10-04 14:16**MOT test number** 896122902485**Result** ✓ Passed**MOT #13** 2018-08-09 15:43**MOT test number** 488865693733**Result** ✓ Passed

**MOT #12** 2018-08-09 10:08**MOT test number** 379525483035**Result** ✗ Failed**Fail** Offside Front Brake pipe excessively corroded (1.1.11 (c))**Advice** Nearside Front Tyre worn close to legal limit/worn on edge edge ON LIMITS (5.2.3 (e))**Fail** Nearside Front Brake pipe excessively corroded (1.1.11 (c))**MOT #11** 2017-08-08 13:00**MOT test number** 318855219833**Result** ✓ Passed**Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**Advice** Nearside Front Tyre has a cut not in excess of the requirements deep enough to reach the ply or cords**MOT #10** 2017-08-08 08:45**MOT test number** 941520179422**Result** ✗ Failed**Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**Fail** Offside Rear Suspension spring mounting prescribed area is excessively corroded outer sill (2.4.A.3)**Advice** Nearside Front Tyre has a cut not in excess of the requirements deep enough to reach the ply or cords**MOT #9** 2016-08-23 08:26**MOT test number** 784191375964**Result** ✓ Passed**MOT #8** 2015-08-21 14:58**MOT test number** 812371097002**Result** ✓ Passed

**MOT #7** 2014-08-19 16:06**MOT test number** 665831834246**Result** ✓ Passed**MOT #6** 2013-08-08 15:41**MOT test number** 535950723225**Result** ✓ Passed**Notice** Nail in nearside rear tyre**Advice** Nearside Front Anti-roll bar linkage has slight play in a ball joint (2.4.G.2)**Notice** Nail in offside rear tyre**MOT #5** 2012-07-11 09:26**MOT test number** 469853792191**Result** ✓ Passed**MOT #4** 2012-01-18 15:43**MOT test number** 178038712081**Result** ✓ Passed**MOT #3** 2011-01-11 15:55**MOT test number** 857391211005**Result** ✓ Passed**MOT #2** 2010-01-18 14:40**MOT test number** 684158710057**Result** ✓ Passed**Advice** Offside Rear Tyre worn close to the legal limit (4.1.E.1)**Advice** Nearside Rear Tyre worn close to the legal limit (4.1.E.1)



MOT #1	2009-01-15 21:27
MOT test number	394885219061
Result	✓ Passed



Damage history

Check the damage history for this FORD. See if, where and when this FORD had damage and the car repair costs. We also check if this FORD was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	



Extra FORD salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this FORD in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this FORD? How many owners did this FORD have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date
Owner	Start date

More info >

Plate changes

See in this check if this FORD had different number plates.

Number of plates	1
Current registration	YG06OBX
Plate since	2024-03-29
Current registration	YG06OBX
Plate since	2024-03-29

More info >



Finance check

Check if this FORD is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this FORD has been settled.

If not, and you buy this FORD then you could lose the money and the car you paid for.

Download the premium report [here](#) and check if this FORD is financed.

Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	22
First mileage registration	2006-03-13
Last registration	2023-10-13
Complete history	See info



Registration #1	2006-03-13	16 mi
Registration #2	2009-01-15	21.726 mi
Registration #3	2010-01-18	30.081 mi
Registration #4	2011-01-11	38.093 mi
Registration #5	2012-01-18	46.282 mi
Registration #6	2012-07-11	48.218 mi
Registration #7	2013-08-08	51.450 mi
Registration #8	2014-08-19	54.622 mi
Registration #9	2015-08-21	59.412 mi
Registration #10	2016-08-23	64.563 mi
Registration #11	2017-08-08	67.322 mi
Registration #12	2018-08-08	65.000 mi
Registration #13	2019-08-08	65.000 mi
Registration #14	2020-08-08	65.000 mi
Registration #15	2021-08-08	65.000 mi
Registration #16	2022-08-08	65.000 mi
Registration #17	2023-08-08	65.000 mi
Registration #18	2024-08-08	65.000 mi
Registration #19	2025-08-08	65.000 mi
Registration #20	2026-08-08	65.000 mi
Registration #21	2027-08-08	65.000 mi
Registration #22	2028-08-08	65.000 mi

More info >



Car features

The FORD factory car options list is only available in the premium report.

S0225	Air conditioning
S0295	
S0482	
S0501	
S0566	
S0567	
S0569	

View the complete FORD factory list for this vehicle [here](#).

More info >

Dimensions & weight

Width	1795 mm
Kerb weight	1435 kg
Max. allowed weight	2260 kg

Additional information

Number of seats	2
Number of axles	2
Engine number	6U12002