



**HY07VTV**


report date: 2024-03-29

General information

Make	JAGUAR
Model	S-TYPE XKR
Colour	Grey
Year of manufacture	2007
Top speed	155 mph
0 - 60 mph	5.0 seconds
Gearbox	6 speed automatic

Engine & fuel consumption

Power	420 BHP
Max. torque	560 Nm at 4.000 rpm
Engine capacity	4.196 cc
Cylinders	8
Fuel type	Petrol
Consumption city	14.8 mpg
Consumption extra urban	32.8 mpg
Consumption combined	23.0 mpg
CO2 emission	294 g/km
CO2 label	M

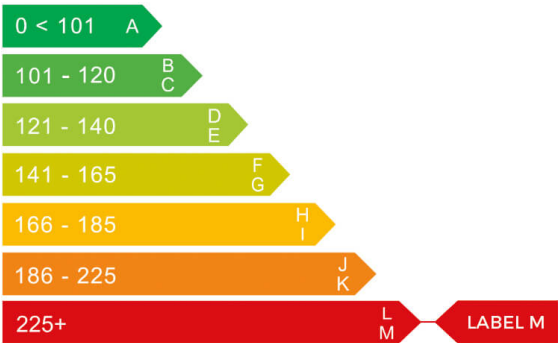



Internet history

Entry 1

Date	2021-07-10
Pictures	15
Listing price	<a href="#">View report</a>



source: autotrader.co.uk



MOT history

MOT expiry date	2025-03-28
MOT pass rate	65 %
MOT passed	15
Failed MOT tests	8
Total advice items	82
Total items failed	23

MOT #23	2024-03-08 12:41
---------	------------------

MOT test number	399596615915
-----------------	--------------

Result	✓ Passed
--------	----------

Next expiry date	2025-03-28
------------------	------------

- Advice** Offside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Advice** Oil leak, but not excessive Auto box (8.4.1 (a) (i))
- Advice** Nearside Front Tyre worn close to legal limit/worn on edge Wearing on the outer edge. 245/40R19 (5.2.3 (e))
- Minor** Windscreen damaged but not adversely affecting driver's view Stone chip in Zone B less than 40mm (3.2 (a) (i))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened Pitted lips (1.1.14 (a) (ii))
- Advice** Nearside Front Slight play felt up and down on suspension but unable to pin point the cause
- Advice** Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Advice** Oil leak, but not excessive Engine (8.4.1 (a) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge On 2mm. 275/35R19 (5.2.3 (e))
- Advice** Offside Front Tyre worn close to legal limit/worn on edge Wearing on the outer edge. 245/40R19 (5.2.3 (e))



MOT #22

2024-03-05 11:53

MOT test number

569021234631

## Result

✗ Failed

- Advice** Oil leak, but not excessive Auto box (8.4.1 (a) (i))
- Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm 275/35R19 (5.2.3 (e))
- Fail** Engine MIL inoperative or indicates a malfunction (8.2.1.2 (h))
- Advice** Nearside Front Tyre worn close to legal limit/worn on edge Wearing on the outer edge. 245/40R19 (5.2.3 (e))
- Advice** Nearside Front Play in steering rack inner joint(s)
- Advice** Nearside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Advice** Rear Brake disc worn, pitted or scored, but not seriously weakened Pitted lips (1.1.14 (a) (ii))
- Fail** Nearside Rear Upper Suspension arm ball joint excessively worn (5.3.4 (a) (i))
- Advice** Oil leak, but not excessive Engine (8.4.1 (a) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge On 2mm. 275/35R19 (5.2.3 (e))
- Fail** Nearside Front Track rod end ball joint has excessive play (2.1.3 (b) (i))
- Advice** Offside Front Tyre worn close to legal limit/worn on edge Wearing on the outer edge. 245/40R19 (5.2.3 (e))
- Advice** Offside Front Shock absorbers has light misting of oil (5.3.2 (b))
- Minor** Windscreen damaged but not adversely affecting driver's view Stone chip in Zone B less than 40mm (3.2 (a) (i))
- Fail** Nearside Rear Upper Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))
- Advice** Nearside Front Slight play felt up and down on suspension but unable to pin point the cause

**MOT #21**

2023-03-29 12:35

**MOT test number**

522330030954

**Result**

✓ Passed

- Advice** Nearside Front Play in steering rack inner joint(s)
- Advice** Nearside Front Tyre worn close to legal limit/worn on edge Feathering on the outer edge. 245/40R19 (5.2.3 (e))
- Advice** Nearside Front Track rod end ball joint has slight play (2.1.3 (b) (i))
- Advice** Offside Rear Tyre worn close to legal limit/worn on edge On 2MM. 275/35R19 (5.2.3 (e))
- Advice** Nearside Rear Nail in tyre
- Minor** Windscreen damaged but not adversely affecting driver's view Stone chip in Zone B less than 40mm (3.2 (a) (i))
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge On 1.6mm and worn on the edges. 275/35R19 (5.2.3 (e))
- Advice** Offside Front Tyre worn close to legal limit/worn on edge Feathering on the outer edge. 245/40R19 (5.2.3 (e))

**MOT #20**

2023-03-29 11:03

**MOT test number**

921856046342

**Result**

✗ Failed

- Fail** Offside Rear Tyre tread depth below requirements of 1.6mm On inner three quarter of the tyre. 275/35R19 (5.2.3 (e))
- Advice** Nearside Front Tyre worn close to legal limit/worn on edge Feathering on the outer edge. 245/40R19 (5.2.3 (e))
- Minor** Windscreen damaged but not adversely affecting driver's view Stone chip in Zone B less than 40mm (3.2 (a) (i))
- Advice** Nearside Rear Nail in tyre
- Advice** Nearside Rear Tyre worn close to legal limit/worn on edge On 1.6mm and worn on the edges. 275/35R19 (5.2.3 (e))
- Advice** Nearside Front Play in steering rack inner joint(s)
- Advice** Offside Front Tyre worn close to legal limit/worn on edge Feathering on the outer edge. 245/40R19 (5.2.3 (e))
- Advice** Nearside Front Track rod end ball joint has slight play (2.1.3 (b) (i))

**MOT #19** 2022-03-01 16:45**MOT test number** 189871524311**Result** ✓ Passed**Advice** Nearside Front Play in steering rack inner joint(s)**Advice** Nearside Front Track rod end ball joint has slight play (2.1.3 (b) (i))**Minor** Windscreen damaged but not adversely affecting driver's view Stone chip in Zone B less than 40mm (3.2 (a) (i))**MOT #18** 2022-02-25 12:14**MOT test number** 661195546939**Result** ✗ Failed**Fail** Offside Headlamp aim too low (4.1.2 (a))**Minor** Windscreen damaged but not adversely affecting driver's view Stone chip in Zone B less than 40mm (3.2 (a) (i))**Fail** Offside Rear Lower Suspension arm pin or bush excessively worn Both bushes (5.3.4 (a) (i))**Advice** Nearside Front Play in steering rack inner joint(s)**Advice** Nearside Front Track rod end ball joint has slight play (2.1.3 (b) (i))**Fail** Offside Rear Upper Suspension arm ball joint dust cover no longer prevents the ingress of dirt (5.3.4 (b) (ii))**MOT #17** 2021-03-23 14:18**MOT test number** 495176352174**Result** ✓ Passed**MOT #16** 2021-03-12 09:48**MOT test number** 743811871527**Result** ✗ Failed**Fail** Front Suspension arm pin or bush excessively worn both lower arms front pin bush (5.3.4 (a) (i))

**MOT #15** 2020-03-27 13:23**MOT test number** 388372393332**Result** ✓ Passed

**Minor** Rear Upper Suspension component ball joint dust cover severely deteriorated both sides (5.3.4 (b) (i))

**MOT #14** 2020-03-18 20:48**MOT test number** 762548320665**Result** ✗ Failed

**Fail** Rear Anti-roll bar linkage ball joint dust cover no longer prevents the ingress of dirt both (5.3.4 (b) (ii))

**Fail** Nearside Rear Tyre tread depth below requirements of 1.6mm (5.2.3 (e))

**Advice** Rear Brake pad(s) wearing thin (1.1.13 (a) (ii))

**Fail** Nearside Front Tyre tread depth below requirements of 1.6mm (5.2.3 (e))

**Fail** Rear Suspension rod ball joint dust cover no longer prevents the ingress of dirt both rear tie rods all dust covers (5.3.4 (b) (ii))

**Fail** Offside Rear Tyre has a tear, caused by separation or partial failure of its structure (5.2.3 (d) (ii))

**Minor** Rear Upper Suspension component ball joint dust cover severely deteriorated both sides (5.3.4 (b) (i))



MOT #13		2017-12-08 16:29
MOT test number		142645289593
Result		✓ Passed
Advice	Offside Rear Lower Suspension arm has slight play in a pin/bearing (2.4.G.2)	
Advice	Offside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)	
Advice	Offside Rear Shock absorber has a slightly worn shock absorber pivot (2.7.4)	
Advice	Offside rear tyre has splits to inner sidewall	
Advice	Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)	
Advice	Nearside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)	
Advice	EML on	
Advice	Front Brake pad(s) wearing thin (3.5.1g)	
Advice	Nearside rear lower arm bearing gaiters split	

**MOT #12**

2017-11-24 11:34

**MOT test number**

209311352042

**Result**

✗ Failed

- Advice** Front brake disc worn, pitted or scored, but not seriously weakened (3.5.1i)
- Advice** EML on
- Fail** Offside Stop lamp not working (1.2.1b)
- Advice** Nearside rear lower arm bearing gaiters split
- Fail** Nearside Front Tyre has a bulge, caused by separation or partial failure of its structure (4.1.D.1b)
- Advice** Nearside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)
- Advice** Front Brake pad(s) wearing thin (3.5.1g)
- Advice** Offside Rear Lower Suspension arm has slight play in a pin/bearing (2.4.G.2)
- Advice** Offside rear tyre has splits to inner sidewall
- Fail** Headlamp cleaning device inoperative (1.7.2)
- Advice** Offside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)
- Advice** Offside Rear Shock absorber has a slightly worn shock absorber pivot (2.7.4)

**MOT #11**

2016-11-30 15:26

**MOT test number**

962254772138

**Result**

✓ Passed

- Advice** Offside Rear Suspension arm has slight play in a pin/bearing (2.4.G.2)
- Advice** Offside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)
- Advice** Offside Rear Shock absorber has a slightly worn shock absorber pivot (2.7.4)
- Advice** Nearside rear lower arm bearing dust cover split
- Advice** Rear Brake pad(s) wearing thin (3.5.1g)
- Advice** Nearside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)

**MOT #10** 2015-11-13 12:03**MOT test number** 110084868648**Result** ✓ Passed**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**MOT #9** 2014-11-06 16:44**MOT test number** 308710014309**Result** ✓ Passed**Notice** Wiperblades split**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**MOT #8** 2014-11-06 11:34**MOT test number** 986210314383**Result** ✗ Failed**Notice** Wiperblades split**Fail** Offside Front Tyre has a cut in excess of the requirements deep enough to reach the ply or cords (4.1.D.1a)**Notice** E.M.L on**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**MOT #7** 2013-11-08 13:39**MOT test number** 977502413390**Result** ✓ Passed**Advice** Rear Brake pad(s) wearing thin (3.5.1g)**Notice** Wipers poor

**MOT #6** 2012-11-15 14:12**MOT test number** 656410622392**Result** ✓ Passed**Advice** Windscreen has damage to an area less than a 40mm circle outside zone 'A' (8.3.1d)**Advice** Offside Rear Tie bar/rod ball joint dust cover deteriorated, but preventing the ingress of dirt (2.4.G.2)**Notice** Front wipers smearing slightly**Advice** Offside Rear Shock absorber has a slightly worn bush (2.7.4)**MOT #5** 2012-11-06 11:05**MOT test number** 465681512435**Result** ✓ Passed**Notice** Note: Rear tyres wearing more to inner edges**MOT #4** 2011-11-15 14:49**MOT test number** 958009611357**Result** ✓ Passed**MOT #3** 2011-03-24 09:27**MOT test number** 196883781418**Result** ✓ Passed**MOT #2** 2010-03-24 09:44**MOT test number** 111733580454**Result** ✓ Passed



MOT #1	2010-03-22 16:23
MOT test number	510411580083
Result	✗ Failed
Fail	Nearside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)
Fail	Nearside Front Tyre has a lump, caused by separation or partial failure of its structure (4.1.D.1b)
Fail	Offside Rear Tyre tread depth below requirements of 1.6mm (4.1.E.1)
Fail	Offside Front Tyre has a lump, caused by separation or partial failure of its structure (4.1.D.1b)



Tax & MOT check

✓  
**Taxed**  
**Tax due:**  
1 March 2025

✓  
**MOT**  
**Expires:**  
28 March 2025

<b>Tax status</b>	Valid until 1 March
<b>Days left</b>	307
<b>MOT expiry date</b>	28 March 2025
<b>Full MOT history</b>	<a href="#">See MOT history</a>

Tax calculation

<b>Vehicle class</b>	48
<b>Band</b>	M
<b>Single payment (12 months)</b>	£ 695,00,-
<b>Single six month payment</b>	£ 382,25,-
<b>Total payable by 12 monthly instalments</b>	£ 729,75,-



Damage history


Check the damage history for this JAGUAR. See if, where and when this JAGUAR had damage and the car repair costs. We also check if this JAGUAR was scrapped. Download the premium report [here](#) for the results.

Damage 1

Date	
Category	
Type	

Damage 2

Date	
Category	
Type	

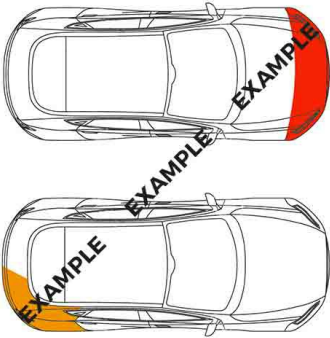

Extra JAGUAR salvage check



If this vehicle was seen at a salvage auction we offer: vehicle pictures, salvage location, retail value. Download the premium report [here](#) for more information.

More info >



Vehicle valuation

What is this car worth? See the vehicle value of this JAGUAR in the premium report. We check: purchase value, age, mileage, MOT history, damages and online sale prices.

Trade retail value	£ 19,999
Auction value	£ 19,999
Average private trade value	£ 19,999

More info >



Owner history

For how long did the current and previous owner(s) have this JAGUAR? How many owners did this JAGUAR have? Check it in the premium report and see all owner registrations. Download the full report [here](#).

Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since
Owner	Since

More info >

Plate changes

See in this check if this JAGUAR had different number plates.

Number of plates	1
Current registration	<b>XXXXXX</b>
Plate since	2024-03-29
Current registration	<b>XXXXXX</b>
Plate since	2024-03-29

More info >



Finance check

Check if this JAGUAR is financed, has an outstanding loan or finance agreement. If you are purchasing a vehicle it is smart to ensure that any finance that may have been taken out on this JAGUAR has been settled. If not, and you buy this JAGUAR then you could lose the money and the car you paid for. Download the premium report [here](#) and check if this JAGUAR is financed.


Finance company	XXXXXXXXXX	XXXX
Date of agreement	XXXXXXXXXX	XXXX
Agreement type	XXXXXXXXXX	XXXX
Agreement term	XXXXXXXXXX	XXXX
Agreement number	XXXXXXXXXX	XXXX
Contact info	XXXXXXXXXX	XXXX

More info >



Mileage check

Odometer	In miles
Mileage registrations	25
First mileage registration	2007-03-01
Last registration	2024-03-08
Complete history	<a href="#">See info</a>

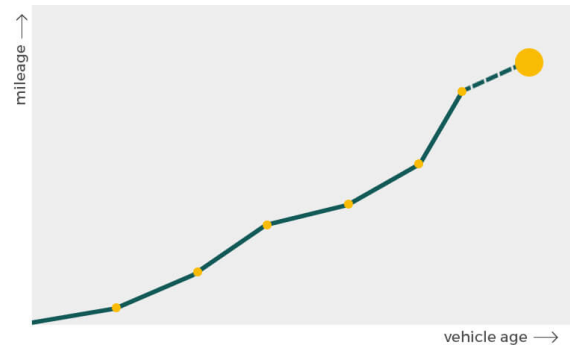

Registration #1	2007-03-01	26 mi
Registration #2	2010-03-22	46.598 mi
Registration #3	2010-03-24	46.598 mi
Registration #4	2011-03-24	60.336 mi
Registration #5	2011-11-15	66.843 mi
Registration #6	2012-11-06	68.176 mi
Registration #7	2012-11-15	68.197 mi
Registration #8	2013-11-08	68.978 mi
Registration #9	2014-11-06	69.788 mi
Registration #10	2014-11-06	69.788 mi
Registration #11	2015-11-13	71.086 mi
Registration #12	2016-11-30	72.765 mi
Registration #13	2017-11-24	76.672 mi
Registration #14	2018-03-22	76.672 mi
Registration #15	2018-03-22	76.672 mi
Registration #16	2018-03-22	76.672 mi
Registration #17	2018-03-22	76.672 mi
Registration #18	2018-03-22	76.672 mi
Registration #19	2018-03-22	76.672 mi
Registration #20	2018-03-22	76.672 mi
Registration #21	2018-03-22	76.672 mi
Registration #22	2018-03-22	76.672 mi
Registration #23	2018-03-22	76.672 mi
Registration #24	2018-03-22	76.672 mi
Registration #25	2018-03-22	76.672 mi



Safety ratings

NCAP rating	★★★★☆
Video	<a href="#">see crash video</a>



Dimensions & weight

Width	1892 mm
Height	1329 mm
Length	4794 mm
Wheel base	2752 mm
Kerb weight	1715 kg
Max. allowed weight	2120 kg

Additional information

Fuel tank capacity	70 l
Fuel delivery	Multi-Point Injection
Number of doors	2
Number of seats	4
Engine number	07020117059G